



self evaluation and transition plan

APPENDICES

MARCH 2015

Appendices

- Appendix A: Program Accessibility Questionnaire
- Appendix B: Public Meeting Minutes
- Appendix C: Facility Reports for City Buildings and Parks
- Appendix D: Public Rights-of-Way Reports for City Facilities
- Appendix E: Grievance Form

Appendix A: Program Accessibility Questionnaire

1. Introduction: Americans with Disabilities Act Programs, Services, and Activ...

BACKGROUND:

The City of Cupertino is preparing an Americans with Disabilities Act (ADA) Self-Evaluation and Transition Plan. As part of this process, you are requested to complete a self-assessment questionnaire that addresses the availability of programs, services, and activities for the public. Examples of programs, services, and activities include: obtaining a permit, participating in a City recreational program, or attending a public meeting such as a City Council meeting.

While some of the questions relate to City of Cupertino employee actions and training, the Self-Evaluation does not address employee-related work issues, which are covered in Title I of the ADA. All questions should be answered as they pertain to services, programs, and activities provided to the public.

Topics addressed in the Program Accessibility Questionnaire include:

- Description of Program Activities
- Accessible/Adaptive Equipment
- Customer Service
- Notice Requirements
- Printed Information
- Television and Audiovisual Public Information
- Website
- Public Telephones and Communication Devices
- · Training and Staffing
- Program Eligibility Requirements and Admission
- Public Meetings
- Transportation Services
- Tours and Trips
- Use of Consultants
- Emergency Evacuation Procedures
- Facilities
- · Special Events and Private Events on City Properties

This survey will take about 20-25 minutes to complete. Please respond to the survey by Friday, May 30, 2014. Responses will be sent directly to MIG. If you have any questions or need further assistance, please contact Ashley Tomerlin at (510)845-7549 or ashleyt@migcom.com.

2. General description of the programs

"Programs" refers to programs, activities and services offered to the public.

Each City department or program that provides direct public service should complete a survey. For example, the Community Development Department would complete one survey for its Planning Division, one for its Building Division and another for its Engineering Division.

If you have questions about how many surveys to complete, please email Ashley Tomerlin, ashleyt@migcom.com, or call (510) 845-7549.


***1.** Name of Department/Division:

*2. Name and title of person completing this questionnaire:

*****3. Telephone number:

4. Email:

***5.** Program name(s) and brief description of what your program does:

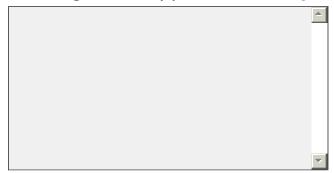

***6.** Date program questionnaire filled out:

MM

Date:

DD YYYY / / /

3. ACCESSIBLE/ADAPTIVE EQUIPMENT

*1. Do you allow members of the public to use electronic equipment such as copying machines, personal computers?

- O Yes
- No
- C Don't know
- O Not applicable

If yes, please describe the electronic equipment the public is allowed to use:

	
	~
	*

4. ACCESSIBLE/ADAPTIVE EQUIPMENT - CONTINUED

*1. Do you ensure that electronic equipment is accessible to and usable by individuals with disabilities? For example, is microfiche provided on a lowered counter or a kiosk is located in an accessible workstation.

\bigcirc	Yes
0	No
0	Don't know
0	Not applicable
lf ye	s please describe how you ensure that the equipment is accessible:
	×

***2.** Are auxiliary aids (such as a moveable light source, adjustable worktable levels, paper and pen, etc.) provided to assist persons with disabilities?

۸.

- O Yes
- O No
- C Don't know
- O Not applicable

If yes, please describe.

5. CUSTOMER SERVICE

*1. If a department has a program that has eligibility requirements for participation, do they contain any of the following?

For example, your department offers a volunteer program to the public that would require an individual to meet specific physical fitness standards such as lifting 40 lbs or walking up and down stairs.

	There are no eligibility requirements
	Don't know
	Physical fitness standards
	Mental fitness
	Performance requirements
	Safety Standards
If ye	es, how do you you ensure that these policies do not discriminate against people with disabilities?
реі	2. Does your department make changes to standard operating procedures to include a rson with disabilities? For example, allowing someone to bring a personal attendant th them to a recreation class or moving an event to an accessible location?
O	
0	Yes
	No
O	
0 0	Νο
	No Don't know

City of Cupertino Programs, Activities, and Services Accessibility Survey
$m{st}$ 3. Is there a formal procedure for making changes to standard operating procedures?
⊙ Yes
© No
C Don't know
C Not applicable
If yes, please describe the procedure.
*4. Do you track accessibility requests?
○ Yes
© No
C Don't know
© Not applicable
If yes, please list how many requests have you received and what the requests were for.
$m{\star}$ 5. Does your program charge an additional fee for people with disabilities for modifying
programs?
© Yes
© No
C Don't know

O Not applicable

If yes, please describe.

<u>۸</u>
~

*6. Does your department consult or work with any outside organizations or groups that assist people with disabilities such as the a Center for Independent Living or Senior Citizen's advocacy group?

- YesNoDon't know
- O Not applicable

If yes, please list the organizations.

7. Does your department have any policies which exclude service animals, such as service dogs for the blind or signal dogs for the hearing impaired?

<u>.</u>

O Yes

- No
- O Don't know
- O Not applicable

If yes, please describe your policy on service animals.

	۸.
	~

6. NOTICE REQUIREMENTS


* 1. C	Do you have a n	on-discrimination	statement that	includes persons	with disabilities?
---------------	-----------------	-------------------	----------------	------------------	--------------------

0	Yes	
0	No	
0	Don't know	
0	Not applicable	
Comments:		

*2. Is a non-discrimination statement that includes information about how to reach the ADA coordinator posted in all departments in a location that maximizes public exposure?

- O No
- O Don't know
- C Not applicable

 If yes, please describe where the non-discrimination statement is posted.



***3.** Do you notify all persons that your meetings, hearings, interviews, and conferences will be held in accessible locations and that adaptive/auxiliary aids (such as assistive listening devices, readers for the blind, pen and paper) will be provided, upon request, to participants with disabilities?

- O Yes
- No
- O Don't know
- O Not applicable

*4. Do you know the procedure for filing a disability discrimination complaint?

▲

O Yes

- O No
- O Don't know

If yes, please describe the procedure for filing a discrimination complaint.

-

 
C Yes

No

- C Don't know
- O Not applicable

If yes, please describe the process here.

discrimination complaint?



7. PRINTED INFORMATION

*1. Does your department produce printed materials that are made available to the public?

- O Yes
- O No
- C Don't know
- O Not applicable

PRINTED INFORMATION - CONTINUED *1. Who manages your printed materials? My department manages printed material Printed materials are managed centrally Both departmental and central management Don't know Comments: *2. How do you make documents and publications available to individuals with visual disabilities? (check all that apply): Do not provide any alternative formats upon request Don't know Don't know duditape Electronic Copy targe print Other: please list *3. Do you make the content of documents and publications available in simple, easy-t understand language for individuals with learning disabilities? Yes No Don't know		es, and Services Accessibility Surve
 My department manages printed material Printed materials are managed centrally Both departmental and central management Don't know Comments: *2. How do you make documents and publications available to individuals with visual lisabilities? (check all that apply): Do not provide any alternative formats upon request Don't know Audiotape Braille Electronic Copy Large print *3. Do you make the content of documents and publications available in simple, easy-t understand language for individuals with learning disabilities? Yes No Don't know 	PRINTED INFORMATION - CONTINU	JED
 Printed materials are managed centrally Both departmental and central management Don't know Comments: *2. How do you make documents and publications available to individuals with visual disabilities? (check all that apply): Do not provide any alternative formats upon request Don't know Audiotape Braille Electronic Copy Large print Cher: please list *3. Do you make the content of documents and publications available in simple, easy-to inderstand language for individuals with learning disabilities? Yes No Don't know 	^k 1. Who manages your printed materials	?
 Both departmental and central management Don't know Comments: *2. How do you make documents and publications available to individuals with visual disabilities? (check all that apply): Do not provide any alternative formats upon request Don't know Audiotape Braille Electronic Copy Large print Other: please list *3. Do you make the content of documents and publications available in simple, easy-transferstand language for individuals with learning disabilities? Yes No Don't know 	O My department manages printed material	
Don't know Comments:	O Printed materials are managed centrally	
Comments: *2. How do you make documents and publications available to individuals with visual lisabilities? (check all that apply): Do not provide any alternative formats upon request Don't know Audiotape Braille Electronic Copy Large print Other: please list *3. Do you make the content of documents and publications available in simple, easy-t understand language for individuals with learning disabilities? Yes No Don't know	O Both departmental and central management	
 *2. How do you make documents and publications available to individuals with visual lisabilities? (check all that apply): Do not provide any alternative formats upon request Don't know Audiotape Braille Electronic Copy Large print Other: please list *3. Do you make the content of documents and publications available in simple, easy-t understand language for individuals with learning disabilities? Yes No Don't know 	C Don't know	
tissbilities? (check all that apply): Do not provide any alternative formats upon request Don't know Audiotape Braille Electronic Copy Large print Other: please list * 3. Do you make the content of documents and publications available in simple, easy-t understand language for individuals with learning disabilities? Yes Yes No Don't know	Comments:	
Iiisabilities? (check all that apply): o not provide any alternative formats upon request Don't know Audiotape Braille Electronic Copy Large print Ther: please list		
 Don't know Audiotape Braille Electronic Copy Large print Other: please list *3. Do you make the content of documents and publications available in simple, easy-tauderstand language for individuals with learning disabilities? Yes No Don't know 	lisabilities? (check all that apply):	
 Audiotape Braille Electronic Copy Large print Other: please list *3. Do you make the content of documents and publications available in simple, easy-tunderstand language for individuals with learning disabilities? Yes No Don't know 		
 Braille Electronic Copy Large print Other: please list * 3. Do you make the content of documents and publications available in simple, easy-tunderstand language for individuals with learning disabilities? Yes No Don't know 		
 Electronic Copy Large print Other: please list *3. Do you make the content of documents and publications available in simple, easy-tunderstand language for individuals with learning disabilities? Yes No Don't know 		
 Large print Other: please list * 3. Do you make the content of documents and publications available in simple, easy-t understand language for individuals with learning disabilities? Yes No Don't know 		
Other: please list *3. Do you make the content of documents and publications available in simple, easy-tenderstand language for individuals with learning disabilities? Yes No Don't know	Electronic Copy	
*3. Do you make the content of documents and publications available in simple, easy-t understand language for individuals with learning disabilities? Yes No Don't know	Large print	
 Anderstand language for individuals with learning disabilities? Yes No Don't know 	Other: please list	
 Anderstand language for individuals with learning disabilities? Yes No Don't know 		
C Don't know	Inderstand language for individuals with	
	C No	
Comments:	C Don't know	
	Comments:	

*4. Does your department include images of people with disabilities?

C Yes, we include photos of people with disabilities

- O No, we include photos of people, but do not show any images of people with disabilities.
- O Do not include any photos of people in publications
- C Don't know
- Comments:

9. TELEVISION AND AUDIOVISUAL INFORMATION

*1. Does your department prepare audiovisual or televised presentations or website demonstrations/webinars for the public or make audiovisual presentations to the public?

- O Yes
- No
- O Don't know
- O Not applicable

City of Cupertino Programs, Activities	, and Services Accessibility Survey
10. TELEVISION AND AUDIOVISUAL INI	FORMATION - CONTINUED
*1. How do you make audiovisual or televis presented by your department to the public a Please check all that apply.	
Captioning	
Transcription	
Do not provide alternative formats upon request	
Please list other alternative formats:	
st2. What type of audiovisual presentations	(film, videotape, television) does your
department provide?	
	presentations, do you also portray individuals
with disabilities in your audiovisual presenta	ations?
⊙ Yes	
C No	
C Don't know	
Comments:	

11. WEBSITE

*1. Does your department have a website?


- O Yes
- No
- C Don't know
- O Not applicable

If yes, please list the website:

12. WEBSITE - CONTINUED

*1. What information is provided on this site?

*2. Does your department's website include information about accessibility of facilities (parking, bathrooms, assistive listening devices, etc.) where programs or services are offered?

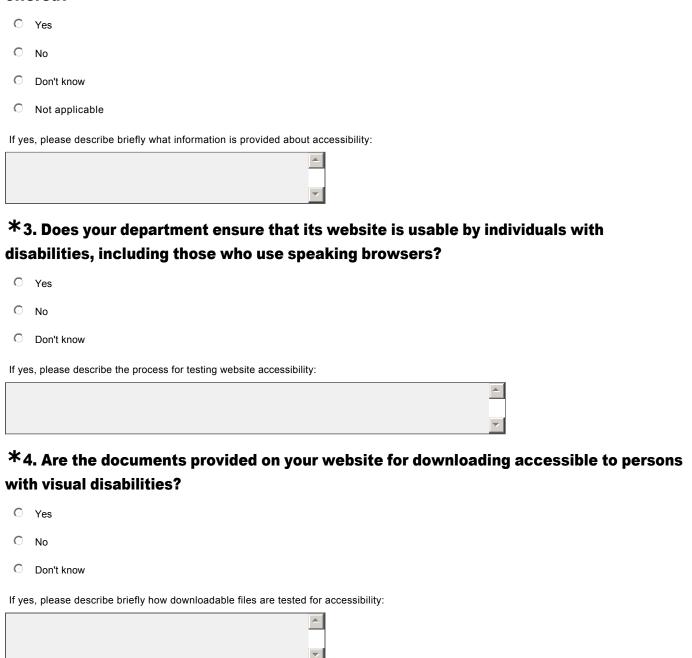

*5. Is information regarding your departments facilities, programs and services created and managed by the department or by others?

- O By others?
- O By the department?
- A combination?

Please describe.

ity of Cupertino Prog	rams, Activities, and Services Accessibility Survey
3. PUBLIC TELEPHON	IES AND COMMUNICATION DEVICES
*1. Do you communicate	e by telephone with individuals with hearing or speech
O Yes	
O No	
C Don't know	
O Not applicable	
Comments:	
2. Have you ever used a T	ext Telephone (TTY) to communicate with the deaf?
C Yes	,
O No	
C Don't know	
*3. Do any staff member	rs use the California Relay Service (711)?
C Yes	
C No	
C Don't know	
Comments:	
*	
↑4. Do you publish your where a phone number is	TTY number or California Relay Service numbers in all materials
© No	
O Don't know	
Comments:	

*5. Do you train your staff in operating a TTY or other means of telephone with a person with a hearing or speech disability?	communicating over the
O Yes	
O No	
C Don't know	
Comments:	

14. TRAINING AND STAFFING

***1.** Do any staff members have contact with the public?

- O Yes
- O No
- O Don't know
- O Not applicable

Comments:

*2. How do you inform staff members who have contact with the public of your department's obligations and policies that enable persons with disabilities to participate in programs or activities?

***3.** Do your staff receive training on interacting with people with disabilities?

▲.

- C Yes, staff training provided
- O Don't know
- C No, staff do not receive training

If yes, please describe your staff training process:

*****4. Are there staff members in your department who provide emergency services to the public?

- O Yes
- O No
- O Don't know
- O Not applicable

If yes, have they had training in American Sign Language or other means of communicating in emergency situations with people who have hearing or speech impairments?

*5. Are there other staff members who would be able to provide better customer service if they had training in American Sign Language (ASL) or other means of communicating with people who have hearing impairments?

- C Yes
- O No
- C Don't know
- O Not applicable

If yes, please list staff who would benefit from receiving emergency American Sign Language training:

15. PROGRAM ELIGIBILITY REQUIREMENTS AND ADMISSION

*1. Are there any limitations or ratios for the number of people with disabilities who may participate in or be admitted to any department program? For example exams, testing for level of ability, age requirements, etc.

\mathbf{O}	Yes	
O	No	
O	Don't know	
0	Not applicable	
lf ye	s, please describe the limitations and programs:	
		-

***2**. Does your program use any criteria (for example good health, residency, letters of recommendation) or written and/or oral tests (including level of skill or achievement, or other factor being tested) in the admissions process?

- O Yes
- No
- C Don't know
- O Not applicable

If yes, please list the participation requirements.

*****3. Are there any forms required for admission to the program (for example, tests and/or the submission of other admissions criteria such as certificates?).

- C Yes
- O No
- O Don't know
- O Not applicable

If yes, please send sample forms to ashleyt@migcom.com.

*4	. Do the forms contain a notice that the City does not discriminate against people with
disa	abilities?
0	Yes
0	No
0	Don't know
0	Not applicable
Com	ments:
*5	. Is an interview required prior to an applicant's entrance into the program?
0	Yes

- No
- O Don't know
- O Not applicable

16. PUBLIC MEETINGS

*1. Does your department hold public meetings?

- O Yes
- No
- O Don't know
- O Not applicable

City of Cupertino Programs, Activities, and Services Accessibility Survey
17. PUBLIC MEETINGS - CONTINUED
st1. Do you require that public meetings, hearings, and conferences be held in accessible locations?
© Yes
○ No
O Don't know
Comments:
*2. Are American Sign Language interpreters, readers, or adaptive equipment provided when requested for meetings, interviews, and conferences? \circ
© No
O Don't know
If yes, how much advanced notice is required to provide accomodations?
$m{st}$ 3. Do you ensure that all individuals with hearing disabilities who do not read sign
language can participate effectively in meetings, conferences, and hearings via assistive
listening devices or other means?
C Yes

\odot	No	

O Don't know

18. TRANSPORTATION SERVICES

*1. Do you provide transportation to volunteers, program participants, visitors, and others who participate in your programs?

- O Yes
- No
- O Don't know
- O Not applicable

Please describe.

19. TRANSPORTATION SERVICES - CONTINUED

st1. Do you have procedures to make transportation accessible to persons who have	e
visual disabilities?	

0	Yes	
0	No	

O Don't Know

16	-	doooribo	th a	mrs as duras
it yes,	please	describe	the	procedures.

*2. Do you have procedures to make transportation accessible to persons who have hearing disabilities?

- O Yes
- No
- O Don't Know

If yes, please describe the procedures.	If ves.	please	describe	the	procedures.
---	---------	--------	----------	-----	-------------

*3. Do you have procedures to make transportation accessible to persons who have mobility disabilities?

- O Yes
- No
- O Don't Know

If yes,	please	describe	the	procedures.
,,	p.0000			p. 000 a a. 00.

*4. Do you have procedures to make transportation accessible to persons who have learning disabilities?

⊙ Yes
O No
O Don't Know
If yes, please describe the procedures.

20. TOURS AND TRIPS

*1. Does your department provide facility tours or organize trips for members of the public?

- O Yes
- No
- O Don't know
- O Not applicable

If yes, please list the tours and trips.

21. TOURS AND TRIPS - CONTINUED

*1. Do you have procedures to make tours and trips accessible to persons who have visual disabilities?

- No
- O Don't Know

If yoo	nlagon	docoribo	tho	procedures.
II yes,	please	uescibe	uie	procedures.

***2.** Do you have procedures to make tours and trips accessible to persons who have hearing disabilities?

\odot	Yes

- No
- O Don't Know

If ve	as	please	describe	the	procedures.
	,	picaco	40001100		procoduroo.

*3. Do you have procedures to make tours and trips accessible to persons who have mobility disabilities?

O Yes

- No
- O Don't Know

If yes,	please	describe	the	procedures
,,				P

*4. Do you have procedures to make tours and trips accessible to persons who have learning disabilities?

22. CONSULTANTS

f st 1. Do you use consultants to conduct programs on behalf of your department?

- Yes
- O No
- O Don't know
- O Not applicable

If yes, please list what consultants.

23. CONSULTANTS - CONTINUED

*1. Do you ensure that consultants are aware of their obligations to facilitate participation of individuals with disabilities in programs or activities operated on behalf of your department?

- O Yes
- O No
- O Don't know
- O Not applicable

If yes, please describe the procedures.

*2. Do you monitor this obligation?

- O Yes
- No
- O Don't know
- O Not applicable

If yes, please describe your department's procedure:

24. EMERGENCY EVACUATION PROCEDURES

*1. Do you notify individuals with visual disabilities of emergencies and evacuation procedures?

- O Yes
- No
- O Don't Know

If yes, describe the equipment and/or procedures do you use to notify individuals with visual disabilities of emergencies and evacuation procedures:

*2. Do you notify individuals with hearing disabilities of emergencies and evacuation procedures?

- C Yes
- No
- O Don't Know

If yes, describe the equipment and/or procedures do you use to notify individuals with hearing disabilities of emergencies and evacuation procedures:

*3. Do you notify individuals with mobility disabilities of emergencies and evacuation procedures?

- O Yes
- No
- O Don't Know

If yes, describe the equipment and/or procedures do you use to notify individuals with mobility disabilities of emergencies and evacuation procedures:




*4. Do you notify individuals with learning disabilities of emergencies and evacuation procedures?

- O Yes
- O No
- O Don't Know

If yes, describe the equipment and/or procedures do you use to notify individuals with learning disabilities of emergencies and evacuation procedures:

25. FACILITIES

*1. List all facilities, or portions of facilities, used for department programs. For each facility, designate the activity for which it is used. (Note: Facilities leased or otherwise used from another person/organization should also be included).

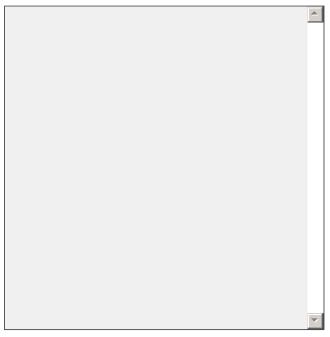

*2. Have you had requests for improving accessibility to your department's programs or facilities?

- O Yes
- No
- O Don't know
- O Not applicable

If yes, please describe how many requests and what the requests were for.



26. SPECIAL EVENTS AND PRIVATE EVENTS ON PUBLIC PROPERTIES

*1. Does your department organize special events or do you help facilitate private events on City property such as a park or City building?

- O Yes
- No
- O Don't know
- O Not applicable

If yes, please describe briefly the type of event and what types of outside organizations are involved.

27. SPECIAL EVENTS AND PRIVATE EVENTS ON PUBLIC PROPERTIES - CONTINUED

*1. Do you ensure that both private entities and your staff are aware of their obligations to facilitate participation of individuals with disabilities in these special events or private events held on public property?

- O Yes
- No
- O Don't Know
- Not applicable

If yes, please describe your department's procedures.

	≜.	
	•	

28. LAST QUESTION

1. Thank you for completing this survey. This is the last question on the survey.

Do you have any accessibility questions for us? Please use this box below for any other questions or comments.

When you are done with the survey, please click on the "done" button. Once you click on the "done" button, you will not be able to edit or change your answers to this survey.



Q1 Name of Department/Division:

#	Responses	Date
1	City Attorney's Office	6/18/2014 12:18 PM
2	Public Works Engineering	6/18/2014 10:04 AM
3	Technology Department/IT Division	6/5/2014 4:41 PM
4	City Clerk	6/4/2014 8:54 PM
5	Administrative Services / Human Resources	6/3/2014 5:02 PM
6	Administrative Services and City Manager	6/3/2014 3:54 PM
7	Grounds	5/30/2014 10:05 AM
8	Public Works - Maintenance	5/23/2014 12:26 PM
9	Community Development / Building	5/22/2014 8:41 AM
10	Parks and Recreation	5/21/2014 10:49 AM
11	Facilities	5/14/2014 7:45 AM

Q2 Name and title of person completing this questionnaire:

#	Responses	Date
1	Colleen Winchester	6/18/2014 12:18 PM
2	Chad Mosley, Senior Engineer	6/18/2014 10:04 AM
3	Mariyah Serratos	6/5/2014 4:41 PM
4	Grace Schmidt City Clerk	6/4/2014 8:54 PM
5	May Sui, HR Asisstant	6/3/2014 5:02 PM
6	Kristina Alfaro Interim Director of Administrative Services	6/3/2014 3:54 PM
7	John Bisely	5/30/2014 10:05 AM
8	Roger Lee, Assistant Director of Public Works	5/23/2014 12:26 PM
9	Sean Hatch / Building Inspector	5/22/2014 8:41 AM
10	Karen Levy	5/21/2014 10:49 AM
11	Chris Orr	5/14/2014 7:45 AM

Q3 Telephone number:

#	Responses	Date
1	(408) 777-3404	6/18/2014 12:18 PM
2	4087777604	6/18/2014 10:04 AM
3	408-777-3189	6/5/2014 4:41 PM
4	408-777-3224	6/4/2014 8:54 PM
5	408-777-3380	6/3/2014 5:02 PM
6	777 7608	6/3/2014 3:54 PM
7	408-777-3270	5/30/2014 10:05 AM
8	1-408-777-3350	5/23/2014 12:26 PM
9	408-777-3231	5/22/2014 8:41 AM
10	408-777-3123	5/21/2014 10:49 AM
11	408 777 3272	5/14/2014 7:45 AM

Q4 Email:

#	Responses	Date
1	colleenw@cupertino.org	6/18/2014 12:18 PM
2	mariyahs@cupertino.org	6/5/2014 4:41 PM
3	graces@cupertino.org	6/4/2014 8:54 PM
4	mays@cupertino.org	6/3/2014 5:02 PM
5	kristinaa@cupertino.org	6/3/2014 3:54 PM
6	Johnb@cupertino.org	5/30/2014 10:05 AM
7	Rogerl@cupertino.org	5/23/2014 12:26 PM
8	seanh@cupertino.org	5/22/2014 8:41 AM
9	karenl@cupertino.org	5/21/2014 10:49 AM
10	chriso@cupertino.org	5/14/2014 7:45 AM

Q5 Program name(s) and brief description of what your program does:


#	Responses	Date
1	The City Attorney's Office is the legal counsel to the City Council, City Commissions, City Manager and staff.	6/18/2014 12:18 PM
2	Reviews Development Projects for the Public Works Department. Interact with the Public over the counter. Perform traffic engineering functions.	6/18/2014 10:04 AM
3	The IT Division supports all related computing, networking, business applications installation, configuration, maintenance and support.	6/5/2014 4:41 PM
4	City Council agendas and legislative actions Public Records requests City Council elections Boards and Commissions Legal noticing Customer service ETC. :-)	6/4/2014 8:54 PM
5	Human Resources: - Recruitment and Employee Retention - Benefit Programs - Payroll Changes - Employee Training and Development - Performance Evaluations - Employee Relations - Negotiations - Risk Management	6/3/2014 5:02 PM
6	Finance - administers payroll, a/p, a/r and budget and financial reporting Human Resources - handles recruitment, policy, retention, training, workers' compensation, employee relations	6/3/2014 3:54 PM
7	Maintenance	5/30/2014 10:05 AM
8	Public works maintenance is responsible for the divisions of Facilities, Grounds (parks and sport fields - we do not program recreational activities), Trees & Right of Way (street trees and medians), Streets (pavement signs and markings, storm drain, street lights and hazardous materials) and Fleet	5/23/2014 12:26 PM
9	The processing of building permits for any new construction, alterations, and additions to residential and commercial developments within the city limits.	5/22/2014 8:41 AM
10	See department website: http://www.cupertino.org/index.aspx?page=177	5/21/2014 10:49 AM
11	Maintain Buildings	5/14/2014 7:45 AM

Q6 Date program questionnaire filled out:

Answer Choices	Responses	
Date:	100.00%	11

#	Date:	Date
1	06/17/2014	6/18/2014 12:18 PM
2	06/18/2014	6/18/2014 10:04 AM
3	06/05/2014	6/5/2014 4:41 PM
4	06/04/2014	6/4/2014 8:54 PM
5	06/03/2014	6/3/2014 5:02 PM
6	06/03/2014	6/3/2014 3:54 PM
7	03/30/2014	5/30/2014 10:05 AM
8	05/23/2014	5/23/2014 12:26 PM
9	05/22/2014	5/22/2014 8:41 AM
10	05/21/2014	5/21/2014 10:49 AM
11	05/14/2014	5/14/2014 7:45 AM


Q7 Do you allow members of the public to use electronic equipment such as copying machines, personal computers?

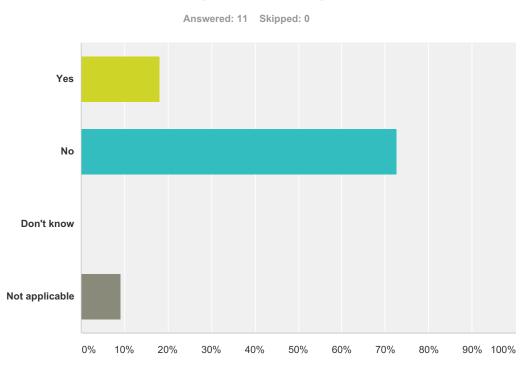

Answer Choices	Responses	
Yes	18.18%	2
No	72.73%	8
Don't know	0.00%	0
Not applicable	9.09%	1
Total		11

#	If yes, please describe the electronic equipment the public is allowed to use:	Date
1	Only Block Leaders can use our copy machine. We don't allow any other members of the public to use any equipment.	6/4/2014 8:54 PM
2	Computer lab (pc's and apple computers) at the Senior Center computer lab	5/21/2014 10:53 AM


Q8 Do you ensure that electronic equipment is accessible to and usable by individuals with disabilities? For example, is microfiche provided on a lowered counter or a kiosk is located in an accessible workstation.

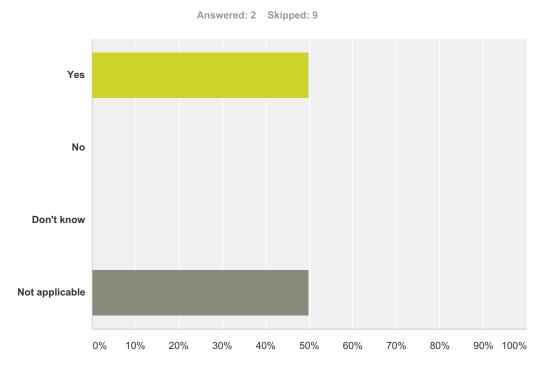

Answer Choices	Responses
Yes	50.00% 1
No	0.00% 0
Don't know	0.00% 0
Not applicable	50.00% 1
Total	2

#	If yes please describe how you ensure that the equipment is accessible:	Date
1	adjustable tables	5/21/2014 10:54 AM


Q9 Are auxiliary aids (such as a moveable light source, adjustable worktable levels, paper and pen, etc.) provided to assist persons with disabilities?

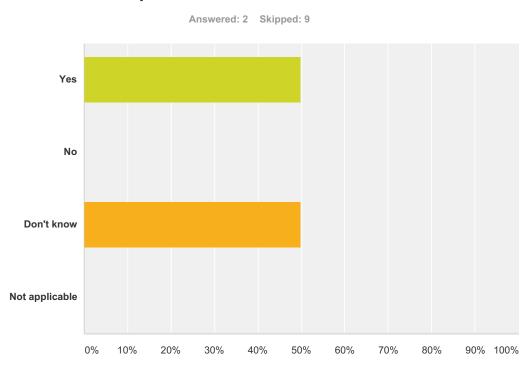

Answer Choices	Responses
Yes	50.00% 1
No	0.00% 0
Don't know	50.00% 1
Not applicable	0.00% 0
Total	2

#	If yes, please describe.	Date
1	provided when requested	5/21/2014 10:54 AM

Q10 If a department has a program that has eligibility requirements for participation, do they contain any of the following? For example, your department offers a volunteer program to the public that would require an individual to meet specific physical fitness standards such as lifting 40 lbs or walking up and down stairs.

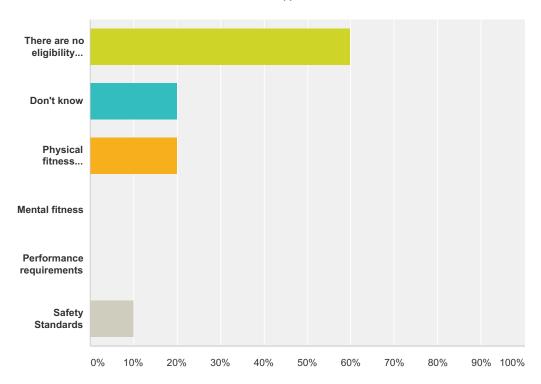

Answer Choices	Responses
There are no eligibility requirements	60.00% 6
Don't know	20.00% 2
Physical fitness standards	20.00% 2
Mental fitness	0.00% 0
Performance requirements	0.00% 0
Safety Standards	10.00% 1
Total Respondents: 10	


#	If yes, how do you you ensure that these policies do not discriminate against people with disabilities?	Date
1	The department does not offer programs.	6/18/2014 12:54 PM
2	I trust our HR Department to guide us through developing minimum requirements for recruitment.	6/5/2014 4:44 PM

We ask people with disabilities to self-identify so that we can make reasonable accommodations.

3

6/3/2014 5:06 PM


Q11 Does your department make changes to standard operating procedures to include a person with disabilities? For example, allowing someone to bring a personal attendant with them to a recreation class or moving an event to an accessible location?

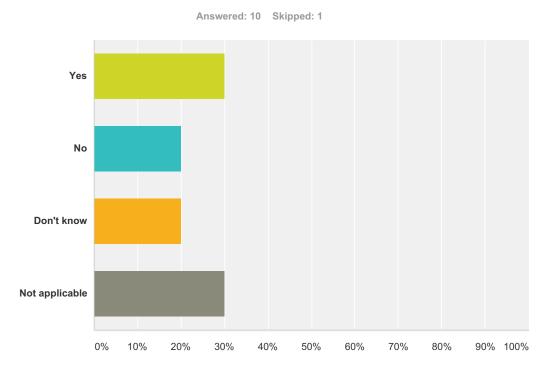

Answer Choices Responses 30.00% 3 Yes 20.00% 2 No 20.00% 2 Don't know 30.00% 3 Not applicable Total 10


#	If yes, please describe the policy to make changes in standard operating procedures:	Date
1	If the situation presented itself, City Attorney would make changes in consultation with Human Resources.	6/18/2014 12:54 PM
2	We provide hearing devices at Council meetings.	6/4/2014 8:59 PM
3	Our SOP includes reasonable accommodations.	6/3/2014 5:06 PM
4	We accommodate everyone as needed. We ask people to let us know when the register.	5/21/2014 10:58 AM

Q12 Is there a formal procedure for making changes to standard operating procedures?

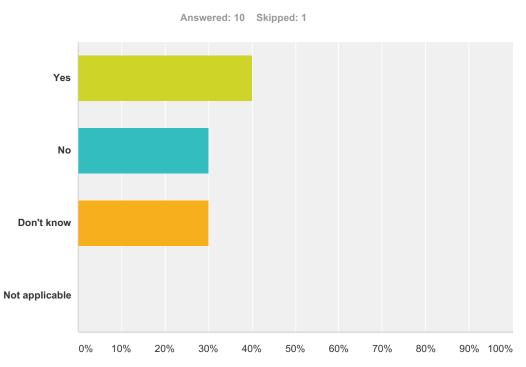

Answer Choices	Responses	
Yes	40.00%	4
No	30.00%	3
Don't know	30.00%	3
Not applicable	0.00%	0
Total		10

#	If yes, please describe the procedure.	Date
1	In our department, the City Attorney makes changes to procedures.	6/18/2014 12:54 PM
2	Public Works only procedures are reviewed internally within public works and approved at Department Head level.	5/23/2014 12:32 PM
3	Internal policies and procedures are created and managed by the Building Official.	5/22/2014 8:42 AM
4	We ask people to let us know when they register and we make needed adjustments and accommodations	5/21/2014 10:58 AM

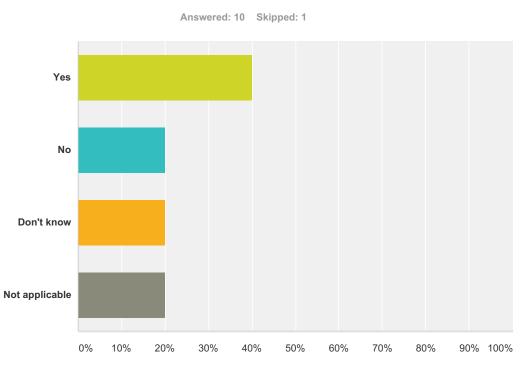


Q13 Do you track accessibility requests?

Answer Choices	Responses	
Yes	40.00%	4
No	20.00%	2
Don't know	20.00%	2
Not applicable	20.00%	2
Total		10

#	If yes, please list how many requests have you received and what the requests were for.	Date
1	But none have been received.	6/18/2014 12:54 PM
2	We've received one complaint in the last year regarding a public sidewalk that is constructed of paver stones.	6/18/2014 10:08 AM
3	recorded on their user profile on our program management system	5/21/2014 10:58 AM
4	One Remove air frshners in rest rooms (scent sensitive)	5/14/2014 7:48 AM


Q14 Does your program charge an additional fee for people with disabilities for modifying programs?

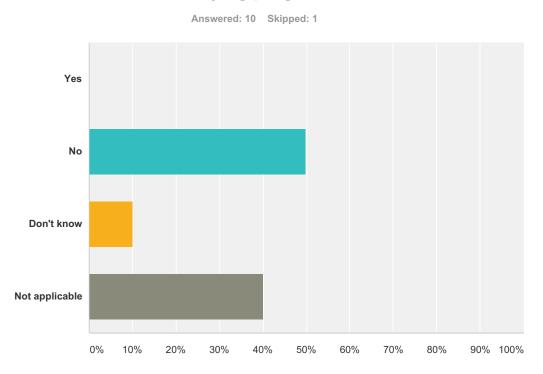

Answer Choices	Responses
Yes	0.00% 0
No	50.00% 5
Don't know	10.00% 1
Not applicable	40.00% 4
otal	10

#	If yes, please describe.	Date
	There are no responses.	


Q15 Does your department consult or work with any outside organizations or groups that assist people with disabilities such as the a Center for Independent Living or Senior Citizen's advocacy group?

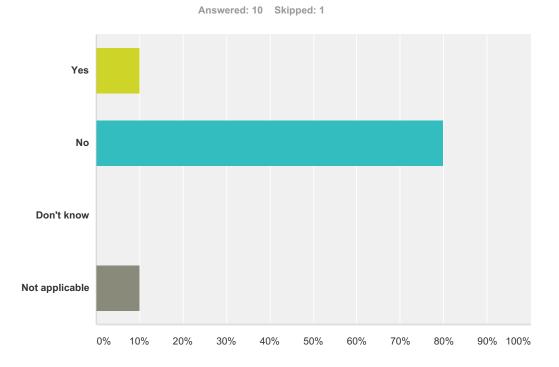

Answer Choices	Responses
Yes	10.00% 1
No	80.00% 8
Don't know	0.00% 0
Not applicable	10.00% 1
Total	10

#	If yes, please list the organizations.	Date
1	para-transit outreach, shuttles from senior housing, rebuilding together	5/21/2014 10:58 AM


Q16 Does your department have any policies which exclude service animals, such as service dogs for the blind or signal dogs for the hearing impaired?

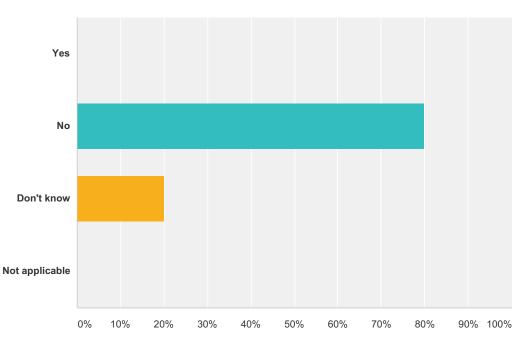

Answer Choices	Responses	
Yes	0.00%	0
No	80.00%	8
Don't know	20.00%	2
Not applicable	0.00%	0
Total		10

#	If yes, please describe your policy on service animals.	Date
	There are no responses.	

Q17 Do you have a non-discrimination statement that includes persons with disabilities?

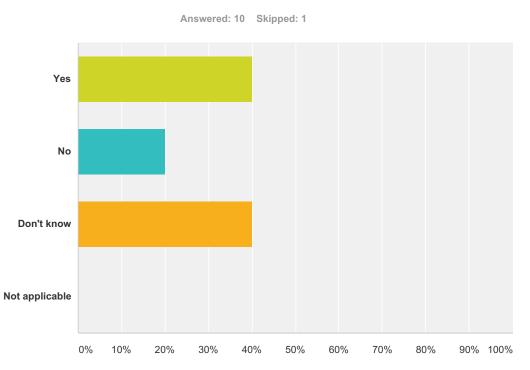


Answer Choices	Responses	
Yes	40.00%	4
No	20.00%	2
Don't know	40.00%	4
Not applicable	0.00%	0
Total		10

#	Comments:	Date
1	Please let us know the required language and we will get these made	5/21/2014 10:59 AM

Q18 Is a non-discrimination statement that includes information about how to reach the ADA coordinator posted in all departments in a location that maximizes public exposure?

 Yes
 Image: Comparison of the second of t

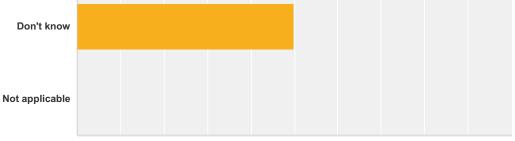


0%	10%	20%	30%	40%	50%	60%	70%	80%	90%	100%
----	-----	-----	-----	-----	-----	-----	-----	-----	-----	------

Answer Choices	Responses
Yes	10.00% 1
Νο	40.00% 4
Don't know	50.00% 5
Not applicable	0.00% 0
Total	10


#	If yes, please describe where the non-discrimination statement is posted.	Date
1	Posted on bulletin board.	6/18/2014 12:56 PM

Q19 Do you notify all persons that your meetings, hearings, interviews, and conferences will be held in accessible locations and that adaptive/auxiliary aids (such as assistive listening devices, readers for the blind, pen and paper) will be provided, upon request, to participants with disabilities?

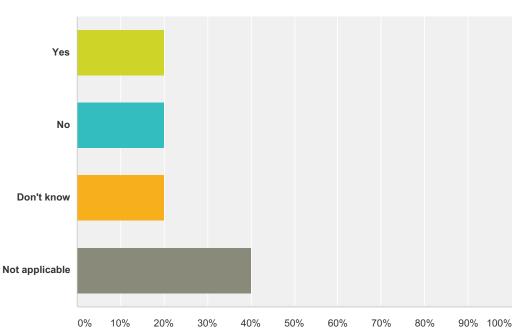

Answer Choices	Responses
Yes	20.00% 2
No	20.00% 2
Don't know	20.00% 2
Not applicable	40.00% 4
Total	10


Q20 Do you know the procedure for filing a disability discrimination complaint?

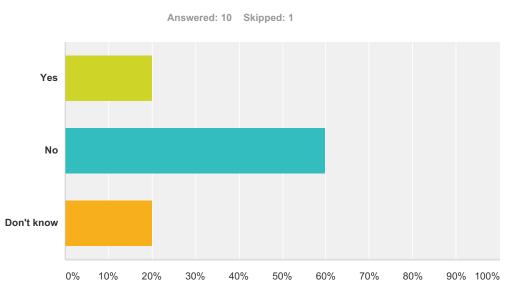

Answer Choices	Responses	
Yes	20.00%	2
No	60.00%	6
Don't know	20.00%	2
Total		10

#	If yes, please describe the procedure for filing a discrimination complaint.	Date
1	through City Clerk's office	5/21/2014 10:59 AM


Q21 Do you notify all members of the public how and with whom to file a disability discrimination complaint?

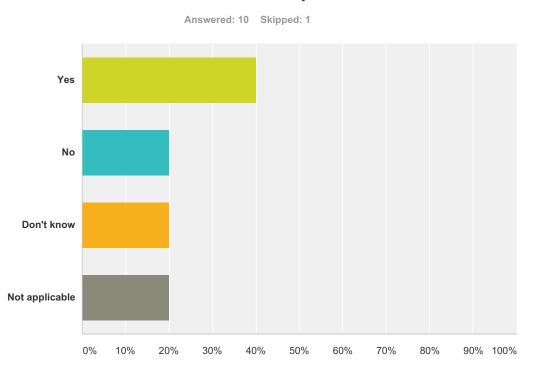

Answer Choices	Responses	
Yes	40.00%	4
No	20.00%	2
Don't know	20.00%	2
Not applicable	20.00%	2
Total		10


#	If yes, please describe the process here.	Date
1	Although we do not provide legal advice to the public, we would provide the procedure if asked.	6/18/2014 12:56 PM
2	Contact David Stillman.	6/18/2014 10:10 AM
3	As part of the employment application	6/3/2014 3:56 PM
4	refer them to City Clerk's office	5/21/2014 10:59 AM

Q22 Does your department produce printed materials that are made available to the public?

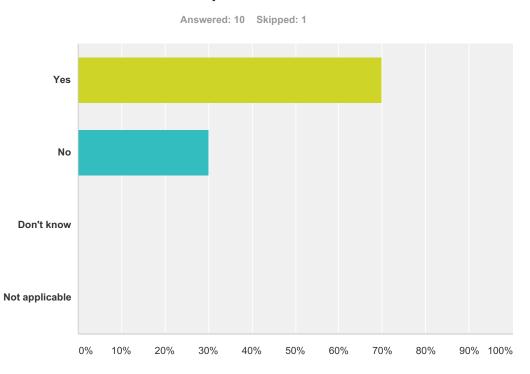

Answer Choices	Responses	
Yes	70.00%	7
No	30.00%	3
Don't know	0.00%	0
Not applicable	0.00%	0
Total		10


#	Comments:	Date
1	Usually in the form of notification of upcoming work in the public right of way that may affect residents / businesses.	5/23/2014 12:34 PM

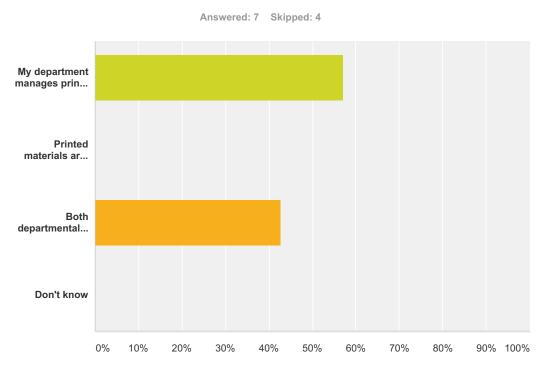

Q23 Who manages your printed materials?

swer Choices	Responses	
My department manages printed material	57.14%	4
Printed materials are managed centrally	0.00%	
Both departmental and central management	42.86%	
Don't know	0.00%	
tal		


#	Comments:	Date
	There are no responses.	

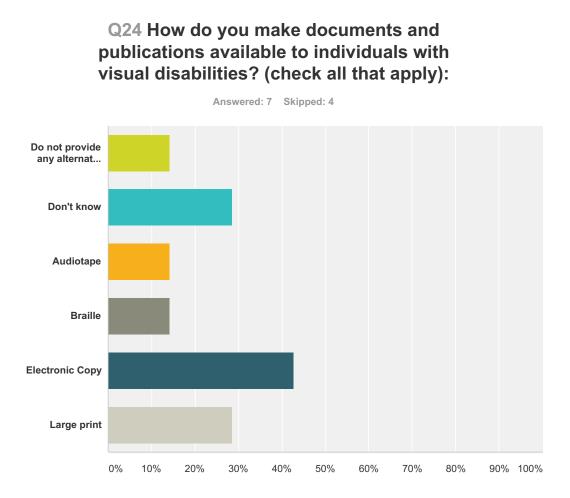

swer Choices	Responses
Do not provide any alternative formats upon request	14.29% 1
Don't know	28.57% 2
Audiotape	14.29%
Braille	14.29%
Electronic Copy	42.86%
Large print	28.57%
al Respondents: 7	

#	Other: please list	Date
1	We would attempt to accommodate other requests or formats.	6/18/2014 10:13 AM
2	We have not had the request.	6/3/2014 5:09 PM
3	Has not come up as a request to my knowledge	5/23/2014 12:36 PM
4	upon request	5/21/2014 11:01 AM

Q25 Do you make the content of documents and publications available in simple, easyto-understand language for individuals with learning disabilities?

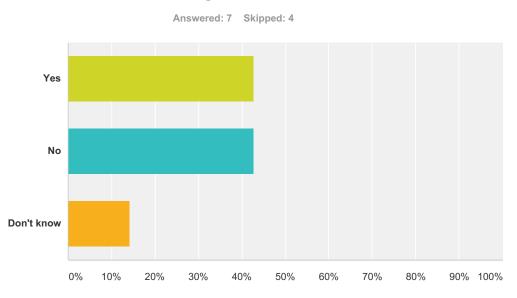

Answer Choices	Responses	
Yes	42.86%	3
No	42.86%	3
Don't know	14.29%	1
Total		7

#	Comments:	Date
1	Regular members of the public can understand the documents	6/4/2014 9:01 PM
2	Not sure what constitutes simple, easy to understand language	5/23/2014 12:36 PM
3	City has worked to simplify agendas	5/21/2014 11:01 AM



photos of ...

Do not include any photos o ...

Don't know

0%

10%

20%

30%



Answer Choices		Responses	
Yes, we include photos of people with disabilities	14.29%	1	
No, we include photos of people, but do not show any images of people with disabilities.	42.86%	3	
Do not include any photos of people in publications	42.86%	3	
Don't know	0.00%	0	
Total		7	

40%

50%

60%


70%

80%

90% 100%

#	Comments:	Date
1	Images on the building department website does not include anyone with a disability.	5/22/2014 8:45 AM
2	we have in the past.	5/21/2014 11:01 AM


Q27 Does your department prepare audiovisual or televised presentations or website demonstrations/webinars for the public or make audiovisual presentations to the public?

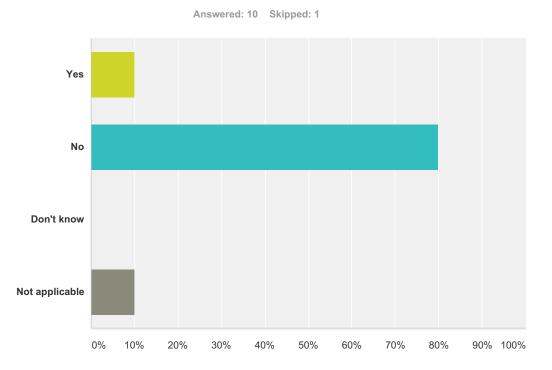

Answer Choices	Responses
Yes	10.00% 1
No	80.00% 8
Don't know	0.00% 0
Not applicable	10.00% 1
Total	10

#	Comment:	Date
1	this is done by the TV department	5/21/2014 11:01 AM

Q28 How do you make audiovisual or televised or on-line presentations prepared or presented by your department to the public accessible to individuals with disabilities? Please check all that apply.

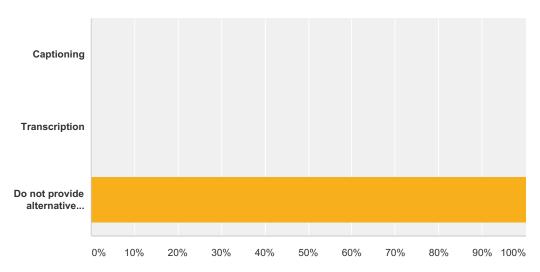

Answer Choices		Responses	
Captioning	0.00%	0	
Transcription	0.00%	0	
Do not provide alternative formats upon request	100.00%	1	
Total Respondents: 1			

#	Please list other alternative formats:	Date
	There are no responses.	

Q29 What type of audiovisual presentations (film, videotape, television) does your department provide?

#	Responses	Date
1	Powerpoint for Council Items that appear online and on TV	6/4/2014 10:27 AM


Q30 If you show people in your audiovisual presentations, do you also portray individuals with disabilities in your audiovisual presentations?

 Yes
 No

 Don't know
 0%
 10%
 20%
 30%
 40%
 50%
 60%
 70%
 80%
 90%
 10%

Answer Choices	Responses
Yes	0.00% 0
No	100.00% 1
Don't know	0.00% 0
Total	1

#	Comments:	Date
	There are no responses.	

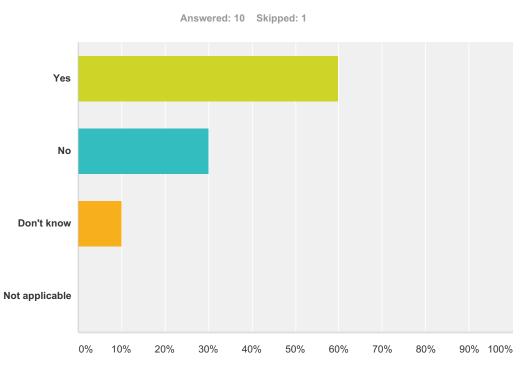

Q31 Does your department have a website?

Answer Choices	Responses	
Yes	60.00%	6
No	30.00%	3
Don't know	10.00%	1
Not applicable	0.00%	0
Total		10


#	If yes, please list the website:	Date
1	Only the City website.	6/18/2014 12:56 PM
2	Webpage on our website	6/4/2014 9:01 PM
3	We have a section for our Division on the City's website.	6/3/2014 5:14 PM
4	http://www.cupertino.org/index.aspx?page=315	5/23/2014 12:37 PM
5	http://www.cupertino.org/index.aspx?page=296	5/22/2014 8:45 AM
6	http://www.cupertino.org/index.aspx?page=177	5/21/2014 11:02 AM

Q32 What information is provided on this site?

Answered: 6 Skipped: 5

#	Responses	Date
1	Public Works Information	6/18/2014 10:18 AM
2	Election information; public records information	6/4/2014 9:10 PM
3	Basic department info, contact info documents	6/4/2014 10:29 AM
4	Description of the various City assets maintained, answers to frequently asked questions and to request service	5/23/2014 12:41 PM
5	Building Code information and department policy, procedures, and downloadable forms.	5/22/2014 8:48 AM
6	information about all programs, facilities, etc.	5/21/2014 11:07 AM

Q33 Does your department's website include information about accessibility of facilities (parking, bathrooms, assistive listening devices, etc.) where programs or services are offered?

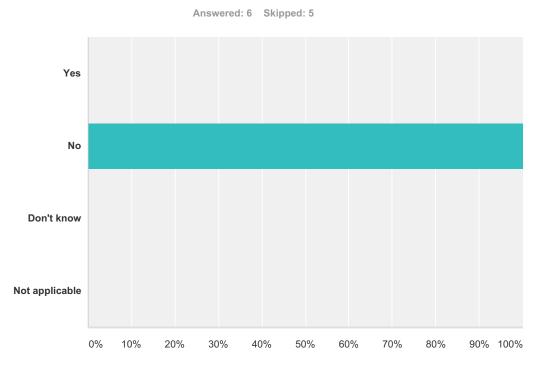

Answer Choices	Responses	
Yes	0.00%	0
No	100.00%	6
Don't know	0.00%	0
Not applicable	0.00%	0
Total		6

#	If yes, please describe briefly what information is provided about accessibility:	Date		
1	not specified right now. Happy to add this information	5/21/2014 11:07 AM		

Q34 Does your department ensure that its website is usable by individuals with disabilities, including those who use speaking browsers?

 Yes
 Image: Skipped: 5

 No
 Image: Skipped: 5


 Don't know
 Image: Skipped: 5

 0%
 10%
 20%
 30%
 40%
 50%
 60%
 70%
 80%
 90%
 100%

Answer Choices	Responses
Yes	16.67% 1
No	33.33% 2
Don't know	50.00% 3
Total	6

#	If yes, please describe the process for testing website accessibility:	Date	
1	Please check with the IT department	5/21/2014 11:07 AM	

Q35 Are the documents provided on your website for downloading accessible to persons with visual disabilities?

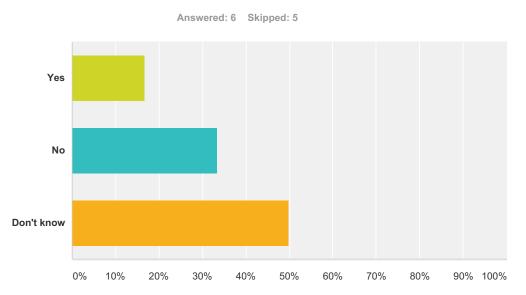


Answer Choices	Responses
Yes	16.67% 1
No	33.33% 2
Don't know	50.00% 3
Total	6

#	If yes, please describe briefly how downloadable files are tested for accessibility:	Date	
1	Please check with the IT department	5/21/2014 11:07 AM	

Q36 Is information regarding your departments facilities, programs and services created and managed by the department or by others?


Answered: 6 Skipped: 5

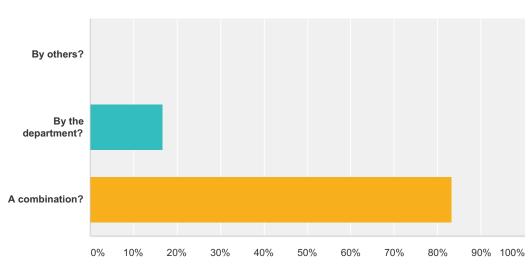

Answer Choices	Responses	
By others?	0.00%	0
By the department?	16.67%	1
A combination?	83.33%	5
Total		6


#	Please describe.	Date		
1	Documents created by the Department, website managed by others.	6/18/2014 10:18 AM		
2	The City's IT department manages the website. Public works provides the information that is posted by IT.	5/23/2014 12:41 PM		
3	A combination of our department and the IT group.	5/22/2014 8:48 AM		
4	We update content, IT maintains website	5/21/2014 11:07 AM		

Q37 Do you communicate by telephone with individuals with hearing or speech difficulties?

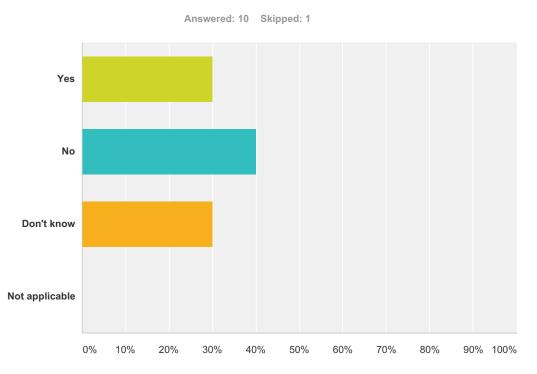

Answer Choices	Responses
Yes	30.00% 3
No	40.00% 4
Don't know	30.00% 3
Not applicable	0.00% 0
Total	10


#	Comments:	Date		
	There are no responses.			

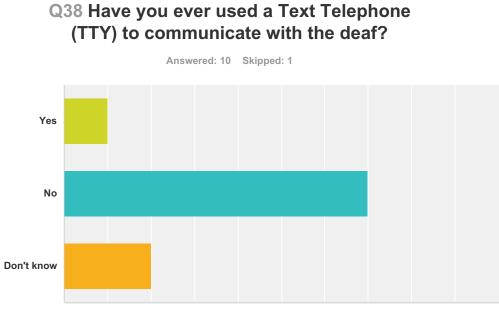

0%	10%	20%	30%	40%	50%	60%	70%	80%	90%	100%

Answer Choices	Responses
Yes	10.00% 1
No	70.00% 7
Don't know	20.00% 2
Total	10

#	If yes, list the location, telephone number, and organization in which the TTY number is listed:	Date
1	would if requested	5/21/2014 11:10 AM

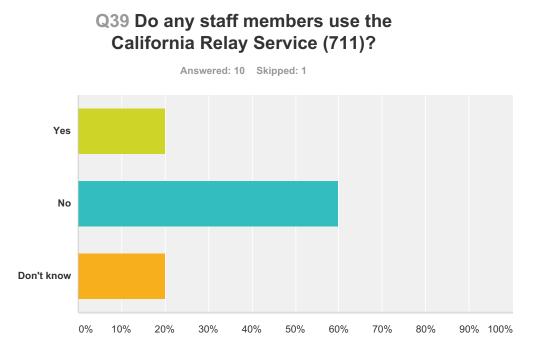


Answer Choices	Responses	
Yes	20.00%	2
No	60.00%	6
Don't know	20.00%	2
Total		10

#	Comments:	Date
1	Staff has used California Relay Service in the past.	6/18/2014 12:56 PM

40 / 78


Q40 Do you publish your TTY number or California Relay Service numbers in all materials where a phone number is listed?

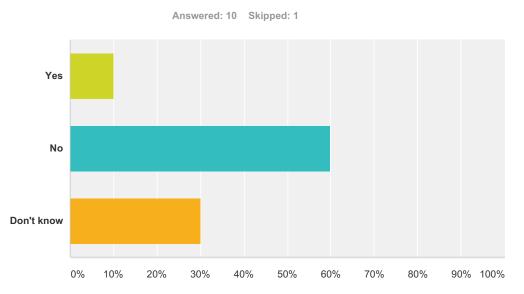

Answer Choices	Responses	
Yes	10.00%	1
No	60.00%	6
Don't know	30.00%	3
Total	· · · · · · · · · · · · · · · · · · ·	10


#	Comments:	Date
1	currently in case management materials only	5/21/2014 11:10 AM

Q41 Do you train your staff in operating a TTY or other means of communicating over the telephone with a person with a hearing or speech disability?

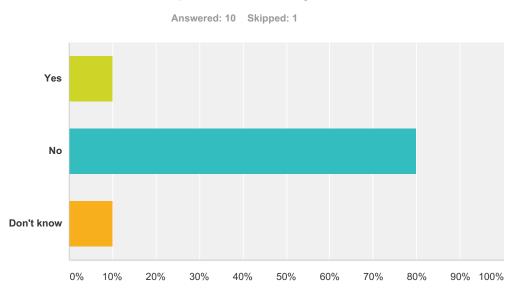

Answer Choices	Responses	
Yes	10.00%	1
No	80.00%	8
Don't know	10.00%	1
Total		10

#	Comments:	Date
	There are no responses.	

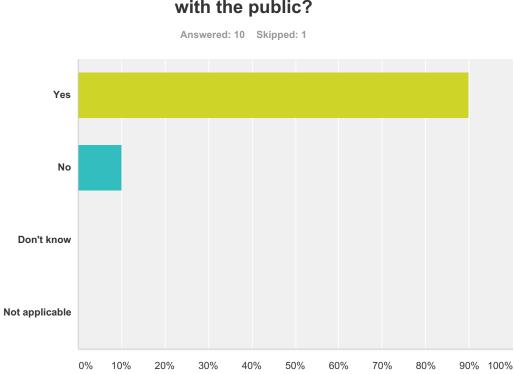

Q42 Do any staff members have contact
with the public?

Answer Choices	Responses	
Yes	90.00%	9
No	10.00%	1
Don't know	0.00%	0
Not applicable	0.00%	0
Total		10


#	Comments:	Date
1	Counter hours, as well as phone.	6/18/2014 10:21 AM
2	The Service Center is open to the public. Questions and service request to residents and businesses occur.	5/23/2014 12:46 PM

Q43 How do you inform staff members who have contact with the public of your department's obligations and policies that enable persons with disabilities to participate in programs or activities?

Answered: 10 Skipped: 1

#	Responses	Date
1	We provide written materials and verbal instruction to staff, but the department does not provide programs or activities to the public.	6/18/2014 12:56 PM
2	Discussions	6/18/2014 10:21 AM
3	n/a	6/5/2014 4:47 PM
4	We don't really have any programs or activities for them to participate in.	6/4/2014 9:12 PM
5	We currently do not have or provide this info to staff	6/4/2014 10:32 AM
6	We don't have a formal awareness program. We are all trained to make reasonable accommodations if needed.	6/3/2014 5:17 PM
7	I have not informed staff members of this process. If we had a member of the public come to use with a disability that prevented us from properly communicating, we would do our best to accommodate and coordinate with the appropriate personnel at City Hall.	5/23/2014 12:46 PM
8	The Building Department does not host any programs or activities. The interaction with the public is at the permit center counter and in the field at the construction sites.	5/22/2014 8:50 AM
9	staff training and policies	5/21/2014 11:11 AM
10	Tailgate Meetings	5/14/2014 7:51 AM


Q44 Do your staff receive training on interacting with people with disabilities?

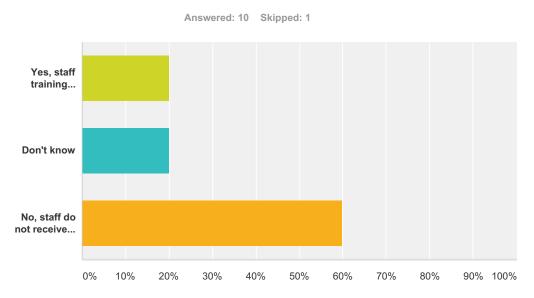

Answer Choices	Responses
Yes, staff training provided	20.00% 2
Don't know	20.00% 2
No, staff do not receive training	60.00% 6
Total	10

#	If yes, please describe your staff training process:	Date
1	We provide written materials and verbal instruction.	6/18/2014 12:56 PM
2	information provided during in-service training	5/21/2014 11:11 AM


Q45 Are there staff members in your department who provide emergency services to the public?

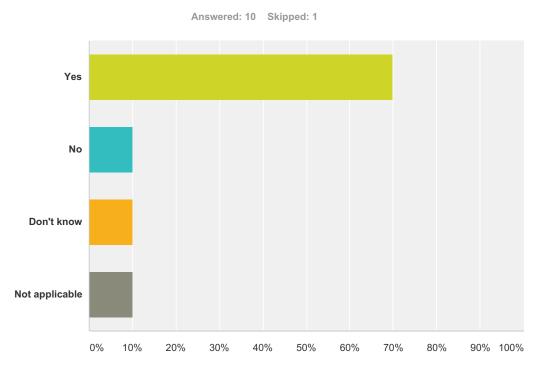

Answer Choices	Responses	
Yes	70.00%	7
No	10.00%	1
Don't know	10.00%	1
Not applicable	10.00%	1
Total		10

#	If yes, have they had training in American Sign Language or other means of communicating in emergency situations with people who have hearing or speech impairments?	Date
1	We are part of the PIO dept. in the EOC. No training in sign language, etc.	6/4/2014 9:12 PM
2	Don't know	6/4/2014 10:32 AM
3	no	6/3/2014 5:17 PM
4	Not to my knowledge	5/23/2014 12:46 PM
5	No	5/22/2014 8:50 AM
6	no	5/21/2014 11:11 AM
7	Only First Aid and CPR	5/14/2014 7:51 AM


Q46 Are there other staff members who would be able to provide better customer service if they had training in American Sign Language (ASL) or other means of communicating with people who have hearing impairments?

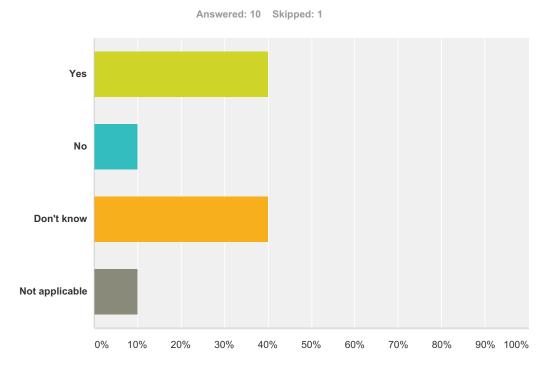

Answer Choices Responses 40.00% 4 Yes 10.00% 1 No 40.00% 4 Don't know 10.00% 1 Not applicable Total 10

#	If yes, please list staff who would benefit from receiving emergency American Sign Language training:	Date
1	Potentially, we routinely interact with the public in the maintenance of City assets and in stormwater pollution prevention education/enforcement	5/23/2014 12:46 PM
2	Public Relations staff in the City Manager's office.	5/22/2014 8:50 AM

Q47 Are there any limitations or ratios for the number of people with disabilities who may participate in or be admitted to any department program? For example exams, testing for level of ability, age requirements, etc.

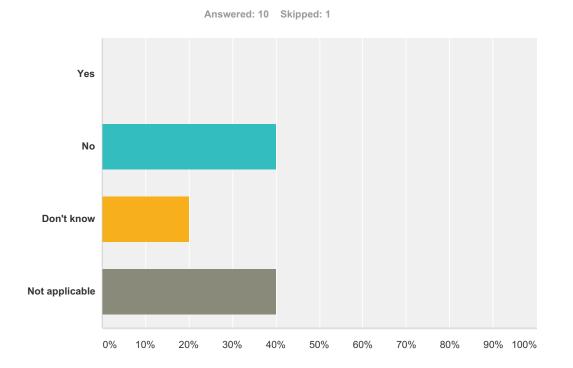

Answer Choices	Responses	
Yes	0.00%	0
No	40.00%	4
Don't know	20.00%	2
Not applicable	40.00%	4
Total	1	0

#	If yes, please describe the limitations and programs:	Date
	There are no responses.	

Q48 Does your program use any criteria (for example good health, residency, letters of recommendation) or written and/or oral tests (including level of skill or achievement, or other factor being tested) in the admissions process?

 Yes
 No

 Don't know
 On't know


 0%
 10%
 20%
 30%
 40%
 50%
 60%
 70%
 80%
 90%
 100%

Answer Choices	Responses	
Yes	20.00%	2
No	20.00%	2
Don't know	10.00%	1
Not applicable	50.00%	5
Total		10

#	If yes, please list the participation requirements.	Date
1	We have minimum qualifications for each job classification.	6/3/2014 5:21 PM
2	for progression type classes	5/21/2014 11:13 AM

Q49 Are there any forms required for admission to the program (for example, tests and/or the submission of other admissions criteria such as certificates?).


Answered: 10 Skipped: 1

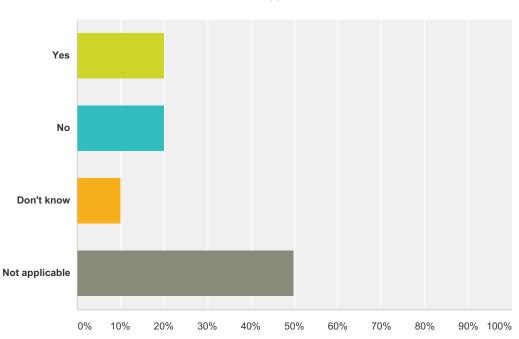

Answer Choices	Responses
Yes	20.00% 2
No	20.00% 2
Don't know	10.00% 1
Not applicable	50.00% 5
Total	10


#	If yes, please send sample forms to ashleyt@migcom.com.	Date
1	Job announcement	6/3/2014 5:21 PM
2	registration form.	5/21/2014 11:13 AM

Q50 Do the forms contain a notice that the City does not discriminate against people with disabilities?

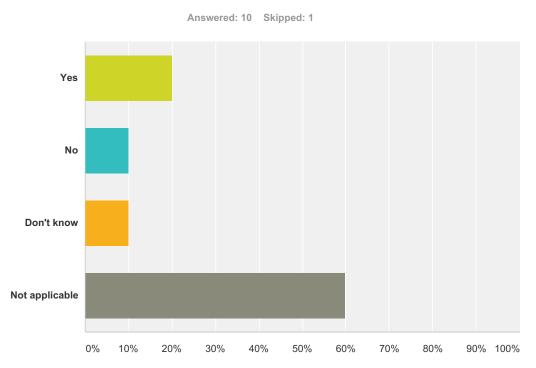


Answer Choices	Responses	
Yes	20.00%	2
No	10.00%	1
Don't know	10.00%	1
Not applicable	60.00%	6
Total		10

#	Comments:	Date
1	In employment application	6/4/2014 10:36 AM

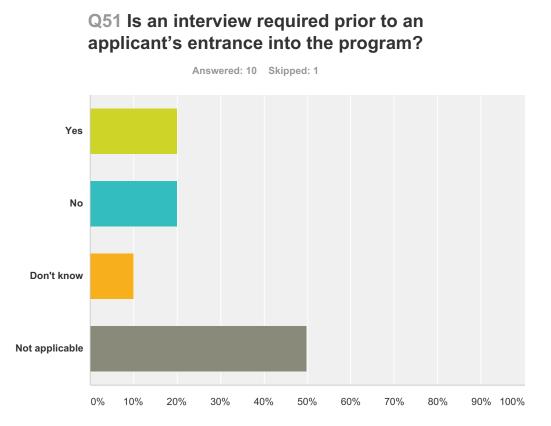

Responses
20.00% 2
20.00% 2
10.00% 1
50.00% 5
10

#	Comments:	Date
	There are no responses.	

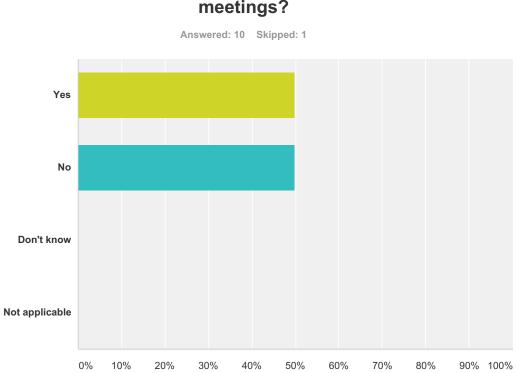


Answer Choices	Responses
Yes	50.00% 5
No	50.00% 5
Don't know	0.00% 0
Not applicable	0.00% 0
Total	10

#	Comments:	Date
1	For large or complex projects, public meetings may be held to inform the public of the project	5/23/2014 12:48 PM

Q52 Does your department hold public meetings?


Q53 Do you require that public meetings, hearings, and conferences be held in accessible locations?

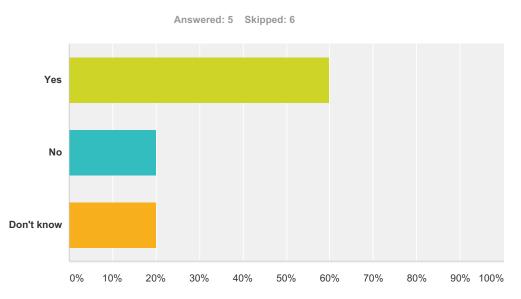

Answer Choices	Responses	
Yes	60.00%	3
No	20.00%	1
Don't know	20.00%	1
Total		5

#	Comments:	Date
	There are no responses.	


Q54 Are American Sign Language interpreters, readers, or adaptive equipment provided when requested for meetings, interviews, and conferences?

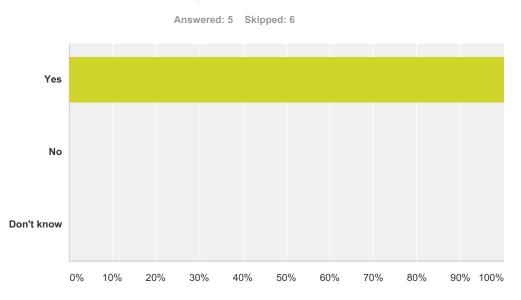

Answer Choices	Responses
Yes	100.00% 5
No	0.00% 0
Don't know	0.00% 0
Total	5

#	If yes, how much advanced notice is required to provide accomodations?	Date
1	24 hours	6/4/2014 9:13 PM
2	Not sure, if we had a request we would coordinate with the appropriate people at City Hall	5/23/2014 12:49 PM
3	we don't have a set requirement	5/21/2014 11:14 AM

Q55 Do you ensure that all individuals with hearing disabilities who do not read sign language can participate effectively in meetings, conferences, and hearings via assistive listening devices or other means?

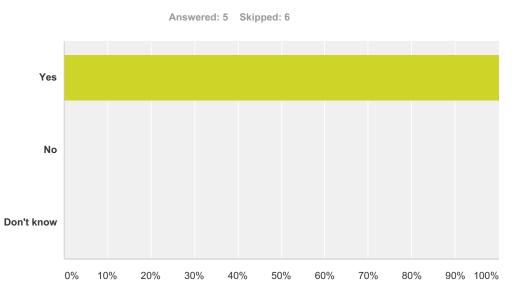


Answer Choices	Responses	
Yes	100.00%	5
No	0.00%	0
Don't know	0.00%	0
Total		5

#	Comments:	Date
1	Though I'm unaware of a situation where this has been a factor.	6/18/2014 10:24 AM
2	If we are aware of the need, yes an accommodation would be made.	5/23/2014 12:49 PM
3	when requested	5/21/2014 11:14 AM

Q56 Do you provide transportation to volunteers, program participants, visitors, and others who participate in your programs?


Answered: 10 Skipped: 1

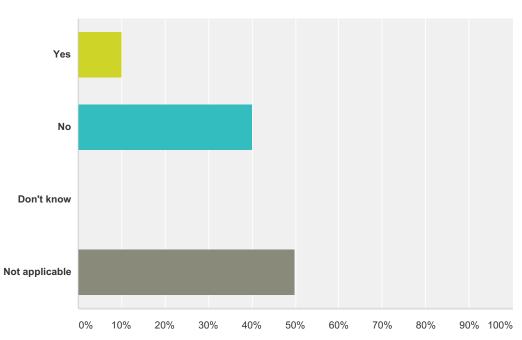

Answer Choices	Responses
Yes	10.00% 1
No	40.00% 4
Don't know	0.00% 0
Not applicable	50.00% 5
Total	10

#	Please describe.	Date
1	camp trips and senior center trips	5/21/2014 11:14 AM


Q57 Do you have procedures to make transportation accessible to persons who have visual disabilities?

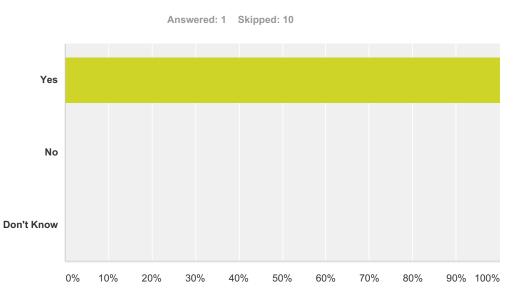

Answer Choices	Responses
Yes	100.00% 1
No	0.00% 0
Don't Know	0.00% 0
Total	1

#	If yes, please describe the procedures.	Date
1	if requested, we make appropriate accommodations	5/21/2014 11:15 AM


Q58 Do you have procedures to make transportation accessible to persons who have hearing disabilities?

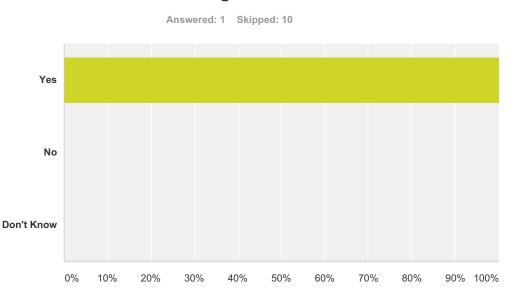

Answer Choices	Responses
Yes	100.00% 1
No	0.00%
Don't Know	0.00% 0
Total	1

#	If yes, please describe the procedures.	Date
1	if requested, we make appropriate accommodations	5/21/2014 11:15 AM


Q59 Do you have procedures to make transportation accessible to persons who have mobility disabilities?

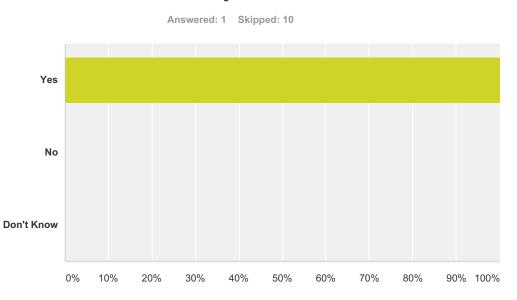

Answer Choices	Responses
Yes	100.00% 1
No	0.00% 0
Don't Know	0.00% 0
Total	1

#	If yes, please describe the procedures.	Date
1	if requested, we make appropriate accommodations	5/21/2014 11:15 AM


Q60 Do you have procedures to make transportation accessible to persons who have learning disabilities?

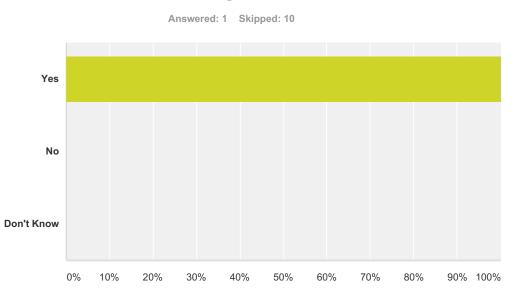

Answer Choices	Responses
Yes	100.00% 1
No	0.00% 0
Don't Know	0.00% 0
Total	1

#	If yes, please describe the procedures.	Date
1	if requested, we make appropriate accommodations	5/21/2014 11:15 AM


Q61 Does your department provide facility tours or organize trips for members of the public?

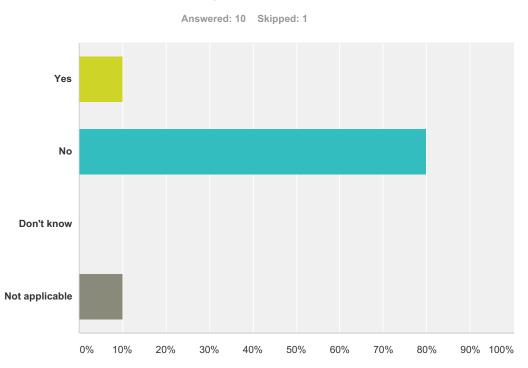

Answer Choices	Responses	
Yes	10.00%	1
No	80.00%	8
Don't know	0.00%	0
Not applicable	10.00%	1
Total		10

#	If yes, please list the tours and trips.	Date
1	travel program through Senior Center	5/21/2014 11:16 AM


Q62 Do you have procedures to make tours and trips accessible to persons who have visual disabilities?

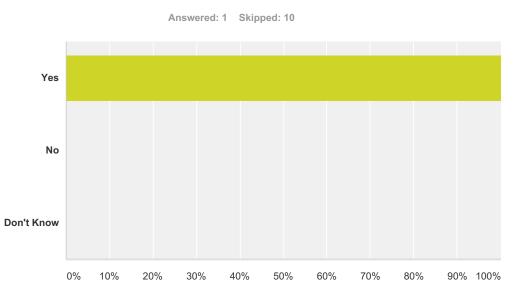

Answer Choices	Responses
Yes	100.00% 1
No	0.00%
Don't Know	0.00% 0
Total	1

#	If yes, please describe the procedures.	Date
1	if requested, we make appropriate accommodations	5/21/2014 11:16 AM


Q63 Do you have procedures to make tours and trips accessible to persons who have hearing disabilities?

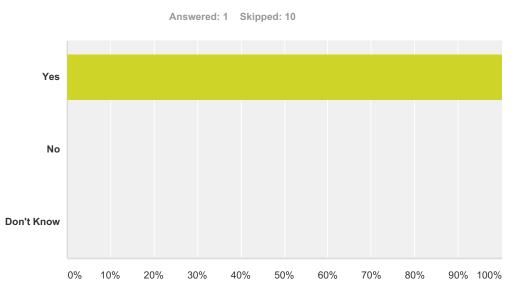

Answer Choices	Responses	
Yes	100.00%	1
No	0.00%	0
Don't Know	0.00%	0
Total		1

#	If yes, please describe the procedures.	Date
1	if requested, we make appropriate accommodations	5/21/2014 11:16 AM


Q64 Do you have procedures to make tours and trips accessible to persons who have mobility disabilities?

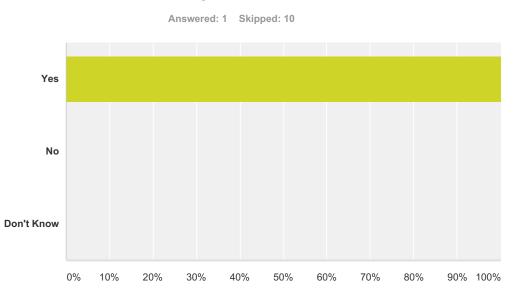

Answer Choices	Responses
Yes	100.00% 1
No	0.00% 0
Don't Know	0.00% 0
Total	1


#	If yes, please describe the procedures.	Date
1	if requested, we make appropriate accommodations	5/21/2014 11:16 AM

Q65 Do you have procedures to make tours and trips accessible to persons who have learning disabilities?

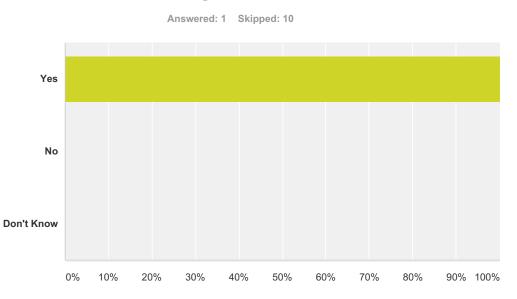

Answer Choices	Responses
Yes	100.00% 1
No	0.00%
Don't Know	0.00% 0
Total	1


#	If yes, please describe the procedures.	Date
1	if requested, we make appropriate accommodations	5/21/2014 11:16 AM

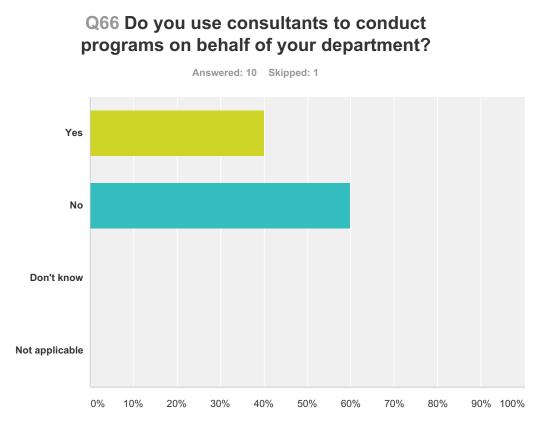

Answer Choices	Responses	
Yes	40.00%	4
No	60.00%	6
Don't know	0.00%	0
Not applicable	0.00%	0
Total		10


#	If yes, please list what consultants.	Date
1	Recruitment, Workers Compensation and Training	6/4/2014 10:39 AM
2	independent contractors teach the majority of our classes	5/21/2014 11:16 AM

Q67 Do you ensure that consultants are aware of their obligations to facilitate participation of individuals with disabilities in programs or activities operated on behalf of your department?

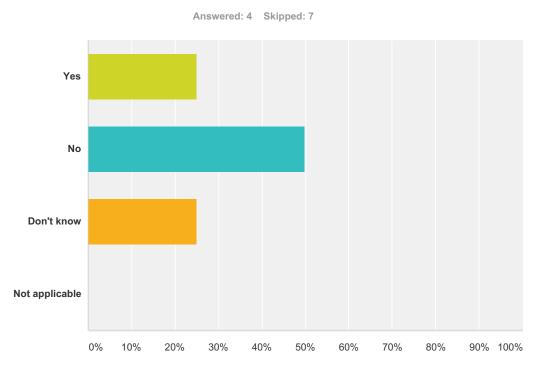

Answer Choices	Responses
Yes	25.00% 1
No	50.00% 2
Don't know	25.00% 1
Not applicable	0.00% 0
Total	4

#	If yes, please describe the procedures.	Date
1	told when brought on to teach	5/21/2014 11:17 AM

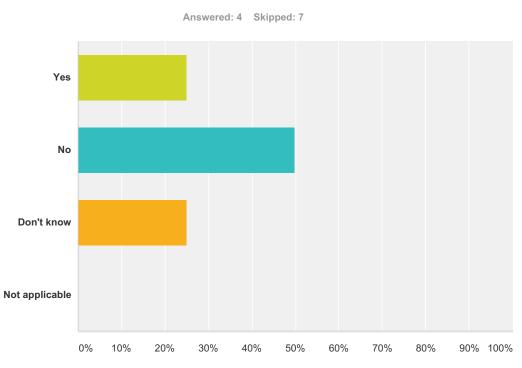


Q68 Do you monitor this obligation?

Answer Choices	Responses
Yes	25.00% 1
No	50.00% 2
Don't know	25.00% 1
Not applicable	0.00% 0
Total	4

#	If yes, please describe your department's procedure:	Date
1	we let them know when someone registers who is special needs	5/21/2014 11:17 AM


Q69 Do you notify individuals with visual disabilities of emergencies and evacuation procedures?

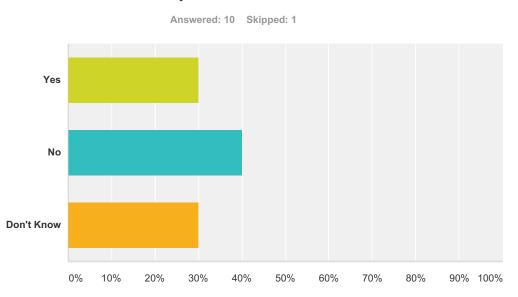

Answer Choices	Responses	
Yes	30.00%	3
No	40.00%	4
Don't Know	30.00%	3
Total		10

#	If yes, describe the equipment and/or procedures do you use to notify individuals with visual disabilities of emergencies and evacuation procedures:	Date
1	In our department, there are no employees with visual disabilities, but we would provide if needed.	6/18/2014 12:58 PM
2	In emergency situations, Public Works may be called to assist with this activity. If accommodation was needed, we would contact the appropriate person at the Emergency Operation Center (if activated) or the appropriate person at City Hall to accommodate.	5/23/2014 12:54 PM
3	Braille, plus part of emergency action plan is a walk through of the building and helping anyone who needs assistance evacuating building	5/21/2014 11:21 AM


Q70 Do you notify individuals with hearing disabilities of emergencies and evacuation procedures?

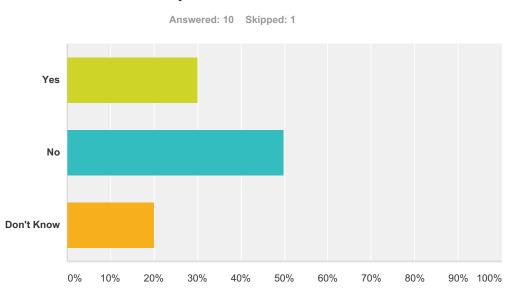

Answer Choices	Responses	
Yes	30.00%	3
No	50.00%	5
Don't Know	20.00%	2
Total		10

#	If yes, describe the equipment and/or procedures do you use to notify individuals with hearing disabilities of emergencies and evacuation procedures:	Date
1	In our department, there are no employees with hearing disabilities, but we would provide if needed.	6/18/2014 12:58 PM
2	Public Works would not be the lead. See description above	5/23/2014 12:54 PM
3	part of emergency action plan is a walk through of the building and helping anyone who needs assistance evacuating building	5/21/2014 11:21 AM


Q71 Do you notify individuals with mobility disabilities of emergencies and evacuation procedures?

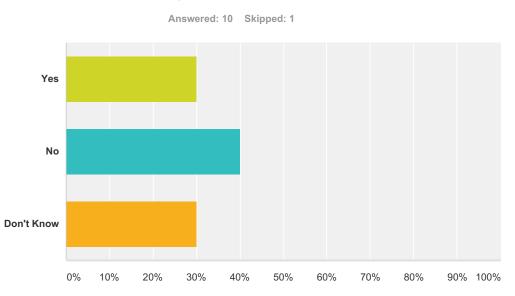

Answer Choices	Responses	
Yes	30.00%	3
No	40.00%	4
Don't Know	30.00%	3
Total		10

#	If yes, describe the equipment and/or procedures do you use to notify individuals with mobility disabilities of emergencies and evacuation procedures:	Date
1	In our department, there are no employees with mobility disabilities, but we would provide if needed.	6/18/2014 12:58 PM
2	Public Works would not be the lead. See description above	5/23/2014 12:54 PM
3	part of emergency action plan is a walk through of the building and helping anyone who needs assistance evacuating building	5/21/2014 11:21 AM

Q72 Do you notify individuals with learning disabilities of emergencies and evacuation procedures?

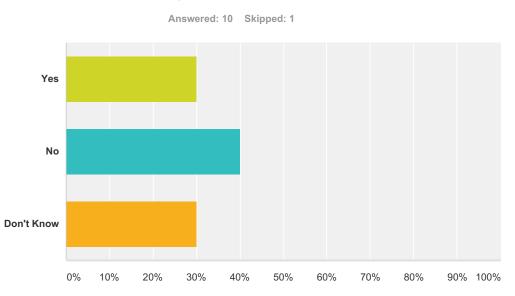


Answer Choices	Responses	
Yes	30.00%	3
No	40.00%	4
Don't Know	30.00%	3
Total		10

#	If yes, describe the equipment and/or procedures do you use to notify individuals with learning disabilities of emergencies and evacuation procedures:	Date
1	In our department, there are no employees with learning disabilities, but we would provided if needed.	6/18/2014 12:58 PM
2	Public Works would not be the lead. See description above	5/23/2014 12:54 PM
3	part of emergency action plan is a walk through of the building and helping anyone who needs assistance evacuating building	5/21/2014 11:21 AM

Q73 List all facilities, or portions of facilities, used for department programs. For each facility, designate the activity for which it is used. (Note: Facilities leased or otherwise used from another person/organization should also be included).

Answered: 10 Skipped: 1

#	Responses	Date
1	The City Attorney's Office does not provide programs.	6/18/2014 12:58 PM
2	City Hall Conference Rooms - Meetings Community Hall - Meetings and Public Hearings Quinlan Center - Meetings	6/18/2014 10:28 AM
3	We have PCs and/or network equipment and business apps at the following facilities for City staff. City Hall Attorney's Office Quinlan Center Senior Center Service Center Sports Center McClellan Ranch Blackberry Farm Golf Blackberry Farm	6/5/2014 4:51 PM
4	No programs. just City Council meetings at Community Hall.	6/4/2014 9:14 PM
5	City Hall	6/4/2014 10:41 AM
6	Community room for all-hands mandatory employee trainings, wellness programs/health fair, county-wide HR meetings.	6/3/2014 5:22 PM
7	Public Works - Maintenance does not operate programs available to the public. We interact with the public at all public facilities relative to maintenance. For planned projects that are large or complex, public meetings may occur. These would typically occur at either City Hall or Community Hall.	5/23/2014 12:58 PM
8	Community Hall and City Hall	5/22/2014 8:55 AM
9	Will email list to cedilier@mig along with registration form	5/21/2014 11:22 AM
10	City Hall, Library, Service Center, Quinlan, Senior Center, McClellan Ranch, Monta Vista, Portal, Willson, Sport Center, Creekside, Community Hall, Teen Center, Blackberry Farm	5/14/2014 7:57 AM

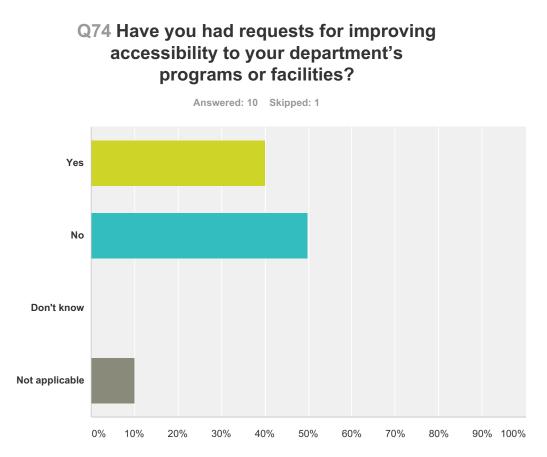

Answer Choices	Responses	
Yes	40.00%	4
No	50.00%	5
Don't know	0.00%	0
Not applicable	10.00%	1
Total		10

#	If yes, please describe how many requests and what the requests were for.	Date
1	alternate counter height for cashier window	6/4/2014 10:41 AM
2	Facilities Division responds to requests at public buildings. These requests will be evaluated and completed per ADA requirements. The Streets Division routinely makes improvements to accessible curb ramps through out the City.	5/23/2014 12:58 PM
3	more handicapped parking at the senior center ASL for Shakespeare in the Park	5/21/2014 11:22 AM
4	10 years ago had to make two sets of park restrooms accessible	5/14/2014 7:57 AM


Q75 Does your department organize special events or do you help facilitate private events on City property such as a park or City building?

 Yes
 Image: Constraint of the second of t

Answer Choices	Responses	
Yes	20.00%	2
No	80.00%	8
Don't know	0.00%	0
Not applicable	0.00%	0
Total		10

#	If yes, please describe briefly the type of event and what types of outside organizations are involved.	Date
1	Public Works - Maintenance routinely assists with the set up / traffic control of City festivals and events.	5/23/2014 12:58 PM
2	block parties, festivals, music & movies in the park, Shakespeare in the park, Big Bunny 5k	5/21/2014 11:23 AM

Q76 Do you ensure that both private entities and your staff are aware of their obligations to facilitate participation of individuals with disabilities in these special events or private events held on public property?

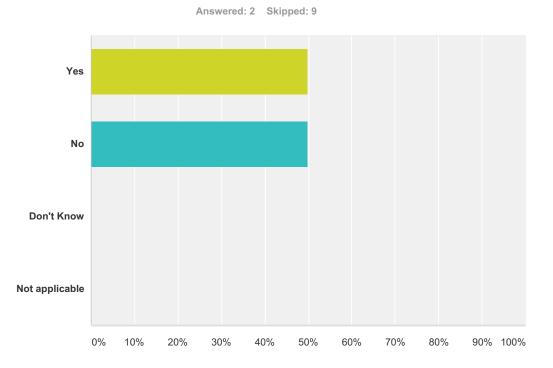

Answer Choices	Responses
Yes	50.00% 1
No	50.00% 1
Don't Know	0.00% 0
Not applicable	0.00% 0
Total	2

#	If yes, please describe your department's procedures.	Date
1	Our role is to prepare the event. We do not operate.	5/23/2014 12:59 PM
2	require that they provide handicapped parking, Otherwise, accommodations made if requested	5/21/2014 11:24 AM

Q77 Thank you for completing this survey. This is the last question on the survey.Do you have any accessibility questions for us? Please use this box below for any other questions or comments.When you are done with the survey, please click on the "done" button. Once you click on the "done" button, you will not be able to edit or change your answers to this survey.

Answered: 3 Skipped: 8

#	Responses	Date
1	Please call me if you have questions about my "don't know" responses. In some cases, I didn't understand the question and needed clarification. 408-777-3380 (May, HR Assistant)	6/3/2014 5:23 PM
2	My understanding that Public Works - Engineering will also be completing this survey from their prospective.	5/23/2014 12:59 PM
3	Nothing to add	5/14/2014 7:57 AM

Appendix B: Public Meeting Minutes

Public Meeting #1 – September 29, 2014 Cupertino Senior Center

Public Meeting #2 – February 2, 2015 Cupertino Senior Center City of Cupertino ADA Self-Evaluation and Transition Plan Public Meeting #1 - Minutes September 29, 2014

An open house was held September 29, 2014 at the Cupertino Senior Center's Oak Room. The City received public comment on the accessibility of Cupertino's facilities and public right-of-way.

Meeting announcements were sent out or posted at the following facilities: West Valley Community Services; De Anza College Disability Support Services; Silicon Valley Independent Living Center; Le Beaulieu; Cupertino Senior Center; Sunnyview Retirement Community; Cupertino Library; Cupertino City Hall; Cupertino Courier newspaper; and the City website home page.

General Comments from the Public:

- I love living in Cupertino. The school district serves kids with disabilities well. The fire department is nice and polite and has come and helped me many times. I feel safe.
- I don't feel safe after dark because of the cars. I try to do my activities and errands in the morning because traffic starts to pick up in the afternoon.

Construction

- More information would be helpful when there is a construction and sidewalk closure. It is very difficult to get around when there are sidewalk closures and detours.
- Provide more signage and better publicize when and where there will be construction so I can plan accordingly. Put a sign a block ahead of the closure so I know it's coming and I can reroute my trip.
- The sidewalk near the 81 stop has been closed and requires me to make three street crossings rather than one in order to get to the bus stop.
- It would be nice if upcoming construction and sidewalk closures were posted on the City's website so I could better plan my day and trips.

Curb Ramps and Street Crossings

- I don't feel safe at intersections allowing for right turns on red. Drivers don't always stop; they just roll through the turn. Often drivers don't look and a lot of people have been hit.
- A good place for a no turn on red sign would be at the flea market entrance on Stelling. I was hit while in the crosswalk when a car crossed through the intersection on a red light.

- Drivers think they can get around me and not be in my way while I'm crossing the street in the crosswalk. I take a long time to cross the street and when this happens, I don't always make it in time and have been stranded in the middle of the street because the light wasn't long enough.
- I like countdown timers. I feel more comfortable when I know how much time I have to cross the street.
- Signal buttons at street crossings are too high. They should be 30" maximum above the ground so people with limited arm movement can still reach the button.
- Many signal buttons at pork chop intersections are too far off the path of travel or behind a curb or located on a surface with a log of rocks and debris.
- I have been told by my blind friends it is hard to distinguish between the pavers and the yellow detectable warning plate.

Sidewalks

- The pavers on Stevens Creek Boulevard make traveling down the sidewalk uncomfortable with the vibrations and dangerous. I have fallen out of my chair and was not able to get back into my chair on my own.
- Bikes on sidewalks are an issue, particularly around De Anza College. It would be good if bicyclists were required to get bike licenses.

Transit

- The routes I use most are the 23, 25, and 81.
- The 23 bus only has two wheelchair spaces and there are times when I've been late for doctors' appointments because I have to wait for the next bus to come by because both spaces are already occupied.
- The 23 runs the latest and serves a lot of DeAnza College students with disabilities.

Help Build a More Accessible Cupertino



Help Cupertino update its ADA Self-Evaluation and Transition Plan

Join Us!

Monday September 29, 2014 5:30 - 7:30 pm

Cupertino Senior Center Reception Hall

21251 Stevens Creek Blvd Cupertino, CA CA 95014 In order to provide accessible services for all residents and visitors, the City of Cupertino is assembling its Americans with Disabilities (ADA) Self-Evaluation and Transition Plan. The City is in the process of evaluating the accessibility of its facilities, programs, and services and would like to hear from **you**.

Please join us for this public meeting where city staff will host a conversation to hear your ideas for improving the accessibility of City services and facilities. You will learn about the evaluation process, and your feedback will be included in the final ADA Transition Plan.

Public Transportation

Santa Clara Valley Transportation Authority (VTA) For more information, please visit http://www.vta.org/ or call (408) 321-2300 Routes 23 and 51 serve the Cupertino Senior Center

Meeting Accessibility

The meeting will be hosted in an accessible location. If you need an American Sign Language interpreter, assistive listening device, or other accommodation, you can request assistance by contacting **David Stillman by email at DavidS@cupertino.org or by calling (408) 777-3249 by September 24, 2014**

Meeting materials in alternative formats can be made available upon request.




Appendix C: Facility Reports for City Buildings and Parks

Location Name	Cost Estimate
Blackberry Farm	\$69,245
Blackberry Farm Golf Course	\$20,975
Burnett Pedestrian Bridge	\$35,550
Canyon Oaks Park	\$22,070
City Council Chambers	\$1,500
City Hall	\$92,735
Civic Center Plaza	\$19,450
Creekside Park	\$142,045
Franco Park	\$3,980
Hoover Park	\$38,550
Jollyman Park	\$63,020
Library	\$12,375
Linda Vista Park	\$91,060
Mary Ave Dog Park	\$4,100
McClellan Ranch	\$57,905
Memorial Park	\$125,230
Monta Vista Park	\$201,425
Oak Valley Park	\$18,430
Portal Park	\$66,680
Quinlan Community Center	\$145,090
Senior Center	\$59,010
Service Center	\$42,155
Somerset Park	\$20,715
Sport Center	\$128,315
Sterling/Barnhart Park	\$5,125
Stevens Creek Trail	\$90,060
Teen Center	\$6,150
Three Oaks Park	\$21,535
Varian Park	\$44,330
Wilson Park	\$61,310

Total \$1,710,120

Blackberry Farm Pool Facilities 21975 San Fernando Ave Cupertino, CA

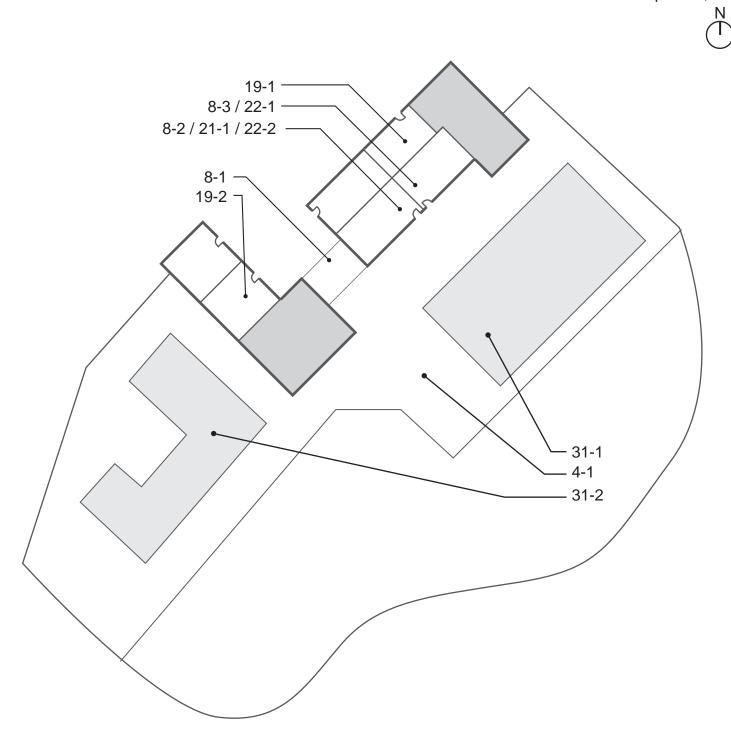


4 - 1 Walk	Category: 2
Regrade surface	\$0
Notes: Cross slope of concrete path is up to 2.8%	
CBC: 11B-403.3 Other: ADA 403.3	
8 - 1 Door/Gate	Cotogony 1
Adjust door closer	Category: 1 \$125
Notes: Door opening force is 16 lbs (5 lbs max).	ψ125
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
8 - 2 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Door opening force is 11.5 lbs (5 lbs max)	
CBC: 11B-404.2.9	/
Other: ADA 404.2.9	
8 - 3 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Door opening force is 11 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
19 - 1 Multiple User Restroom	Category: 2
Provide an accessible lavatory	\$3,000
Notes: Centerline of the lavatory is 17.5" from sid	de wall (18" min).
CBC: 11B-606.6	
Other: -	
19 - 2 Multiple User Restroom	Category: 2
Install restroom sign	\$250
Notes: Federal sign is located on the hinge side mounted on the latch side of the door).	of the door (required federal sign is to be
CBC: -	
Other: ADA 703	
21 - 1 Locker Room	Category: 2
Provide clear floor or turning space	\$3,000
Notes: Turning space in the women's changing r	oom is 56" (60" min).
CBC: 11B-803.2	
Other: ADA 304.3.1, ADA 304.3.2, ADA 306.3, A	ADA 803.2

22 - 1 Bath	ning Facility	Category: 2
Replace wate	r controls	\$500
	er controls are located 32" from th min to 27" max).	ne seat on the rear wall in the men's shower
CBC: 11B-	608.5.2	
Other: -		
22 - 2 Bath	ning Facility	Category: 2
Replace wate	r controls	\$500
		the seat on the rear wall in the women's nead mounted higher than 48" max allowed.
CBC: 11B-	608, 11B-608.5.2	
Other: ADA	608	
31 - 1 Swir	nming Pool / Wading Pools / Տլ	bas (int. or ext.) Category: 2
Install handra	ail	\$5,000
Notes: The	clear width between the handrails	s is 51" (33"min to 38" max).
CBC: 11B-	1009.3.3	
Other: ADA	1009.3.3	
Raise or lowe	er existing handrail	\$0
Notes: Hand	drail top surface is mounted 33" A	FF (34" min to 38" max).
CBC: 11B-	1009.3.3	
Other: ADA	1009.3.3	
31 - 2 Swir	nming Pool / Wading Pools / Sr	bas (int. or ext.) Category: 2
Install handra	ail	\$5,000
Notes: The	clear width between the handrails	s is 46.5" (33"min to 38" max).
CBC: 11B-	1009.3.3	
Other: ADA	1009.3.3	
Raise or lowe	er existing handrail	\$0
Notes: Hand	drail top surface is mounted 32.25	5" AFF (34" min to 38" max).
CBC: 11B-	1009.3.3	
Other: ADA	1009.3.3	
Provide an ac	ccessible method for entering t	h e pool \$5,000
Notes: A se	cond accessible entry is not provi	ded.
CBC: 11B-	242.2	
Other: ADA	242.2	

Blackberry Farm 21975 San Fernando Avenue Cupertino, CA

Ν

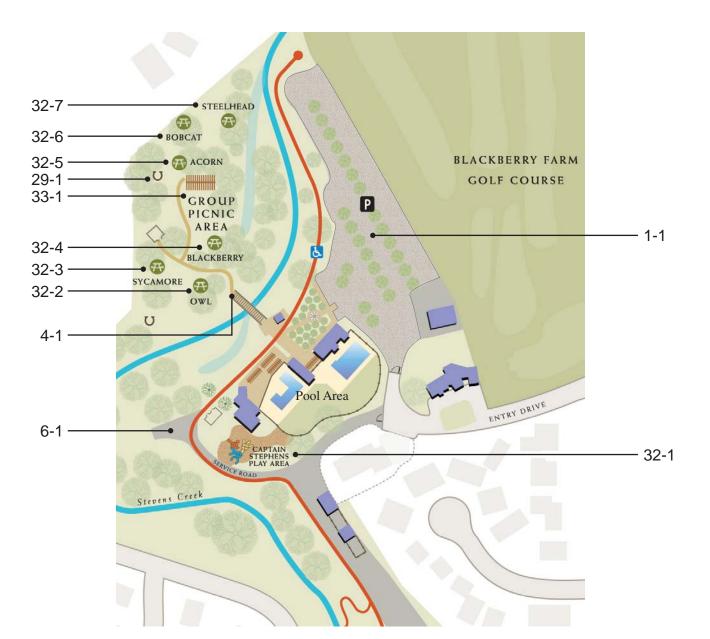

Park	
1 - 1 Parking Area	Category: 1
Install reserved parking sign	\$375
Notes: No tow-away warning sign provided at stree	et entry or at accessible parking space.
No additional sign is provided stating "Minir	mum fine \$250".
CBC: 11B-502.6.2, 11B-502.8	
Other: -	
Provide detectable warnings	\$500
Notes: No detectable warning provided on curb rat travel.	mp leading from parking area to path of
CBC: 11B-705.1.2	
Other: -	
4 - 1 Walk	Category: 1
Grind or patch vertical change of grade	\$250
Notes: 1" change in level at the joint between the elevel (1/4" max, up to 1/2" with a bevel).	end of the pedestrian bridge and ground
CBC: 11B-303.2	
Other: ADA 303.2, ADA 303.3	
6 - 1 Stairway	Category: 2
Install tread striping	\$45
Notes: No tread striping is provided on three risers	leading to the pedestrian bridge.
CBC: 11B-504.4.1	
Other: -	
29 - 1 Game and Sports Area	Category: 3
Provide an accessible path of travel	\$400
Notes: An accessible route to two horse shoe pits over compacted natural surface.	is not provided. Route is 20 linear feet
CBC: 11B-206.2.2	
Other: ADA 206.2.2	
32 - 1 Picnic Area	Category: 2
Provide an accessible path of travel	\$400
Notes: An accessible route to the picnic area is no surface.	t provided to 9 picnic tables on natural
CBC: 11B-403	
Other: AGODA F245.4	

Category: 2
\$400
d to 15 picnic tables on natural
\$6,400
vith15 tables. (2 required).
Category: 2
\$400
d to 15 picnic tables on natural
\$6,400
with 15 tables. (2 required).
Category: 2
\$400
d to 35 picnic tables on natural
\$9,600
with 35 tables. (3 required).

Park	
32 - 5 Picnic Area	Category: 2
Provide an accessible path of travel	\$400
Notes: An accessible route to the picnic area is i	not provided to 4 picnic tables on natural
surface.	
CBC: 11B-403	
Other: AGODA F245.4	
Provide an accessible picnic unit	\$6,400
Notes: An accessible table is not provided in a p	icnic area with 4 tables. (2 required).
CBC: 11B-246.5	
Other: -	
32 - 6 Picnic Area	Category: 2
Provide an accessible path of travel	\$400
Notes: An accessible route to the picnic area is a surface.	not provided to 8 picnic tables on natural
CBC: 11B-403	
Other: AGODA F245.4	
Provide an accessible picnic unit	\$6,400
Notes: An accessible table is not provided in a p	icnic area with 8 tables. (2 required).
CBC: 11B-246.5	
Other: -	
32 - 7 Picnic Area	Category: 2
Provide an accessible path of travel	\$400
Notes: An accessible route to the picnic area is a surface.	not provided to 16 picnic tables on natural
CBC: 11B-403	
Other: AGODA F245.4	
Provide an accessible picnic unit	\$6,400
Notes: An accessible table is not provided in a p	icnic area with 16 tables. (2 required).
CBC: 11B-246.5	
Other: -	

Park		
33 - 1	Outdoor Constructed Features	Category: 2
Modify	operating mechanism	\$250
Notes	s: No accessible grill provided in picnic area mechanism is located 65" AFF (15" min to	
CBC	2: -	
Othe	r: AGODA 1011.3	
Provide	e an accessible path of travel	\$400
Notes	s: An accessible route to the fixed trash/recy	cling container is not provided.
CBC); -	
Othe	r: AGODA 1011.2.1	

Blackberry Farm Golf Course 22100 Stevens Creek Boulevard Cupertino, CA



Blackberry Farm Golf Course

1 - 1 Parking Area	Category: 1
Regrade accessible parking space or access ais	sle \$1,600
Notes: Parking space close to the golf course has Parking spaces in front of the restaurant h CBC: 11B-502.4	
Other: ADA 502.4	
Provide detectable warnings	\$2,500
Notes: No detectable warning provided on 5 curb	
CBC: 11B-705.1.2	
Other: -	
4 - 1 Walk	Category: 1
Grind or patch vertical change of grade	\$250
Notes: 1.25" wide and 0.75" deep change in level bevel).	l at joints (1/4" max, up to 1/2" with a
CBC: 11B-303.2	
Other: ADA 303.2, ADA 303.3	
5 - 1 Ramp	Category: 1
nstall a handrail	\$125
Notes: Handrail gripping surface is obstructed by	spindle hatch.
CBC: 11B-505.6	
Other: ADA 505.6	
Regrade or replace ramp	\$3,400
Notes: Ramp slope is up to 8.6% (8.33% max).	
CBC: 11B-405.2	
Other: ADA 405.2	
7 - 1 Hazard	Category: 1
Remove overhanging or protruding objects	\$125
Notes: Air conditioner overhangs 16.5" from the v	vall at 70.5" AFF (80" min).
CBC: 11B-307.4	
Other: ADA 307.4	
8 - 1 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Door opening force is 7 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	


Blackberry Farm Golf Course

8 - 2	Door/Gate	Catagory: 2
		Category: 2
-	oor closer	\$125
	Door opening force to men's restroom	is 11 ibs (5 ibs max).
	11B-404.2.9	
	ADA 404.2.9	\$ \$\$\$
	or modify door kickplate	\$225
	A smooth and uninterrupted kick plate in the 10" space above the finished flo	e surface is not provided. Door stop is located por.
CBC:	11B-404.2.10	
Other:	ADA 404.2.10	
8 - 3	Door/Gate	Category: 2
Adjust do	oor closer	\$125
Notes:	Door opening force to women's restro	om is 9 lbs (5 lbs max).
CBC:	11B-404.2.9	
Other:	ADA 404.2.9	
Provide c	or modify door kickplate	\$225
	A smooth and uninterrupted kick plate in the 10" space above the finished flo	e surface is not provided. Door stop is located por.
CBC:	11B-404.2.10	
Other:	ADA 404.2.10	
Provide s	strike edge clearance	\$2,500
	Front approach strike-edge clearance (move door to wall)	on the swing side of the door is 1.5" (18" min)
CBC:	11B-404.2.4.1	
Other:	ADA 404.2.4.1	
16 - 1	Built-in Elements	Category: 4
Provide a	an accessible counter	\$1,500
	No accessible service counter provide max).	edin the pro shop. Counter is 40" AFF (34"
CBC:	11B-227.3	
Other:	ADA 227.3	

Blackberry Farm Golf Course

19 - 1	Multiple User Restroom	Category: 2
	or replace compartment door hardware	\$175
	Compartment door does not have handle on inside (U-shaped handles both inside and outside of the doo	•
CBC:	11B-604.8.1.2	
Other:	ADA 604.8.1.2	
Replace	toilet or adjust toilet seat height	\$3,000
Notes:	Water closet seat height is 16" AFF (17" min to 19" m	nax).
CBC:	11B-604.4	
Other:	ADA 604.4	
Replace	or modify grab bars	\$300
Notes:	Side grab bar extends 51" from the rear wall (54" mir	n).
CBC:	11B-604.5.1	
Other:	ADA 604.5.1	
19 - 2	Multiple User Restroom	Category: 2
Provide of	or replace compartment door hardware	\$175
Notes:	Compartment door does not have handle on inside (U-shaped handles both inside and outside of the doo	•
	11B-604.8.1.2	
Other:	ADA 604.8.1.2	
20 - 1	Single User Restroom	Category: 2
	in accessible lavatory	\$3,000
	Centerline of lavatory is 17.5" from side wall (18" min).
CBC:	11B-606.6	
Other:	-	
Provide of	lear floor or turning space	\$3,000
	Maneuvering clearance between urinal and the water	closet is 54" (60" min).
	11B-404.2.4.1	
Other:	ADA 404.2.4.1	
Provide a	in accessible path of travel	\$0
Notes:	There is a 1" threshold at the entrance to the restroom bevel).	m (.25" max, .5" max with
CBC	11B-206.2	
000.		

Blue Pheasant Restaurant 22100 Stevens Creek Boulevard Cupertino, CA

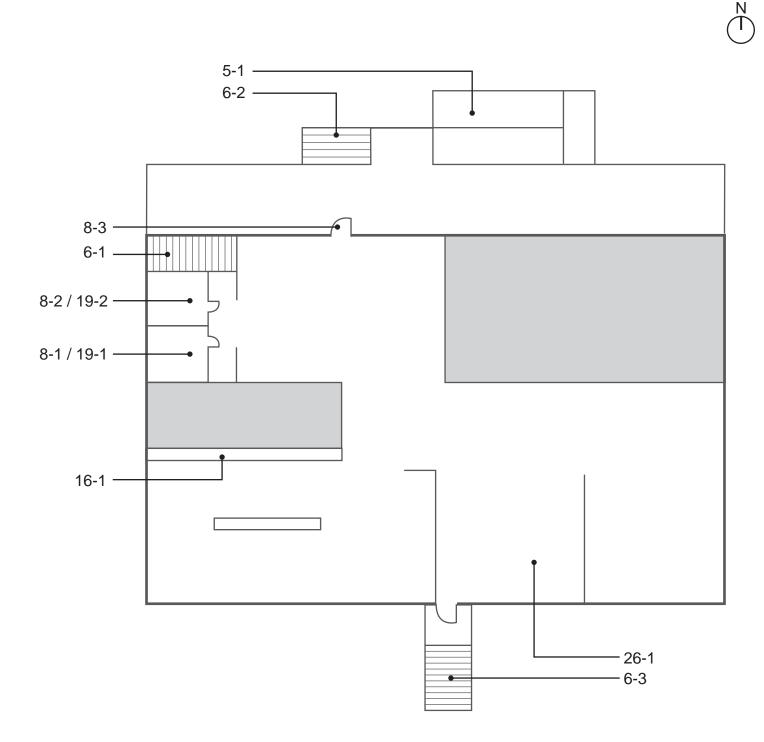


5 - 1	Ramp	Category: 4	
Provide	a level landing	\$2,	500
Notes:	Intermediate landing is 48" by 69" (Min. 60 travel when there is change in direction at		
CBC:	11B-405.7		
Other:	ADA 405.7.4		
6 - 1	Stairway	Category: 4	
Install tr	ead striping		\$30
Notes:	No tread striping provided on top and botto	om risers.	
CBC:	11B-504.4.1		
Other:	-		
Raise or	lower existing handrail	\$	500
	Iower existing handrail Handrail top surface is mounted 32" above max).	•	
Notes:	Handrail top surface is mounted 32" above	•	
Notes: CBC:	Handrail top surface is mounted 32" above max).	•	
Notes: CBC:	Handrail top surface is mounted 32" above max). 11B-505.4 ADA 505.4	e tread surface, 15 risers (34" min to 3	38"
Notes: CBC: Other: Install a	Handrail top surface is mounted 32" above max). 11B-505.4 ADA 505.4	tread surface, 15 risers (34" min to 3	38"
Notes: CBC: Other: Install a Notes:	Handrail top surface is mounted 32" above max). 11B-505.4 ADA 505.4 handrail	tread surface, 15 risers (34" min to 3	38"
Notes: CBC: Other: Install a Notes: CBC:	Handrail top surface is mounted 32" above max). 11B-505.4 ADA 505.4 handrail No extension is not provided at the bottom	tread surface, 15 risers (34" min to 3	500 38" 125
Notes: CBC: Other: Install a Notes: CBC:	Handrail top surface is mounted 32" above max). 11B-505.4 ADA 505.4 handrail No extension is not provided at the bottom 11B-505.10.3	tread surface, 15 risers (34" min to 3	38"
Notes: CBC: Other: Install a Notes: CBC: Other: 6 - 2	Handrail top surface is mounted 32" above max). 11B-505.4 ADA 505.4 handrail No extension is not provided at the bottom 11B-505.10.3 ADA 505.10.3	e tread surface, 15 risers (34" min to 3 \$ of the handrail (12" min). Category: 4	38"
Notes: CBC: Other: Install a Notes: CBC: Other: 6 - 2 Install tree	Handrail top surface is mounted 32" above max). 11B-505.4 ADA 505.4 handrail No extension is not provided at the bottom 11B-505.10.3 ADA 505.10.3 Stairway	e tread surface, 15 risers (34" min to 3 \$ of the handrail (12" min). Category: 4	38"
Notes: CBC: Other: Install a Notes: CBC: Other: 6 - 2 Install tro Notes:	Handrail top surface is mounted 32" above max). 11B-505.4 ADA 505.4 handrail No extension is not provided at the bottom 11B-505.10.3 ADA 505.10.3 Stairway ead striping	e tread surface, 15 risers (34" min to 3 \$ of the handrail (12" min). Category: 4	38"


6 - 3	Stairway	Category: 4
Install tr	ead striping	\$240
Notes:	No tread striping provided on 16 risers	•
CBC:	11B-504.4.1	
Other:	-	
Install a	handrail	\$125
Notes:	Handrail gripping surface is obstructed	by spindle hatch.
CBC:	11B-505.6	
Other:	ADA 505.6	
Repair s	tair nosing	\$2,000
Notes:	Tread nosing overhangs riser horizont depth of .5".	ally at 90 degrees (30 degrees max) at a
CBC:	11B-504.5	
Other:	ADA 504.5	
8 - 1	Door/Gate	Category: 4
Adjust d	oor closer	\$125
Notes:	Door opening force at women's restroo	om is 10 lbs (5 lbs max).
CBC:	11B-404.2.9	
Other:	ADA 404.2.9	
Provide	strike edge clearance	\$2,500
Notes:	Front approach strike-edge clearance	on the pull side of the door is 5.5" (18" min).
CBC:	11B-404.2.4.1	
Other:	ADA 404.2.4.1	
Increase	maneuvering space	\$1,000
Notes:	Front approach maneuvering clearanc min).	e on the pull side of the door is 58.5" (60"
CBC:	11B-404.2.4	
Other:	ADA 404.2.4.1	

8 - 2 Door/Gate	Category: 4
Adjust door closer	\$125
Notes: Door opening force at men's restroom is 10 l	lbs (5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Provide strike edge clearance	\$2,500
Notes: Front approach strike-edge clearance on the	pull side of the door is 9.5" (18" min).
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.1	
Increase maneuvering space	\$1,000
Notes: Front approach maneuvering clearance on th min).	ne pull side of the door is 58.5" (60"
CBC: 11B-404.2.4	
Other: ADA 404.2.4.1	
8 - 3 Door/Gate	Category: 4
Provide strike edge clearance	\$0
Notes: Front approach strike-edge clearance on the due to movable fan (18" min).	e push side of the door is not provided
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.1	
Adjust door closer	\$125
Notes: Door opening force is 13 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Provide sign(s) indicating accessible entries	\$500
Notes: Sign indicating the location of an accessible accessible entry.	entry are not provided at non-
CBC: 11B-216.6	
Other: ADA 216.6	
16 - 1 Built-in Elements	Category: 4
Provide an accessible counter	\$1,500
Notes: No accessible counter provided at the bar (3-	4" max).
CBC: 11B-904.4	
Other: ADA 904.4.1	

19 - 1	Multiple User Restroom	Category: 4	
Provide	or replace compartment door hardware		\$175
Notes:	Compartment door does not have a handle on must have U-shaped handles both inside and closing).		door
CBC:	11B-604.8.1.2		
Other:	ADA 604.8.1.2		
Repositi	on toilet flush controls		\$750
Notes:	Flush control is not located on wide side of fixt located on the open side of the fixture).	ture (flush control is required to	be
CBC:	11B-604.6		
Other:	ADA 604.6		
Replace	or reposition dispenser		\$125
Notes:	Toilet paper is mounted 7" behind the front of	the fixture. (7" min9" max. in fr	ont of
	fixture).		
CBC:	11B-604.7		
Other:	11B-604.7	Category: 4	
Other: 19 - 2	11B-604.7 ADA 604.7	Category: 4	\$175
Other: 19 - 2 Provide	11B-604.7 ADA 604.7 Multiple User Restroom	inside the door and is not self-	closing
Other: 19 - 2 Provide Notes:	11B-604.7 ADA 604.7 Multiple User Restroom or replace compartment door hardware Compartment door does not have a handle on (Compartment door must have U-shaped hand	inside the door and is not self-	closing
Other: 19 - 2 Provide Notes: CBC:	11B-604.7 ADA 604.7 Multiple User Restroom or replace compartment door hardware Compartment door does not have a handle on (Compartment door must have U-shaped hand door and be self-closing).	inside the door and is not self-	closing
Other: 19 - 2 Provide Notes: CBC: Other:	11B-604.7 ADA 604.7 Multiple User Restroom or replace compartment door hardware Compartment door does not have a handle on (Compartment door must have U-shaped hand door and be self-closing). 11B-604.8.1.2	inside the door and is not self-	closing
Other: 19 - 2 Provide Notes: CBC: Other: Modify s	11B-604.7 ADA 604.7 Multiple User Restroom or replace compartment door hardware Compartment door does not have a handle on (Compartment door must have U-shaped hand door and be self-closing). 11B-604.8.1.2 ADA 604.8.1.2	n inside the door and is not self-o	closing he
Other: 19 - 2 Provide Notes: CBC: Other: Modify s Notes:	11B-604.7 ADA 604.7 Multiple User Restroom or replace compartment door hardware Compartment door does not have a handle on (Compartment door must have U-shaped hand door and be self-closing). 11B-604.8.1.2 ADA 604.8.1.2 stall partitions	n inside the door and is not self-o	closing he
Other: 19 - 2 Provide Notes: CBC: Other: Modify s Notes: CBC:	11B-604.7 ADA 604.7 Multiple User Restroom or replace compartment door hardware Compartment door does not have a handle on (Compartment door must have U-shaped hand door and be self-closing). 11B-604.8.1.2 ADA 604.8.1.2 stall partitions Water closet compartment is 59.5" wide (60" r	n inside the door and is not self-o	closing he
Other: 19 - 2 Provide Notes: CBC: Other: Modify s Notes: CBC: Other:	11B-604.7 ADA 604.7 Multiple User Restroom or replace compartment door hardware Compartment door does not have a handle on (Compartment door must have U-shaped hand door and be self-closing). 11B-604.8.1.2 ADA 604.8.1.2 stall partitions Water closet compartment is 59.5" wide (60" r 11B-604.8.1.1	n inside the door and is not self-o dles both inside and outside of t min).	closinç he
Other: 19 - 2 Provide Notes: CBC: Other: Modify s Notes: CBC: Other: Replace	11B-604.7 ADA 604.7 Multiple User Restroom or replace compartment door hardware Compartment door does not have a handle on (Compartment door must have U-shaped hand door and be self-closing). 11B-604.8.1.2 ADA 604.8.1.2 stall partitions Water closet compartment is 59.5" wide (60" r 11B-604.8.1.1 ADA 604.3.1	n inside the door and is not self-o dles both inside and outside of t min).	he \$500
Other: 19 - 2 Provide Notes: CBC: Other: Modify s Notes: CBC: Other: Replace Notes:	11B-604.7 ADA 604.7 Multiple User Restroom or replace compartment door hardware Compartment door does not have a handle on (Compartment door must have U-shaped hand door and be self-closing). 11B-604.8.1.2 ADA 604.8.1.2 Mater closet compartment is 59.5" wide (60" r 11B-604.8.1.1 ADA 604.3.1 or reposition fixtures	n inside the door and is not self-o dles both inside and outside of t min).	stosing he \$500

26 - 1 Eating Area	Category: 4
Provide an accessible table	\$0
Notes: No accessible tables provided in the	restaurant.
CBC: 11B-306.3, 11B-902.3	
Other: ADA 306.3, ADA 902.3	
Provide accessible seating	\$2,500
Notes: No accessible seating provided in re-	staurant. (5% min.)
CBC: 11B-226.1	
Other: ADA 226.1	

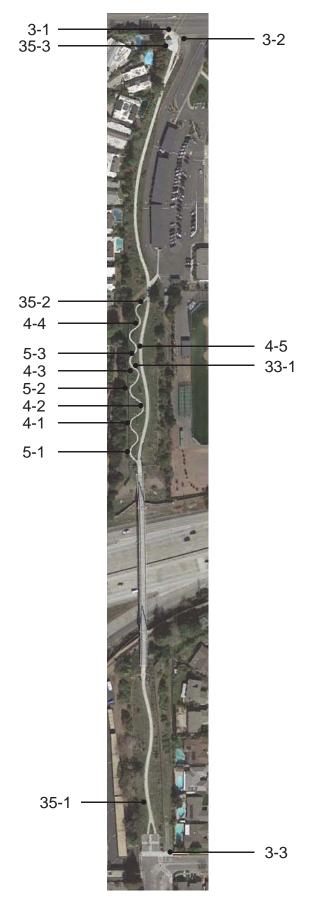

 



City of Cupertino Facilities Surveys

Burnett Pedestrian Bridge

3 - 1 Curb Ramp	Category: 1
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 8.6% (8.33% ma	ax).
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ram	ıp is 5.9% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
3 - 2 Curb Ramp	Category: 1
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ram	ıp is 6.5% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
3 - 3 Curb Ramp	Category: 1
Provide a level landing	\$90
Notes: Top landing has a slope of 2.6% (2% max	ς).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
4 - 1 Walk	Category: 1
Regrade surface	\$760
Notes: Cross slope of concrete path is up to 2.9%	6 for 19 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 2 Walk	Category: 1
Regrade surface	\$6,040
Notes: Running slope of concrete path is up to 5. cross slope is up to 5% for 60 linear feet (
CBC: 11B-403.3	<i>-</i>
Other: ADA 403.3	
4 - 3 Walk	Category: 1
Regrade surface	\$1,960
Notes: Cross slope of concrete path is up to 6.3%	
CBC: 11B-403.3	
Other: ADA 403.3	

Burnett Pedestrian Bridge

4 - 4 Walk	Category: 1
Regrade surface	\$7,040
Notes: Running slope of concrete path is up (2.0% max) for 176 linear feet.	to 6% (5.0% max) and cross slope is up to 4%
CBC: 11B-403.3	
Other: ADA 403.3	
Provide a level landing	\$250
Notes: Level landing at the bottom of the wal	k has a cross slope of up to 2.3% (2% max).
CBC: 11B-403.7	
Other: -	
4 - 5 Walk	Category: 1
Regrade surface	\$600
Notes: Cross slope of concrete path is up to	4.1% for 15 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
5 - 1 Ramp	Category: 1
Provide a level landing	\$150
Notes: Top landing has a slope of 2.3% (2%	max).
CBC: 11B-405.7.1	
Other: ADA 302, ADA 405.7.1	
Provide a level landing	\$250
Notes: Intermediate level landing is 54" long	(60" long min).
CBC: 11B-405.7	
Other: ADA 405.7.4	
5 - 2 Ramp	Category: 1
Regrade or replace ramp	\$0
Notes: Ramp width is 47" (48" min).	
CBC: 11B-405.5	
Other: ADA 405.5	
Provide a level landing	\$150
Notes: Slope of bottom landing is 2.8% (2.0%	6 max).
CBC: 11B-405.7.1	
Other: ADA 302, ADA 405.7.1	

Burnett Pedestrian Bridge

5 - 3 Ramp	Category: 1
Regrade or replace ramp	\$9,350
Notes: Ramp cross slope is up to 5.3	3% for 22 linear feet (2.0% max).
CBC: 11B-405.3	
Other: ADA 405.3	
Provide a level landing	\$150
Notes: Slope of bottom landing is 4.2	1% (2.0% max).
CBC: 11B-405.7.1	
Other: ADA 302, ADA 405.7.1	
33 - 1 Outdoor Constructed Feature	Ires Category: 2
Increase or provide clear floor area	\$700
Notes: A clear floor space is not prov	vided adjacent to the bench (36" by 48" min).
CBC: -	
Other: AGODA 1011.2.1	
35 - 1 Other	Category: 3
Reposition controls	\$200
Notes: Mutt Mitt is 47" AFF and loca 10" to 24" off path of travel).	ated 20" off the path of travel (46" max when between
CBC: 11B-308.3	
Other: ADA 308.3, ADA 308.3.1, AD	DA 308.3.2
35 - 2 Other	Category: 3
Reposition controls	\$200
Notes: Mutt Mitt is 51" AFF located 2 24" off path of travel).	24" off the path of travel (46" max when between 10" to
CBC: 11B-308.3	
Other: ADA 308.3, ADA 308.3.1, AD	DA 308.3.2
35 - 3 Other	Category: 3
Reposition controls	\$200
Notes: Mutt Mitt is located 54" AFF (46" max when between 10" to 24" off path of travel).
CBC: 11B-308.3	
Other: ADA 308.3, ADA 308.3.1, AD	DA 308.3.2

Canyon Oaks Park 21140-21150 Canyon Oak Way Cupertino, CA





Canyon Oaks Park


4 - 1	Walk	Category: 1
Regrade	surface	\$880
Notes:	Cross slope of concrete path is up to 4	.1% for 22 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 2	Walk	Category: 2
Widen w	alk	\$125
Notes:	Width of walk is 32" for 60" due to a prowidth). (Cut back shrub).	otruding shrub at 24" AFF (48" min clear
CBC:	11B-403.5.1.3	
Other:	ADA 403.5.1	
4 - 3	Walk	Category: 1
Regrade	surface	\$1,240
Notes:	Cross slope of concrete path is up to 2	.8% for 31 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
10 - 1	Drinking Fountain	Category: 3
Replace	fountain	\$3,000
Notes:	Bubbler height is 37" AFF. Fountain pro accessible fountain. (Accessible fountain standing fountain has an allowable ran	in is to be located at 36" max. above floor;
CBC:	11B-602.4, 11B-602.7	
Other:	ADA 602.4, ADA 602.7	
Provide	wing walls	\$1,000
Notes:	Drinking fountain is 23" from vertical su 4" must be mounted below 27" or abov	pport at 28.75" AFF (protrusion more than e 80").
CBC:	11B-602.8, 11B-602.9	
Other:	ADA 307	
Dawlaaa	or adjust water controls	\$125
керіасе	•	
	Operating effort of control is 7 lbs (5 lbs	s max).
Notes:		s max).

Canyon Oaks Park

33 - 1 Outdoor Constructed Features	Category: 3
Increase or provide clear floor area	\$70
Notes: A clear floor space is not provided adjacent t by 48" min). 1" change in level in clear floor s play area.	
CBC: -	
Other: AGODA 1011.2.1	
33 - 2 Outdoor Constructed Features	Category: 4
Provide an accessible path of travel	\$1,960
Notes: An accessible route to the fixed benches is n	ot provided, 49 linear feet over grass.
CBC: -	
Other: AGODA 1011.2.1	
Increase or provide clear floor area	\$70
Notes: A clear floor space is not provided adjacent t	o 2 benches (36" by 48" min).
CBC: -	
Other: AGODA 1011.2.1	
33 - 3 Outdoor Constructed Features	Category: 4
Provide an accessible path of travel	\$2,16
Notes: An accessible route to the fixed benches is n	ot provided, 54 linear feet over grass.
CBC: -	
Other: AGODA 1011.2.1	
Increase or provide clear floor area	\$70
Notes: A clear floor space is not provided adjacent t	o 2 benches (36" by 48" min).
CBC: -	
Other: AGODA 1011.2.1	
43 - 1 Play Equipment Area	Category: 2
Install or modify transfer system	\$15,000
Notes: A transfer platform is not provided to the slid	е.
CBC: 11B-1008.3, 11B-1008.3.1.1, 11B-1008.3.1.2	2
Other: ADA 1008.3, ADA 1008.3.1.1, ADA 1008.3.1	.2

City Council Chambers 10400 Torre Ave Cupertino, CA



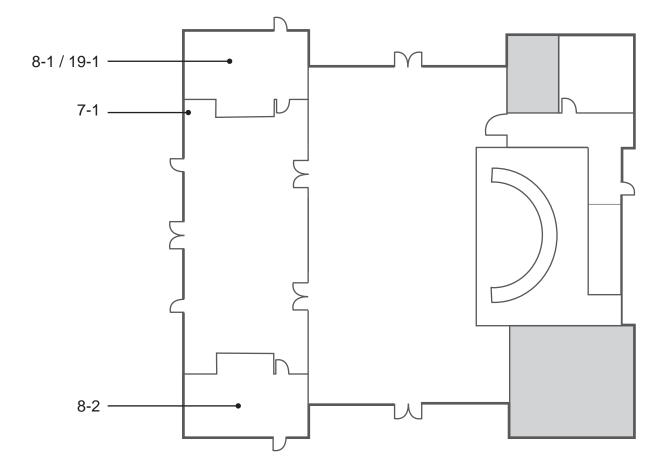


City Council Chambers

7 - 1 Hazard	Category: 1
Remove overhanging or protruding o	bjects \$0
Notes: AED protrudes 7.5" from wall a mounted below 27" or above 8	and at 46" AFF (protrusion more than 4" must be 30").
CBC: 11B-307.4	
Other: ADA 307.4	
8 - 1 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: On the day of survey the autor Door's closing force and closin	matic door was locked from the outside of the building. ng time not surveyed.
CBC: 11B-404.2.8.1, 11B-404.3	
Other: ADA 404.2.8.1, ADA 404.3	
8 - 2 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: On the day of survey the autor Door's closing force and closir	matic door was locked from the outside of the building. ng time not surveyed.
CBC: 11B-404.2.8.1, 11B-404.3	
Other: ADA 404.2.8.1, ADA 404.3	
19 - 1 Multiple User Restroom	Category: 2
Replace or reposition fixtures	\$1,250
Notes: Centerline of water closet is 19	9" from side wall (17" min to 18" max).
CBC: 11B-604.2	
Other: ADA 604.2	

City Hall - Basement 10300 Torre Ave Cupertino, CA




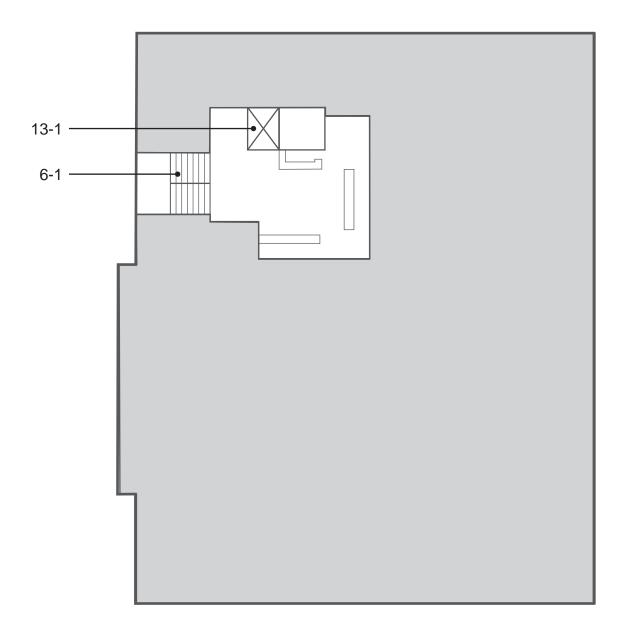

City Hall

Basement	
6 - 1 Stairway	Category: 1
Install tread striping	\$60
Notes: No tread striping provided on top and	bottom risers on two flights of stairs.
CBC: 11B-504.4.1	
Other: -	
Raise or lower existing handrail	\$200
Notes: Handrail top surface is mounted 33" a and 32" above the second flight of sta	5 S
CBC: 11B-505.4	
Other: ADA 505.4	
13 - 1 Elevator	Category: 1
Enlarge elevator	\$55,000
Notes: Elevator car with off-centered door ha wall to side wall (68" wide min, and 5 ²	is an inside car dimension of 66.25" from side I" from front wall to back wall).
CBC: 11B-407.4.1	
Other: ADA 407.4.1	
Adjust elevator controls and labeling	\$900
Notes: Phone control button is not identified	with a tactile sign.
CBC: 11B-407.4.9	
Other: ADA 407.4.9, ADA 703.2	
Adjust or provide elevator signals and indic	ators \$2,000
Notes: A verbal annunciator that announces	the floor at the stop is not provided.
CBC: 11B-407.4.8.2	
Other: ADA 407.4.8.2	

City Hall - Main Floor 10300 Torre Ave Cupertino, CA

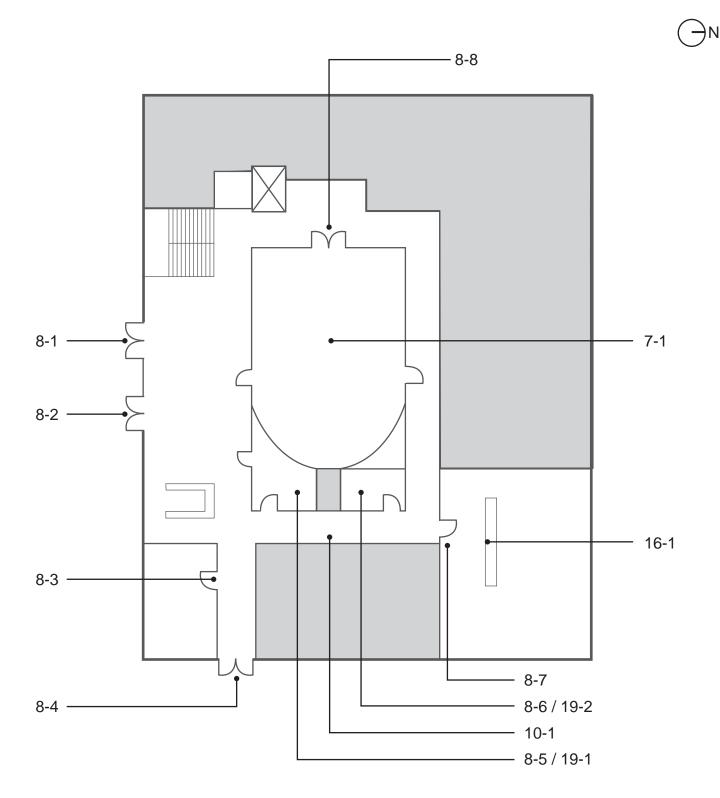

City Hall

Floor 1	
7 - 1 Hazard	Category: 4
Remove overhanging or protruding objects	
	n the wall at 59" AFF in the conference room
(protrusion more than 4" must be mo	
CBC: 11B-307.2	
Other: ADA 307.2	
8 - 1 Door/Gate	Category: 1
Provide an International Symbol of Accessi	bility \$250
Notes: Accessible entry is not marked by the	International Symbol of Accessibility.
CBC: 11B-216.6	
Other: ADA 216.6, ADA 703.7.2.1	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not p	provided for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Regrade surface	\$2,500
Notes: Slope of the maneuvering clear area	is 4.5% (2% max).
CBC: 11B-404.2.4.4	
Other: ADA 404.2.4.4	
8 - 2 Door/Gate	Category: 1
Provide an International Symbol of Accessi	bility \$250
Notes: Accessible entry is not marked by the	International Symbol of Accessibility.
CBC: 11B-216.6	
Other: ADA 216.6, ADA 703.7.2.1	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not p	provided for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Regrade surface	\$2,500
Notes: Slope of the maneuvering clear area	is 4.9% (2% max).
CBC: 11B-404.2.4.4	
Other: ADA 404.2.4.4	
8 - 3 Door/Gate	Category: 2
Install or modify sign	\$250
Notes: A tactile and Braille permanent room	sign is not provided.
CBC: 11B-216.2	
CDC. TTD-2T0.2	

. City Hall

Floor 1	
8 - 4 Door/Gate	Category: 1
Adjust door closer	\$12
Notes: Door opening force is 7 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$25
Notes: A tactile and Braille EXIT sign is not prov	ded in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Regrade surface	\$2,50
Notes: Slope of the maneuvering clear area is 3.	3% (2% max).
CBC: 11B-404.2.4.4	
Other: ADA 404.2.4.4	
8 - 5 Door/Gate	Category: 2
Enlarge door opening	\$1,65
Notes: Height of door closer is 76 3/8" AFF (78"	min).
CBC: 11B-404.2.3	
Other: ADA 404.2.3.2	
8 - 6 Door/Gate	Category: 2
Enlarge door opening	\$1,65
Notes: Height of door closer is 76.5" AFF (78" m	in at door closer).
CBC: 11B-404.2.3	
Other: ADA 404.2.3.2	
8 - 7 Door/Gate	Category: 2
Adjust door closer	\$12
Notes: Door opening force is 7 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$25
Notes: A tactile and Braille permanent room sign	is not provided in the administration offic
CBC: 11B-216.2	
Other: ADA 216.2	

. City Hall

8 - 8 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: On the day of survey the automatic Door's closing force and closing tin	c door was locked from the outside of the building ne not surveyed.
CBC: 11B-404.2.8.1, 11B-404.3	
Other: ADA 404.2.8.1, ADA 404.3	
10 - 1 Drinking Fountain	Category: 3
Replace fountain	\$3,000
Notes: Bubbler height is 30.75" AFF. A sta (38"min to 43" max for a standing p	anding person drinking fountain is not provided person fountain).
CBC: 11B-602.7	
CDC. IID-002.7	
Other: ADA 602.7	
	\$1,500
Other: ADA 602.7	
Other: ADA 602.7 Raise or lower fountain	
Other: ADA 602.7 Raise or lower fountain Notes: Space between floor/ground and b	
Other: ADA 602.7 Raise or lower fountain Notes: Space between floor/ground and b CBC: 11B-306.3	
Other: ADA 602.7 Raise or lower fountain Notes: Space between floor/ground and b CBC: 11B-306.3 Other: ADA 306.3, ADA 306.3.1	oottom of fountain is 26.25" (27" min).
Other: ADA 602.7 Raise or lower fountain Notes: Space between floor/ground and b CBC: 11B-306.3 Other: ADA 306.3, ADA 306.3.1 16 - 1 Built-in Elements	oottom of fountain is 26.25" (27" min). Category: 2 \$1,500
Other: ADA 602.7 Raise or lower fountain Notes: Space between floor/ground and b CBC: 11B-306.3 Other: ADA 306.3, ADA 306.3.1 16 - 1 Built-in Elements Provide an accessible counter	oottom of fountain is 26.25" (27" min). Category: 2 \$1,500

City Hall

Notes: Federal sign is not provided in the men's restroom. State sign is centered at 65" AFF (60"AFF). CBC: 11B-216.8, 11B-703.7.2.6 Other: ADA 703 Replace or reposition mirror \$150 Notes: Bottom of the mirror's reflecting surface is 40.5" AFF (40" max). CBC: 11B-603.3 Other: ADA 603.3 Reposition clothing hooks Notes: Height of coat hook is 69" (48" max). CBC: 11B-603.4 Other: ADA 308 Modify lavatory or counter clearances Motigi lavatory or counter clearances Motes: Clear space beneath the lavatory is 28.25" to front apron (29" min). Knee space measured at 8" deep from the centerline of the lavatory is 26.5" AFF (27" min). CBC: 11B-306.3.1, 11B-306.3.3 Other: ADA 308.3, ADA 306.3.3 Provide clear floor or turning space \$3,000 Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Provide or replace compartment door hardware Provide or and be self-closing). CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). </th <th>Floor 1</th> <th></th> <th></th>	Floor 1		
Notes: Federal sign is not provided in the men's restroom. State sign is centered at 65" AFF (60"AFF). CBC: 11B-216.8, 11B-703.7.2.6 Other: ADA 703 Replace or reposition mirror \$150 Notes: Bottom of the mirror's reflecting surface is 40.5" AFF (40" max). CBC: 11B-603.3 Other: ADA 603.3 Reposition clothing hooks Notes: Height of coat hook is 69" (48" max). CBC: 11B-603.4 Other: ADA 308 Modify lavatory or counter clearances \$1,500 Notes: Clear space beneath the lavatory is 28.25" to front apron (29" min). Knee space measured at 8" deep from the centerline of the lavatory is 26.5" AFF (27" min). CBC: 11B-306.3.1, 11B-306.3.3 Other: ADA 306.3, ADA 306.3.3 Provide clear floor or turning space Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware S175 Notes: Compartment door does not have handle on the inside of the door and is not self-closing (Compartment door must have U-shaped handles both inside and outside of the door and be self-closing). CBC: 11B-604.8.1.2 S000 </th <th>19 - 1 Multiple User Restroom</th> <th>Category</th> <th>/:2</th>	19 - 1 Multiple User Restroom	Category	/:2
AFF (60°AFF). CBC: 11B-216.8, 11B-703.7.2.6 Other: ADA 703 Replace or reposition mirror \$150 Notes: Bottom of the mirror's reflecting surface is 40.5" AFF (40" max). CBC: 11B-603.3 Other: ADA 603.3 Reposition clothing hooks \$125 Notes: Height of coat hook is 69" (48" max). CBC: 11B-603.4 Other: ADA 308 Modify lavatory or counter clearances \$1,500 Notes: Clear space beneath the lavatory is 28.25" to front apron (29" min). Knee space measured at 8" deep from the centerline of the lavatory is 26.5" AFF (27" min). CBC: 11B-306.3.1, 11B-306.3.3 Other: ADA 308.3, ADA 306.3.3 Provide clear floor or turning space \$3,000 Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self- closing (Compartment door must have U-shaped handles both inside and outside of the door and be self-closing). CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 Replace toilet or adjust toilet seat height \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4	nstall restroom sign		\$250
Other: ADA 703 Replace or reposition mirror \$150 Notes: Bottom of the mirror's reflecting surface is 40.5" AFF (40" max). CBC: 11B-603.3 Other: ADA 603.3 (48" max). Reposition clothing hooks \$125 Notes: Height of coat hook is 69" (48" max). CBC: 11B-603.4 Other: ADA 308 (48" max). CBC: 11B-603.4 (48" max). Other: ADA 308 \$1,500 Notes: Clear space beneath the lavatory is 28.25" to front apron (29" min). Knee space measured at 8" deep from the centerline of the lavatory is 26.5" AFF (27" min). CBC: 11B-306.3.1, 11B-306.3.3 Other: ADA 306.3, ADA 306.3.3 Provide clear floor or turning space \$3,000 Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self-closing (Compartment door must have U-shaped handles both inside and outside ot the door and be self-closing). CBC: 11B-604.8.1.2 Wodify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 \$3	•	ed in the men's restroom. State sign is	centered at 65"
Replace or reposition mirror \$150 Notes: Bottom of the mirror's reflecting surface is 40.5" AFF (40" max). CBC: 11B-603.3 Other: ADA 603.3 \$125 Reposition clothing hooks \$125 Notes: Height of coat hook is 69" (48" max). \$125 CBC: 11B-603.4 Other: ADA 308 Modify lavatory or counter clearances \$1,500 Notes: Clear space beneath the lavatory is 28.25" to front apron (29" min). Knee space measured at 8" deep from the centerline of the lavatory is 26.5" AFF (27" min). CBC: 11B-306.3.1, 11B-306.3.3 Other: ADA 306.3, ADA 306.3.3 Provide clear floor or turning space \$3,000 Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door must have U-shaped handles both inside and outside c the door and be self-closing). CBC: 11B-604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4. CBC: 11B-604.4. \$3,000 Notes: Water closet seat height is 15.75" AFF	CBC: 11B-216.8, 11B-703.7.2.6	5	
Notes: Bottom of the mirror's reflecting surface is 40.5" AFF (40" max). CBC: 11B-603.3 Other: ADA 603.3 Reposition clothing hooks \$125 Notes: Height of coat hook is 69" (48" max). CBC: 11B-603.4 Other: ADA 308 0ther: ADA 308 Modify lavatory or counter clearances \$1,500 Notes: Clear space beneath the lavatory is 28.25" to front apron (29" min). Knee space measured at 8" deep from the centerline of the lavatory is 26.5" AFF (27" min). CBC: 11B-306.3.1, 11B-306.3.3 Other: ADA 306.3, ADA 306.3.3 Provide clear floor or turning space \$3,000 Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self-closing (Compartment door must have U-shaped handles both inside and outside of the door and be self-closing). CBC: 11B-604.8.1.2 Wodify stall partitions Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.2 CBC: 11B-604.8.1.1 \$3,000 Other: ADA 604.3.1 \$3,000	Other: ADA 703		
CBC: 11B-603.3 Other: ADA 603.3 Reposition clothing hooks \$125 Notes: Height of coat hook is 69" (48" max). CBC: 11B-603.4 Other: ADA 308 Modify lavatory or counter clearances \$1,500 Notes: Clear space beneath the lavatory is 28.25" to front apron (29" min). Knee space measured at 8" deep from the centerline of the lavatory is 26.5" AFF (27" min). CBC: 11B-306.3.1, 11B-306.3.3 Other: ADA 306.3, ADA 306.3.3 Provide clear floor or turning space \$3,000 Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self- closing (Compartment door must have U-shaped handles both inside and outside of the door and be self-closing). CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 Replace toilet or adjust toilet seat height \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4	Replace or reposition mirror		\$150
Other: ADA 603.3 Reposition clothing hooks \$125 Notes: Height of coat hook is 69" (48" max). CBC: 11B-603.4 Other: ADA 308 \$1,500 Notes: Clear space beneath the lavatory is 28.25" to front apron (29" min). Knee space measured at 8" deep from the centerline of the lavatory is 26.5" AFF (27" min). CBC: 11B-306.3.1, 11B-306.3.3 Other: ADA 306.3, ADA 306.3.3 Provide clear floor or turning space \$3,000 Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self-closing (Compartment door must have U-shaped handles both inside and outside of the door and be self-closing). CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Other: ADA 604.8.1.1 \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 \$3,000 Notes: Water closet seat height \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4 Cher: ADA 604.4 Cher: ADA 604.4	Notes: Bottom of the mirror's refl	lecting surface is 40.5" AFF (40" max).	
Reposition clothing hooks \$125 Notes: Height of coat hook is 69" (48" max). CBC: 11B-603.4 Other: ADA 308 \$1,500 Motes: Clear space beneath the lavatory is 28.25" to front apron (29" min). Knee space measured at 8" deep from the centerline of the lavatory is 26.5" AFF (27" min). CBC: 11B-306.3.1, 11B-306.3.3 Other: ADA 306.3, ADA 306.3.3 Provide clear floor or turning space \$3,000 Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self-closing (Compartment door must have U-shaped handles both inside and outside or the door and be self-closing). CBC: 11B-604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 \$3,000 Replace toilet or adjust toilet seat height \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4 Other: ADA 604.4	CBC: 11B-603.3		
Notes: Height of coat hook is 69" (48" max). CBC: 11B-603.4 Other: ADA 308 Modify lavatory or counter clearances \$1,500 Notes: Clear space beneath the lavatory is 28.25" to front apron (29" min). Knee space measured at 8" deep from the centerline of the lavatory is 26.5" AFF (27" min). CBC: 11B-306.3.1, 11B-306.3.3 Other: ADA 306.3, ADA 306.3.3 Provide clear floor or turning space \$3,000 Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self-closing (Compartment door must have U-shaped handles both inside and outside or the door and be self-closing). CBC: 11B-604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 \$3,000 Replace toilet or adjust toilet seat height \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4 Cher: ADA 604.4	Other: ADA 603.3		
CBC: 11B-603.4 Other: ADA 308 Modify lavatory or counter clearances \$1,500 Notes: Clear space beneath the lavatory is 28.25" to front apron (29" min). Knee space measured at 8" deep from the centerline of the lavatory is 26.5" AFF (27" min). CBC: 11B-306.3.1, 11B-306.3.3 Other: ADA 306.3, ADA 306.3.3 Provide clear floor or turning space \$3,000 Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self- closing (Compartment door must have U-shaped handles both inside and outside of the door and be self-closing). CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 Replace toilet or adjust toilet seat height Replace toilet or adjust toilet seat height Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4	Reposition clothing hooks		\$125
Other: ADA 308 Modify lavatory or counter clearances \$1,500 Notes: Clear space beneath the lavatory is 28.25" to front apron (29" min). Knee space measured at 8" deep from the centerline of the lavatory is 26.5" AFF (27" min). CBC: 11B-306.3.1, 11B-306.3.3 Other: ADA 306.3, ADA 306.3.3 Provide clear floor or turning space \$3,000 Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self-closing (Compartment door must have U-shaped handles both inside and outside or the door and be self-closing). CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 \$3,000 Notes: ADA 604.4 Other: ADA 604.4 \$3,000	Notes: Height of coat hook is 69	" (48" max).	
Modify lavatory or counter clearances \$1,500 Notes: Clear space beneath the lavatory is 28.25" to front apron (29" min). Knee space measured at 8" deep from the centerline of the lavatory is 26.5" AFF (27" min). CBC: 11B-306.3.1, 11B-306.3.3 Other: ADA 306.3, ADA 306.3.3 Provide clear floor or turning space \$3,000 Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self-closing (Compartment door must have U-shaped handles both inside and outside of the door and be self-closing). CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 Replace toilet or adjust toilet seat height \$3,000 \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Cther: ADA 604.4	CBC: 11B-603.4		
Notes: Clear space beneath the lavatory is 28.25" to front apron (29" min). Knee space measured at 8" deep from the centerline of the lavatory is 26.5" AFF (27" min). CBC: 11B-306.3.1, 11B-306.3.3 Other: ADA 306.3, ADA 306.3.3 Provide clear floor or turning space \$3,000 Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self-closing (Compartment door must have U-shaped handles both inside and outside of the door and be self-closing). CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Cther: ADA 604.3.1 Replace toilet or adjust toilet seat height \$3,000 \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Cther: ADA 604.4	Other: ADA 308		
measured at 8" deep from the centerline of the lavatory is 26.5" AFF (27" min). CBC: 11B-306.3.1, 11B-306.3.3 Other: ADA 306.3, ADA 306.3.3 Provide clear floor or turning space \$3,000 Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self- closing (Compartment door must have U-shaped handles both inside and outside of the door and be self-closing). CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 Replace toilet or adjust toilet seat height S3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4	Modify lavatory or counter cleara	ances	\$1,500
Other: ADA 306.3, ADA 306.3.3 Provide clear floor or turning space \$3,000 Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self-closing (Compartment door must have U-shaped handles both inside and outside of the door and be self-closing). CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Other: ADA 604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 \$3,000 Replace toilet or adjust toilet seat height \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4 Cher: ADA 604.4	•	• • •	, ,
Provide clear floor or turning space \$3,000 Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self-closing (Compartment door must have U-shaped handles both inside and outside or the door and be self-closing). CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 \$3,000 Notes: Water closet seat height \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4 \$3,000	CBC: 11B-306.3.1, 11B-306.3.3	3	
Notes: Clear space in front of the urinal is 27.25" wide (30"min). No turning space provided (turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self-closing (Compartment door must have U-shaped handles both inside and outside of the door and be self-closing). CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Other: ADA 604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 \$3,000 Notes: Water closet seat height \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4 Other: ADA 604.4	Other: ADA 306.3, ADA 306.3.3		
(turning space of 60" min). CBC: 11B-305, 11B-603.2.1 Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self- closing (Compartment door must have U-shaped handles both inside and outside of the door and be self-closing). CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Other: ADA 604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 \$3,000 Replace toilet or adjust toilet seat height \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4 Other: ADA 604.4	Provide clear floor or turning spa	ace	\$3,000
Other: ADA 304.3, ADA 305.5, ADA 603.2.1 Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self-closing (Compartment door must have U-shaped handles both inside and outside of the door and be self-closing). CBC: 11B-604.8.1.2 CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 \$3,000 Notes: Water closet seat height \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4 Other: ADA 604.4	•	· · · · · · · · · · · · · · · · · · ·	ning space provided
Provide or replace compartment door hardware \$175 Notes: Compartment door does not have handle on the inside of the door and is not self- closing (Compartment door must have U-shaped handles both inside and outside of the door and be self-closing). CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). \$500 CBC: 11B-604.8.1.1 \$3,000 Other: ADA 604.3.1 \$3,000 Replace toilet or adjust toilet seat height \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4 Other: ADA 604.4	CBC: 11B-305, 11B-603.2.1		
Notes: Compartment door does not have handle on the inside of the door and is not self-closing (Compartment door must have U-shaped handles both inside and outside of the door and be self-closing). CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 Replace toilet or adjust toilet seat height \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4	Other: ADA 304.3, ADA 305.5, A	ADA 603.2.1	
closing (Compartment door must have U-shaped handles both inside and outside of the door and be self-closing). CBC: 11B-604.8.1.2 Modify stall partitions \$500 Notes: Water closet compartment is 57.5" wide (60" min). CBC: 11B-604.8.1.1 Other: ADA 604.3.1 Replace toilet or adjust toilet seat height \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4	Provide or replace compartment	door hardware	\$175
Other: ADA 604.8.1.2\$500Modify stall partitions\$500Notes: Water closet compartment is 57.5" wide (60" min).CBC: 11B-604.8.1.1CBC: 11B-604.3.1Other: ADA 604.3.1\$3,000Replace toilet or adjust toilet seat height\$3,000Notes: Water closet seat height is 15.75" AFF (17" min to 19" max).CBC: 11B-604.4Cther: ADA 604.4	closing (Compartment do	or must have U-shaped handles both i	
Modify stall partitions\$500Notes: Water closet compartment is 57.5" wide (60" min).CBC: 11B-604.8.1.1Other: ADA 604.3.1Replace toilet or adjust toilet seat height\$3,000Notes: Water closet seat height is 15.75" AFF (17" min to 19" max).CBC: 11B-604.4Other: ADA 604.4	CBC: 11B-604.8.1.2		
Notes: Water closet compartment is 57.5" wide (60" min).CBC: 11B-604.8.1.1Other: ADA 604.3.1Replace toilet or adjust toilet seat height\$3,000Notes: Water closet seat height is 15.75" AFF (17" min to 19" max).CBC: 11B-604.4Other: ADA 604.4	Other: ADA 604.8.1.2		
CBC: 11B-604.8.1.1 Other: ADA 604.3.1 Replace toilet or adjust toilet seat height \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4	Modify stall partitions		\$500
Other: ADA 604.3.1 Replace toilet or adjust toilet seat height \$3,000 Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4	Notes: Water closet compartmer	nt is 57.5" wide (60" min).	
Replace toilet or adjust toilet seat height\$3,000Notes: Water closet seat height is 15.75" AFF (17" min to 19" max).CBC: 11B-604.4Other: ADA 604.4Other: ADA 604.4	CBC: 11B-604.8.1.1		
Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4	Other: ADA 604.3.1		
Notes: Water closet seat height is 15.75" AFF (17" min to 19" max). CBC: 11B-604.4 Other: ADA 604.4	Replace toilet or adjust toilet sea	at height	\$3,000
Other: ADA 604.4			
	CBC: 11B-604.4		
	Other: ADA 604.4		
	12/10/2017	Floor 1	Page

. City Hall

Floor '			
19 - 1	Multiple User Restroom	Category: 2	
Replace	e or reposition dispenser		\$125
Notes	: Centerline of the toilet paper is positioned 1 max).	" in front of the water closet (7'	' min to 9"
CBC	: 11B-604.7		
Other	: ADA 604.7		
Install c	r modify visible fire alarm		\$250
Notes	: Visible fire alarm is not provided.		
CBC	: 11B-702.1		
Other	: ADA 702.1		

City Hall


Floor 1	
19 - 2 Multiple User Restroom	Category: 2
Install or modify visible fire alarm	\$250
Notes: A visible fire alarm is not provided.	
CBC: 11B-702.1	
Other: ADA 702.1	
Replace or reposition mirror	\$150
Notes: Bottom of the mirror's reflecting surface is 40.5" AFF	(40" max).
CBC: 11B-603.3	
Other: ADA 603.3	
Reposition clothing hooks	\$125
Notes: Height of coat hook is 58.75" AFF (48" max).	
CBC: 11B-308	
Other: ADA 308	
Modify lavatory or counter clearances	\$1,500
Notes: Clear space beneath the lavatory is 28.5" to front apr	ron (29" min).
CBC: 11B-306.3.1	
Other: -	
Provide or replace compartment door hardware	\$175
Notes: Compartment door does not have handle on the insid closing (Compartment door must have U-shaped har the door and be self-closing).	
CBC: 11B-604.8.1.2	
Other: ADA 604.8.1.2	
Modify stall partitions	\$500
Notes: Water closet compartment is 57.5" wide (60" min).	
CBC: 11B-604.8.1.1	
Other: ADA 604.3.1	
Reposition toilet flush controls	\$750
Notes: Flush control is not located on the wide side of the warequired to be located on the open side of the fixture	•
CBC: 11B-604.6	
Other: ADA 604.6	
Replace toilet or adjust toilet seat height	\$3,000
Notes: Water closet seat is 15.75" AFF (17" min to 19" max)).
CBC: 11B-604.4	
Other: ADA 604.4	

City Hall

Floor 1			
19 - 2	Multiple User Restroom	Category: 2	
Replace	or reposition dispenser		\$125
Notes	: Coin slot at sanitary napkin dispenser is	48" AFF (40" max).	
CBC	: 11B-603.5		
Other	: -		

Civic Center Complex 10800 Torre Ave Cupertino, CA

N T

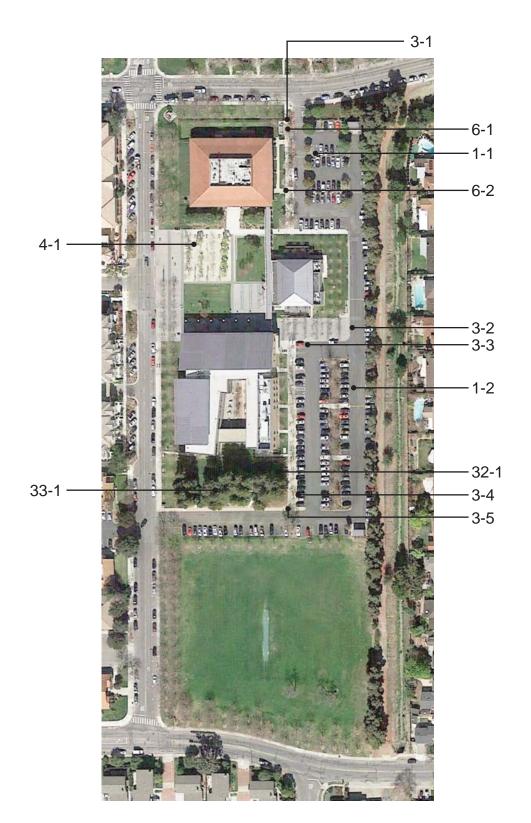

1 - 1 Parking Area	Category: 1
Install van accessible sign	\$375
Notes: A "Van Accessible" sign is not provided. F posted at stalls striped and designated to	
CBC: 11B-502.6	
Other: ADA 208.2.4	
Provide adequate striping	\$100
Notes: The words "No Parking" are not painted ir	the access aisle.
CBC: 11B-502.3.3	
Other: -	
Provide or modify accessible access aisles	\$210
Notes: Van access aisle width is 80" (96" min). S	econd access aisle width is 58" (60" min).
CBC: 11B-502.2, 11B-502.3.1	
Other: ADA 502.3.1	
Provide adequate striping	\$100
Notes: Accessible parking space is 16'-8" long (1	8' min).
CBC: 11B-502.2	
Other: ADA 502.2	
1 - 2 Parking Area	Category: 1
Provide adequate striping	\$100
Notes: The lettering for the "No Parking" is 8" tall	(12" min).
CBC: 11B-502.3.3	
Other: -	
Provide or modify accessible access aisles	\$210
Notes: Access aisle does not have a blue border.	
CBC: 11B-502.3.2, 11B-502.3.3	
Other: ADA 502.3.3	
Provide detectable warnings	\$2,000
Notes: No detectable warning provided on four concerning.	urb ramps adjacent to the accessible
CBC: 11B-705.1.2	
Other: -	


3 - 1 Curb Ramp	Category: 1	
nstall, replace or modify curb ramp		\$2,460
Notes: Slope of the curb ramp is 9.8% (8.33% max).		
CBC: 11B-405.2, 11B-406		
Other: ADA 405.2, ADA 406.1		
Provide detectable warnings		\$0
Notes: Detectable warnings not provided.		
CBC: 11B-247.1.2, 11B-406.5.12		
Other: -		
3 - 2 Curb Ramp	Category: 1	
Provide detectable warnings		\$1,000
Notes: Detectable warnings not provided.		
CBC: 11B-247.1.2, 11B-406.5.12		
Other: -		
Provide a level landing		\$2,500
Notes: Counter slope at the base of the curb ramp is	s 8.8% (5.0% max).	
CBC: 11B-406.5.8		
Other: ADA 406.2		
3 - 3 Curb Ramp	Category: 1	
Provide detectable warnings		\$1,000
Notes: Detectable warnings not provided.		
CBC: 11B-247.1.2, 11B-406.5.12		
Other: -		
Provide a level landing		\$2,500
Notes: Counter slope at the base of the curb ramp is	s 10.6% (5.0% max).	
CBC: 11B-406.5.8		
Other: ADA 406.2		
3 - 4 Curb Ramp	Category: 1	
Install, replace or modify curb ramp		\$2,460
Notes: Slope of the curb ramp is 10% (8.33% max).		
CBC: 11B-405.2, 11B-406		
Other: ADA 405.2, ADA 406.1		
Provide detectable warnings		\$0
Notes: Detectable warnings not provided.		
CBC: 11B-247.1.2, 11B-406.5.12		
Other: -		

3 - 5 Curb Ramp	Category: 1
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 9.6% (8.33% ma	ax).
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
4 - 1 Walk	Category: 1
Grind or patch vertical change of grade	\$250
Notes: Change in level at transition from concrete Maintain DG. (1/4" max, up to 1/2" with a l	
CBC: 11B-303.2	
Other: ADA 303.2, ADA 303.3	
6 - 1 Stairway	Category: 1
Raise or lower existing handrail	\$300
Notes: Handrail top surface is mounted 28" above	e 6 stair nosings (34" min to 38" max).
CBC: 11B-505.4	
Other: ADA 505.4	
6 - 2 Stairway	Category: 1
Raise or lower existing handrail	\$250
Notes: Handrail top surface is mounted 33" above	e the stair nosing (34" min to 38" max).
CBC: 11B-505.4	
Other: ADA 505.4	
Install tread striping	\$75
Notes: No tread striping provided on 5 risers.	
CBC: 11B-504.4.1	
Other: -	

32 - 1 Picnic Area	Category: 2
Provide an accessible path of travel	\$400
Notes: An accessible route to the picnic area is not path to two picnic tables.	t provided, 10 linear feet over grass fron
CBC: 11B-403	
Other: AGODA F245.4	
Increase or provide clear floor area	\$700
Notes: A 36" min clear space around the picnic tab	le is not provided.
CBC: -	
Other: AGODA 1011.2.1	
33 - 1 Outdoor Constructed Features	Category: 4
Increase or provide clear floor area	\$700
Notes: A clear floor space is not provided adjacent	to four benches (36" by 48" min).
CBC: -	
Other: AGODA 1011.2.1	


Creekside Park 10455 Miller Avenue Cupertino, CA



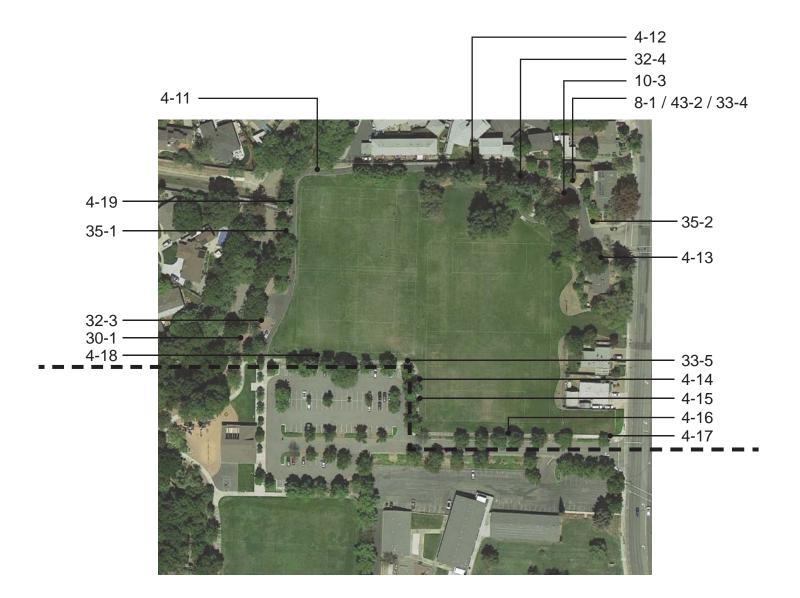

Creekside Park 10455 Miller Avenue Cupertino, CA



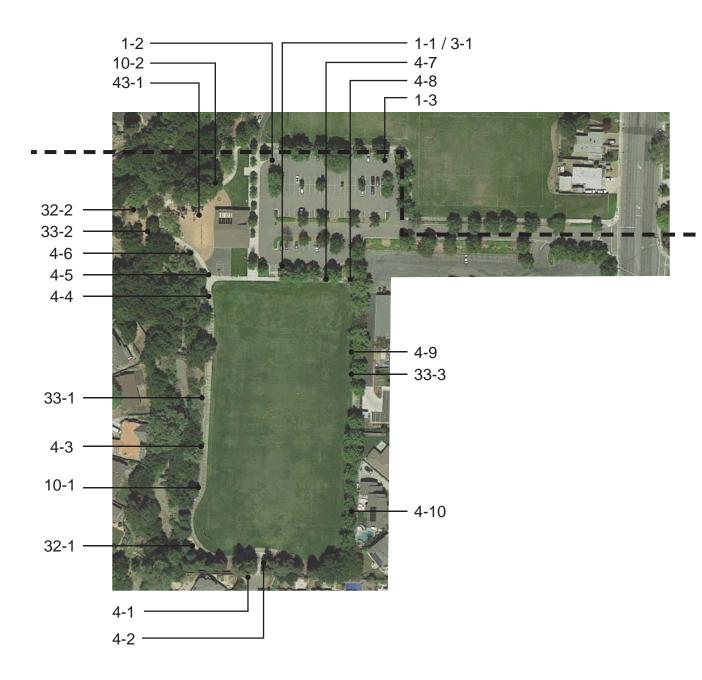

1 - 1	Parking Area Category	y: 1
Provide	adequate striping	\$100
Notes:	The words "No Parking" are not painted in the access aisle. Access are 94" wide (108" min).	cessible parking
CBC:	11B-502.3.3	
Other:	-	
Regrade	accessible parking space or access aisle	\$1,600
Notes:	Slopes of the first 42" of the parking spaces and access aisles a max). The slope of one of the accessible parking spaces is 7.89	•
	11B-502.4	
Other:	ADA 502.4	
	or modify accessible access aisles	\$210
	Van access aisle width is 60" (96" min). Access aisle does not h	have a blue border.
	11B-502.2, 11B-502.3.1	
Other:	ADA 502.3.1	
1 - 2	Parking Area Category	y: 1
Provide	adequate striping	\$100
Notes:	The words "No Parking" are not painted in the access aisle.	
CBC:	11B-502.3.3	
Other:	-	
Provide	detectable warnings	\$500
Notes:	No detectable warning provided on the ramp from accessible path of travel.	arking space to the
CBC:	11B-705.1.2	
Other:	-	
	accessible parking space or access aisle	\$1,600
Notes:	Slope of front 42" in the parking space is 4% ,and the slope in t 7% (2.0% max).	he access aisles is
CBC:	11B-502.4	
Other:	ADA 502.4	
Provide	or modify accessible access aisles	\$210
Notes:	Van access aisle width is 60" (96" min). Access aisle does not h Accessible parking spaces are 107" wide (108" min).	nave a blue border.
CBC:	11B-502.2, 11B-502.3.1	
Other [.]	ADA 502.3.1	

1 - 3 Parking Area	Category: 1
Provide adequate striping	\$100
Notes: The words "No Parking" are not painted in the spaces are 7' wide (9' min).	e access aisle. Accessible parking
CBC: 11B-502.3.3	
Other: -	
Provide or modify accessible access aisles	\$210
Notes: Access aisle does not have a blue border.	
CBC: 11B-502.3.2, 11B-502.3.3	
Other: ADA 502.3.3	
Regrade accessible parking space or access aisle	\$1,600
Notes: Slope of access aisle is 7% (2.0% max). Built (2% max).	t-up curb ramp has a slope of 8.1%
CBC: 11B-502.4	
Other: ADA 502.4	
Repair surface	\$250
Notes: The drain in the access aisle has .75" gaps (.5	5" max).
CBC: 11B-302.3	
Other: ADA 302.3	
Provide detectable warnings	\$500
Notes: No detectable warning provided on ramp from	accessible parking space to walk.
CBC: 11B-705.1.2	
Other: -	
3 - 1 Curb Ramp	Category: 1
Install, replace or modify curb ramp	\$2,460
Notes: Slope of ramp from the accessible parking spa	ace to the walk is 9% (8.33% max).
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	

4 - 1 Walk	Category: 1
Regrade surface	\$2,640
Notes: Cross slope of concrete path is up to	3.2% for 66 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
Grind or patch vertical change of grade	\$0
Notes: Two 1" deflections at tree roots (1/4" r	max, 1/2" with bevel).
CBC: 11B-303.2	
Other: ADA 303.2, ADA 303.3	
4 - 2 Walk	Category: 1
Regrade surface	\$800
Notes: Running slope of concrete path is up	to 6% (5.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 3 Walk	Category: 1
Regrade surface	\$5,680
Notes: Cross slope of concrete path is up to	3.4% for 142 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 4 Walk	Category: 1
Regrade surface	\$2,600
Notes: Cross slope of concrete path is up to	
CBC: 11B-403.3	<u>_</u>
Other: ADA 403.3	
4 - 5 Walk	Category: 1
Grind or patch vertical change of grade	\$250
Notes: 1" change in level at concrete/asphalt	joint (1/4" max, up to 1/2" with a bevel).
CBC: 11B-303.2	
Other: ADA 303.2, ADA 303.3	
4-6 Walk	Category: 1
Regrade surface	\$4,400
Notes: Cross slope of concrete path is up to	
CBC: 11B-403.3	······ · · · · · · · · · · · · · · · ·
Other: ADA 403.3	

4 - 7	Walk	Category: 1	
Regrade	surface		\$200
Notes:	Cross slope of concrete path is up	o to 2.3% at sliced pavement (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 8	Walk	Category: 1	
Regrade	surface		\$1,200
Notes:	Cross slope of concrete path is up	o to 2.4% for 30 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 9	Walk	Category: 1	
Regrade	surface		\$3,120
Notes:	Cross slope of concrete path is up	o to 2.7% for 78 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 10	Walk	Category: 1	
Regrade	surface		\$12,960
Notes:	Cross slope of concrete path is up	o to 4 for 324 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 11	Walk	Category: 1	
Regrade	surface		\$1,440
Notes:	Cross slope of concrete path is up	o to 4% for 36 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 12	Walk	Category: 1	
Regrade	surface		\$6,560
Notes:	Cross slope of concrete path is up	to 3.9% for 164 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 13	Walk	Category: 1	
Viden w	alk		\$120
Notes:	Width of walk is 42" for 14.5 linea bollards (48" min).	r feet at the entrance to the park due to ro	ow of
CBC:	11B-403.5.1.3		
Other [.]	ADA 403.5.1		

4 - 14 W	alk	Category: 1	
Regrade s	urface		\$2,080
Notes: C	ross slope of concrete path is up to 3.4%	for 52 linear feet (2.0% max).	
CBC: 1 ⁻	IB-403.3		
Other: A	DA 403.3		
4 - 15 W	alk	Category: 1	
Regrade s	urface		\$920
Notes: C	ross slope of concrete path is up to 3.6%	for 23 linear feet (2.0% max).	
CBC: 1	IB-403.3		
Other: A	DA 403.3		
4 - 16 W	alk	Category: 1	
Regrade s	urface		\$2,440
Notes: C	ross slope of concrete path is up to 2.7%	for 61 linear feet (2.0% max).	
CBC: 1	IB-403.3		
Other: A	DA 403.3		
4 - 17 W	alk	Category: 1	
Regrade s	urface		\$400
Notes: R	unning slope of concrete path is up to 9.9	9% (5.0% max).	
CBC: 1 ⁻	IB-403.3		
Other: A	DA 403.3		
4 - 18 W	alk	Category: 1	
Regrade s	urface		\$8,880
Notes: C	ross slope of concrete path is up to 4% for	or 222 linear feet (2.0% max).	
CBC: 1	IB-403.3		
Other: A	DA 403.3		
Grind or pa	atch vertical change of grade		\$0
Notes: 1'	change in level and 2" gaps in walk (1/4	" max, up to 1/2" with a bevel).	
CBC: 1	IB-303.2		
Other: A	DA 303.2, ADA 303.3		
4 - 19 W	alk	Category: 1	
Regrade s	urface		\$5,600
	ross slope of concrete path is up to 4.5%	for 140 linear feet (2.0% max).	
	IB-403.3	······································	
Other: A	DA 403.3		

8 - 1 Door/Gate	Category: 1
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate surface	is not provided.
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Replace or modify door threshold	\$125
Notes: Threshold has a vertical change of 1.5" from w 1/2" with a bevel).	valk to sand surface (1/4" max, up to
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
10 - 1 Drinking Fountain	Category: 3
Install an additional high or low fountain	\$3,000
Notes: A standing person water fountain is not provide	ed (38" min to 43" max).
CBC: 11B-211.2	
Other: ADA 211.2	
10 - 2 Drinking Fountain	Category: 3
Install an additional high or low fountain	\$3,000
Notes: A wheelchair accessible fountain is not provide	ed (36" max).
CBC: 11B-211.2	
Other: ADA 211.2	
Adjust the water stream height or direction	\$125
Notes: The flow of the water is 3.5" high (4" high min)	
CBC: 11B-602.6	
Other: ADA 602.6	
10 - 3 Drinking Fountain	Category: 3
Install an additional high or low fountain	\$3,000
Notes: A standing person water fountain is not provide	ed (38" min to 43" max).
CBC: 11B-211.2	
Other: ADA 211.2	
30 - 1 Exercise Machines and Equipment	Category: 2
Provide an accessible path of travel	\$1,250
Notes: An accessible path of travel is not provided to surface.	the workout area, inaccessible
CBC: 11B-206.2	
Other: ADA 206.2, ADA 206.2.2	


32 - 1 Picnic Area	Category: 2
ncrease or provide clear floo	r area \$700
•	around the picnic table overlaps with the clear floor space of r space on one side and 28" on the other (36" min).
CBC: -	
Other: AGODA 1011.2.1	
32 - 2 Picnic Area	Category: 2
Provide an accessible picnic	unit \$6,400
Notes: One accessible table i	s provided in a picnic area with 5 tables. (2 required).
CBC: 11B-246.5	
Other: -	
Provide an accessible path of	travel \$220
Notes: An accessible route to	the picnic area is not provided, 5.5 linear feet over grass.
CBC: 11B-403	
Other: AGODA F245.4	
ncrease or provide clear floo	r area \$700
Notes: The clear space arour clear floor space of the	nd the picnic table ranges from 26"-32" and overlaps with the e grill.
CBC: -	
Other: AGODA 1011.2.1	
32 - 3 Picnic Area	Category: 2
ncrease or provide clear floo	r area \$700
Notes: A 36" min clear space one side and 26" on th	around the picnic table is not provided. 30" clear space on ne other side.
CBC: -	
Other: AGODA 1011.2.1	
32 - 4 Picnic Area	Category: 2
ncrease or provide clear floo	r area \$700
	nd the picnic table is 23" on one side of the table and 28" on o clear floor space provided at grill.
CBC: -	
Other: AGODA 1011.2.1	

33 - 1 Outdoor Constructed Features	Category: 2	
Increase or provide clear floor area		\$700
Notes: Clear floor space adjacent to the bench is 24	4" deep (36" by 48" min).	
CBC: -		
Other: AGODA 1011.2.1		
Provide an accessible path of travel		\$120
Notes: Trash container is 34" off the path of travel (AFF).	24" max reach depth for a height	of 46'
CBC: -		
Other: AGODA 1011.2.1		
33 - 2 Outdoor Constructed Features	Category: 2	
Provide an accessible path of travel		\$480
Notes: An accessible route to the fixed bench is not benches.	provided, 12 linear feet to three	
CBC: -		
Other: AGODA 1011.2.1		
33 - 3 Outdoor Constructed Features	Category: 2	
Increase or provide clear floor area		\$700
Notes: A clear floor space is not provided adjacent	to the benches (36" by 48" min).	
CBC: -		
Other: AGODA 1011.2.1		
33 - 4 Outdoor Constructed Features	Category: 2	
Provide an accessible path of travel		\$400
	ot provided two 3" curbs in the	nath o
Notes: An accessible route to the fixed benches is r travel (an accessible route must be free of s route to the fixed trash/recycling container is	teps or changes in level). An acc	
travel (an accessible route must be free of strong route to the fixed trash/recycling container is CBC: -	teps or changes in level). An acc	
travel (an accessible route must be free of si route to the fixed trash/recycling container is	teps or changes in level). An acc	
travel (an accessible route must be free of strong route to the fixed trash/recycling container is CBC: -	teps or changes in level). An acc	essible
travel (an accessible route must be free of st route to the fixed trash/recycling container is CBC: - Other: AGODA 1011.2.1	teps or changes in level). An acc not provided.	essible
travel (an accessible route must be free of st route to the fixed trash/recycling container is CBC: - Other: AGODA 1011.2.1 Increase or provide clear floor area	teps or changes in level). An acc not provided.	essible
travel (an accessible route must be free of st route to the fixed trash/recycling container is CBC: - Other: AGODA 1011.2.1 Increase or provide clear floor area Notes: A clear floor space is not provided adjacent	teps or changes in level). An acc not provided.	
travel (an accessible route must be free of st route to the fixed trash/recycling container is CBC: - Other: AGODA 1011.2.1 Increase or provide clear floor area Notes: A clear floor space is not provided adjacent CBC: -	teps or changes in level). An acc not provided.	essible
travel (an accessible route must be free of si route to the fixed trash/recycling container is CBC: - Other: AGODA 1011.2.1 Increase or provide clear floor area Notes: A clear floor space is not provided adjacent CBC: - Other: AGODA 1011.2.1	teps or changes in level). An acc not provided. to the bench (36" by 48" min).	essible
travel (an accessible route must be free of st route to the fixed trash/recycling container is CBC: - Other: AGODA 1011.2.1 Increase or provide clear floor area Notes: A clear floor space is not provided adjacent to CBC: - Other: AGODA 1011.2.1 35 - 1 Other	teps or changes in level). An acc not provided. to the bench (36" by 48" min). Category: 3	\$700 \$200
travel (an accessible route must be free of st route to the fixed trash/recycling container is CBC: - Other: AGODA 1011.2.1 Increase or provide clear floor area Notes: A clear floor space is not provided adjacent f CBC: - Other: AGODA 1011.2.1 35 - 1 Other Reposition controls Notes: Trash container is 34" off the path of travel (teps or changes in level). An acc not provided. to the bench (36" by 48" min). Category: 3	\$700 \$200

35 - 2 Other	Category: 3
Reposition controls	\$200
Notes: Mutt Mitt is mounted 50" AFF 27" off the p between 10"-24").	oath of travel (46" max when reach is
CBC: 11B-308.3	
Other: ADA 308.3, ADA 308.3.1, ADA 308.3.2	
35 - 3 Other	Category: 3
Reposition controls	\$200
Notes: Trash container is 32" off the path of trave AFF).	el (24" max reach depth for a height of 46"
CBC: 11B-308.3	
Other: ADA 308.3, ADA 308.3.1, ADA 308.3.2	
43 - 1 Play Equipment Area	Category: 2
Provide an accessible path of travel	\$40
around the play area (An accessible route CBC: 11B-206.2.17 Other: ADA 206.2.17	e must be free of steps or changes in level)
Install or modify transfer system	\$15,000
Notes: A transfer system is not provided to deck	serving 2 slides.
CBC: 11B-1008.3	
Other: ADA 1008.3	
Provide play components	\$5,000
Notes: An accessible route to 50% of the compo	nents is not provided.
CBC: 11B-240.2.2	
Other: ADA 240.2.2	
43 - 2 Play Equipment Area	Category: 2
Provide an accessible path of travel	\$1,080
Notes: An accessible route to the sand box and p and 27 linear feet of sand surface (An acc	alov area is not provided due to a 4" ourb
changes in level and the surface must be	cessible route must be free of steps or
changes in level and the surface must be CBC: 11B-206.2.17	cessible route must be free of steps or

Creekside Park - Building 10455 Miller Ave Cupertino, CA



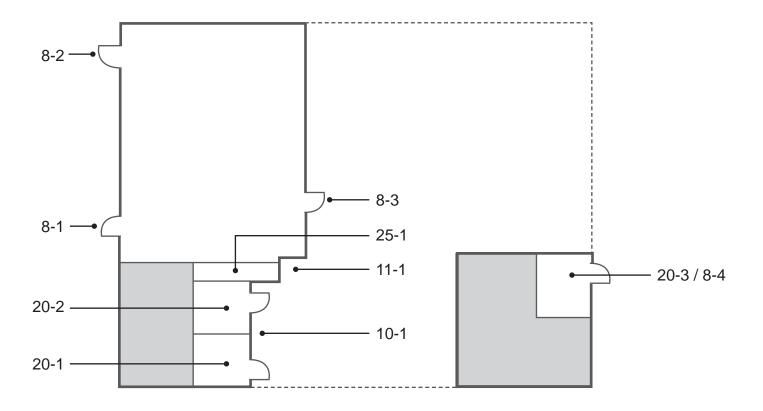

Building		
8 - 1 Door/Gate	Category: 1	
Adjust door closer		\$125
Notes: Door opening force is 10 lbs (5 lbs max). (Initial	stick of the door).	
CBC: 11B-404.2.9		
Other: ADA 404.2.9		
Install or modify sign		\$250
Notes: A tactile and Braille EXIT sign is not provided in	passageway for emerge	ncy exit.
CBC: 1011		
Other: ADA 216.4.1, ADA 703.4.1		
8 - 2 Door/Gate	Category: 1	
Adjust door closer		\$125
Notes: Door opening force is 8 lbs (5 lbs max).		
CBC: 11B-404.2.9		
Other: ADA 404.2.9		
Install or modify sign		\$250
Notes: A tactile and Braille EXIT sign is not provided in	passageway for emerge	ncy exit.
CBC: 1011		
Other: ADA 216.4.1, ADA 703.4.1		
8 - 3 Door/Gate	Category: 1	
Adjust door closer		\$125
Notes: Door opening force is 10 lbs (5 lbs max).		
CBC: 11B-404.2.9		
Other: ADA 404.2.9		
Install or modify sign		\$250
Notes: A tactile and Braille EXIT sign is not provided in	passageway for emerge	ncy exit.
CBC: 1011		
Other: ADA 216.4.1, ADA 703.4.1		
8 - 4 Door/Gate	Category: 2	
Adjust door closer		\$125
Notes: Door opening force is 7 lbs (5 lbs max).		
CBC: 11B-404.2.9		
Other: ADA 404.2.9		

10 - 1 Drinking Fountain	Category: 3
Provide wing walls	\$1,000
e .	les 18" from vertical support at 27.25" AFF (protrusion more d below 27" or above 80").
CBC: 11B-602.8, 11B-602.9	
Other: ADA 307	
11 - 1 Telephone	Category: 3
Install volume control sign	\$225
Notes: Volume control is not pro	ovided.
CBC: 11B-703.7.2.3	
Other: ADA 703.7.2.3	
Reposition phone equipment	\$500
Notes: Coin slot is 53" AFF (48"	max).
CBC: 11B-308.3	
Other: ADA 308.3, ADA 308.3.1	. ADA 308.3.2

Building 20 - 1 Single User Restroom	Category: 2
Modify lavatory or counter clearances	\$1,500
Notes: Height of the lavatory rim is 34.5" AFF (34" max	
CBC: 11B-606.3	·)·
Other: ADA 606.3	
Replace or reposition dispenser	\$125
Notes: Soap dispenser is 42" AFF (40" max).	• ·
CBC: 11B-603.5	
Other: -	
Reposition toilet flush controls	\$750
Notes: Operating effort of flush control is 15 lbs (5 lbs n closet is not located on the wide side of the wate	
CBC: 11B-604.6	
Other: ADA 604.6	
Replace toilet or adjust toilet seat height	\$3,000
Notes: Water closet seat height is 20" AFF (17" min to	19" max).
CBC: 11B-604.4	
Other: ADA 604.4	
Replace or reposition fixtures	\$1,250
Notes: The water closet centerline is 19.5" from the wa	ll (17" min to 18" max).
CBC: 11B-604.2	
Other: ADA 604.2	
Provide clear floor or turning space	\$3,000
Notes: A 60" min diameter turning space unobstructed is not provided due to movable trash can. There clear floor space (2% max).	0
CBC: 11B-603.2.1	
Other: ADA 304.3.1, ADA 306.3, ADA 603.2.1	
Reposition clothing hooks	\$125
Notes: Height of coat hook is 59" (48" max).	
CBC: 11B-603.4	
Other: ADA 308	

Creekside Park

Building	
20 - 2 Single User Restroom	Category: 2
Modify lavatory or counter clearances	\$1,500
Notes: Height of the lavatory rim is 44.25" AFF (34	" max).
CBC: 11B-606.3	
Other: ADA 606.3	
Replace or reposition dispenser	\$125
Notes: Soap dispenser is 41.5" AFF (40" max). To max). Centerline of the toilet paper is 12" in max).	• •
CBC: 11B-603.5	
Other: -	
Reposition toilet flush controls	\$750
Notes: Operating effort of flush control is 16 lbs (5 closet is not located on the wide side of the	
CBC: 11B-604.6	
Other: ADA 604.6	
Replace toilet or adjust toilet seat height	\$3,000
Notes: Water closet seat height is 19.5" AFF (17"	min to 19" max).
CBC: 11B-604.4	
Other: ADA 604.4	
Reposition clothing hooks	\$125
Notes: Height of coat hooks is 59" (48" max).	
CBC: 11B-603.4	
Other: ADA 308	
Provide clear floor or turning space	\$3,000
Notes: A 60" min diameter turning space unobstru is not provided due to movable trash can. T clear floor space (2% max).	-
CBC: 11B-603.2.1	
Other: ADA 304.3.1, ADA 306.3, ADA 603.2.1	

Creekside Park


Buildin		
20 - 3	Single User Restroom	Category: 2
Replace	or reposition dispenser	\$125
Notes:	Soap dispenser is 42" AFF (40" max). Paper tow (40" max). Height of operating mechanism of bal max). Diaper changing surface is 45.5" AFF (28" toilet paper is 12" in front of the water closet (7"	by changing station is 49" AFF (40" ' min to 34" max). Centerline of the
CBC:	11B-603.5	
Other:	-	
Repositi	on toilet flush controls	\$750
Notes:	Operating effort of flush control is 20 lbs (5 lbs m the wide side of the water closet.	nax). Flush control is not located on
CBC:	11B-604.6	
Other:	ADA 604.6	
Install re	stroom sign	\$0
Notes:	Neither state nor federal signs provided on temp	orary door.
CBC:	11B-216.8, 703.7.2.6	
Other:	ADA 703	
Repositi	on clothing hooks	\$125
Notes:	Height of coat hook is 61.5" (48" max).	
CBC:	11B-603.4	
Other:	ADA 308	
Replace	or reposition fixtures	\$1,250
Notes:	The water closet centerline is 18.75" from the wa	all (17" min to 18" max).
	11B-604.2	
Othory	ADA 604.2	

Creekside Park

25 - 1 Kitchen	Category: 2
Modify counter height	\$1,500
Notes: Height of kitchen work surface is 34 3/8" AF	FF (28" AFF min to 34" AFF max).
CBC: 11B-804.3.2	
Other: ADA 804.3.2	
Provide knee and toe clearance	\$0
Notes: Knee space under the sink is 7" deep (11" of	deep at 9" AFF, and 8" deep at 27" AFF
CBC: 11B-306.3.3	
Other: ADA 306.3, ADA 306.3.3	
Replace or reposition dispenser	\$125
Notes: Paper towel dispenser is 52" AFF (48" AFF	max).
CBC: 11B-606.1	
Other: ADA 308, ADA 308.2.1, ADA 308.2.2, ADA	308.3.1, ADA 308.3.2
Reposition Controls	\$250
Notes: Microwave controls are located at 52.5" abo	ove the floor (15" min. to 48" max.)
CBC: 11B-308	
Other: ADA 308	

Franco Park 10981 Franco Court Cupertino, CA



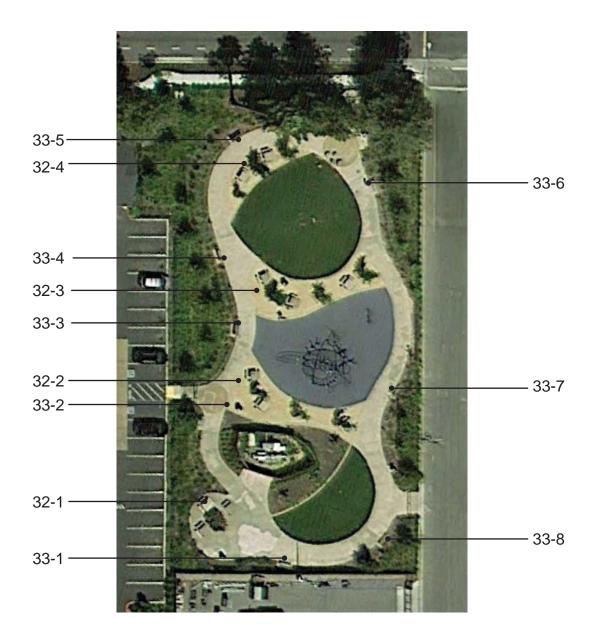

Franco Park

32 - 1 Picnic Area	Category: 4
Increase or provide clear floor area	\$700
Notes: A 36" min clear space around the picn	nic table is not provided.
CBC: -	
Other: AGODA 1011.2.1	
Provide an accessible table	\$500
Notes: Knee clearance is 25 1/8" measured a tabletop (27" min).	at 8" horizontally from the front face of the
CBC: 11B-306.3	
Other: -	
32 - 2 Picnic Area	Category: 2
Provide an accessible path of travel	\$240
Notes: 1" change in levels from concrete rout accessible route must be free of steps	
CBC: 11B-403	
Other: AGODA F245.4	
Increase or provide clear floor area	\$700
Notes: A 36" min clear space around the picn	nic table is not provided.
CBC: -	
Other: AGODA 1011.2.1	
32 - 3 Picnic Area	Category: 4
Provide an accessible path of travel	\$240
Notes: 1" change in levels from concrete rout be free of steps or changes in level).	e to the DG surface (an accessible route must
CBC: 11B-403	
Other: AGODA F245.4	
Increase or provide clear floor area	\$700
Notes: A 36" min clear space around the picn	nic table is not provided.
CBC: -	
Other: AGODA 1011.2.1	

Franco Park

32 - 4	Picnic Area	Category: 4	
Provide	an accessible path of travel		\$240
Notes	1" change in levels from concrete route to accessible route must be free of steps or c	•	
CBC	11B-403		
Other	AGODA F245.4		
Increase	or provide clear floor area		\$700
Notes	A 36" min clear space around the picnic ta	ble is not provided.	
CBC	-		
Other	AGODA 1011.2.1		
Provide	an accessible table		\$500
Notes	Knee clearance is 26.5" measured at 8" h tabletop (27" min).	norizontally from the front face of th	е
CBC	11B-306.3		
Other	-		
33 - 1	Outdoor Constructed Features	Category: 2	
Increase	or provide clear floor area		\$700
Notes	A clear floor space is not provided adjacer	nt to the bench (36" by 48" min).	
CBC	-		
Other	AGODA 1011.2.1		
33 - 2	Outdoor Constructed Features	Category: 3	
Provide	an accessible path of travel		\$240
Notes	An accessible route to the fixed trash/recy 1.5" change in level in the path to the cont steps or changes in level).	•	
CBC	-		
Other	AGODA 1011.2.1		
33 - 3	Outdoor Constructed Features	Category: 2	
Increase	or provide clear floor area		\$700
Notes	A clear floor space is not provided adjacer	nt to the bench (36" by 48" min).	
CBC	-		
Other	AGODA 1011.2.1		
33 - 4	Outdoor Constructed Features	Category: 2	
Increase	or provide clear floor area		\$700
Notes	A clear floor space is not provided adjacer	nt to the bench (36" by 48" min).	
~ ~ ~ ~		· · · · · · · · · · · · · · · · · · ·	
CBC	-		

Franco Park

33 - 5 Outdoor Constructed Features	Category: 4	
Increase or provide clear floor area		\$700
Notes: A clear floor space is not provided adjacent	to the bench (36" by 48" min).	
CBC: -		
Other: AGODA 1011.2.1		
33 - 6 Outdoor Constructed Features	Category: 4	
Increase or provide clear floor area		\$700
Notes: A clear floor space is not provided adjacent	to the bench (36" by 48" min).	
CBC: -		
Other: AGODA 1011.2.1		
33 - 7 Outdoor Constructed Features	Category: 2	
Increase or provide clear floor area		\$700
Notes: A clear floor space is not provided adjacent	to the bench (36" by 48" min).	
CBC: -		
Other: AGODA 1011.2.1		
33 - 8 Outdoor Constructed Features	Category: 4	
Increase or provide clear floor area		\$700
Notes: A clear floor space is not provided adjacent	to the bench (36" by 48" min).	
CBC: -		
Other: AGODA 1011.2.1		

Hoover Park Leeds Avenue and Donegal Avenue Cupertino, CA



Hoover Park

1 - 1 Parking Area Category:	1
Provide adequate striping	\$100
Notes: No striping provided at one accessible parking space and on half	of the access aisle
CBC: 11B-502.2	
Other: ADA 502.2	
Provide or modify accessible access aisles	\$210
Notes: Access aisle does not have a blue border.	
CBC: 11B-502.3.2, 11B-502.3.3	
Other: ADA 502.3.3	
Install reserved parking sign	\$375
Notes: Signs for designated parking are not provided at one parking spa	ice.
CBC: 11B-502.6, 11B-502.6.1, 11B-502.6.2	
Other: ADA 502.6	
Install van accessible sign	\$375
Notes: A "Van Accessible" sign is not provided. Required: A "Van Acces posted at stalls striped and designated to be van accessible.	sible" sign is
CBC: 11B-502.6	
Other: ADA 208.2.4	
Provide a pavement stencil	\$210
Notes: No ISA is provided at designated accessible space.	
CBC: 11B-502.6.4.1, 11B-502.6.4.2	
Other: ADA 502.6	
Regrade accessible parking space or access aisle	\$1,600
Notes: 7.8% slope at asphalt overlay in the parking space (2% max).	
CBC: 11B-502.4	
Other: ADA 502.4	
Provide an accessible path of travel	\$40
Notes: Accessible route from the parking area is not provided. Curb ram with the access aisle.	p is not aligned
CBC: 11B-502.7.1	
Other: ADA 502.3	

Hoover Park

1 - 2 Parking Area	Category: 1
Provide or modify accessible access aisles	\$210
Notes: No access aisle provided at a designated	-
CBC: 11B-502.3	1
Other: ADA 502.3	
Provide a pavement stencil	\$210
Notes: No ISA is provided at designated access	sible space.
CBC: 11B-502.6.4.1, 11B-502.6.4.2	
Other: ADA 502.6	
3 - 1 Curb Ramp	Category: 1
Provide detectable warnings	\$1,000
Notes: Truncated domes are 2.5" apart (2.35" n	nax).
CBC: 11B-406.5.12	
Other: ADA 705.1	
4 - 1 Walk	Category: 1
Regrade surface	\$480
Notes: Running slope of concrete path is up to '	14% for 12 linear feet (5.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 2 Walk	Category: 2
Regrade surface	\$1,720
Notes: Running slope of concrete path is up to s	5.8% for 43 linear feet (5.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
8 - 1 Door/Gate	Category: 1
Enlarge door opening	\$1,650
Notes: Width of clear opening of the gate is 23" side (32" min).	at one side of bollard and 24" on the other
CBC: 11B-404.2.3	
Other: ADA 404.2.3	

Hoover Park

10 - 1	Drinking Fountain Category:	3
Install a	n additional high or low fountain	\$3,000
Notes	A wheelchair accessible fountain is not provided.	
CBC	: 11B-211.2	
Other	: ADA 211.2	
Increase	e or provide maneuvering or clear floor area	\$1,000
Notes	Slope of clear space in front of the water fountain is 6.8% (2.0% r	nax).
CBC	: 11B-305, 11B-306, 11B-602.2	
Other	: ADA 305, ADA 305.3, ADA 305.5, ADA 306	
Provide	wing walls	\$1,000
Notes	Drinking fountain protrudes 21.25" from the vertical support at 31' more than 4" must be mounted below 27" or above 80").	AFF (protrusion
	: 11B-602.8, 11B-602.9	
Other	: ADA 307	
10 - 2	Drinking Fountain Category:	3
Replace	fountain	\$3,000
Notes	Bubbler height is 36.5" AFF. Fountain provided is neither standing accessible fountain. (Accessible fountain is to be located at 36" m	g person nor nax. above floor;
		g person nor nax. above floor;
CBC	accessible fountain. (Accessible fountain is to be located at 36" m standing fountain has an allowable range of 38" min to 43" max a	g person nor nax. above floor;
CBC: Other: Provide	accessible fountain. (Accessible fountain is to be located at 36" m standing fountain has an allowable range of 38" min to 43" max a 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 wing walls	g person nor hax. above floor; bove floor). \$1,000
CBC: Other: Provide	accessible fountain. (Accessible fountain is to be located at 36" m standing fountain has an allowable range of 38" min to 43" max a : 11B-602.4, 11B-602.7 : ADA 602.4, ADA 602.7	g person nor hax. above floor; bove floor). \$1,000
CBC: Other: Provide Notes:	accessible fountain. (Accessible fountain is to be located at 36" m standing fountain has an allowable range of 38" min to 43" max a : 11B-602.4, 11B-602.7 : ADA 602.4, ADA 602.7 wing walls : Drinking fountain protrudes 28" from vertical support at 31" AFF (g person nor hax. above floor; bove floor). \$1,000
CBC: Other: Provide Notes: CBC:	accessible fountain. (Accessible fountain is to be located at 36" m standing fountain has an allowable range of 38" min to 43" max a : 11B-602.4, 11B-602.7 : ADA 602.4, ADA 602.7 wing walls : Drinking fountain protrudes 28" from vertical support at 31" AFF (than 4" must be mounted below 27" or above 80").	g person nor hax. above floor; bove floor). \$1,000
CBC: Other: Provide Notes: CBC: Other:	accessible fountain. (Accessible fountain is to be located at 36" m standing fountain has an allowable range of 38" min to 43" max a : 11B-602.4, 11B-602.7 : ADA 602.4, ADA 602.7 wing walls : Drinking fountain protrudes 28" from vertical support at 31" AFF (than 4" must be mounted below 27" or above 80"). : 11B-602.8, 11B-602.9	g person nor hax. above floor; bove floor). \$1,000 protrusion more
CBC: Other: Provide Notes: CBC: Other: Increase	accessible fountain. (Accessible fountain is to be located at 36" m standing fountain has an allowable range of 38" min to 43" max a : 11B-602.4, 11B-602.7 : ADA 602.4, ADA 602.7 wing walls : Drinking fountain protrudes 28" from vertical support at 31" AFF (than 4" must be mounted below 27" or above 80"). : 11B-602.8, 11B-602.9 : ADA 307	g person nor hax. above floor; bove floor). \$1,000 protrusion more
CBC: Other: Provide Notes: CBC: Other: Increase	accessible fountain. (Accessible fountain is to be located at 36" m standing fountain has an allowable range of 38" min to 43" max a : 11B-602.4, 11B-602.7 : ADA 602.4, ADA 602.7 wing walls : Drinking fountain protrudes 28" from vertical support at 31" AFF (than 4" must be mounted below 27" or above 80"). : 11B-602.8, 11B-602.9 : ADA 307 e or provide maneuvering or clear floor area	g person nor hax. above floor; bove floor). \$1,000 protrusion more
CBC: Other: Provide Notes: CBC: Other: Increase Notes: CBC:	accessible fountain. (Accessible fountain is to be located at 36" m standing fountain has an allowable range of 38" min to 43" max a : 11B-602.4, 11B-602.7 : ADA 602.4, ADA 602.7 wing walls : Drinking fountain protrudes 28" from vertical support at 31" AFF (than 4" must be mounted below 27" or above 80"). : 11B-602.8, 11B-602.9 : ADA 307 e or provide maneuvering or clear floor area : Drinking fountain is not oriented for front or side approach.	g person nor hax. above floor; bove floor). \$1,000 protrusion more
CBC: Other: Provide Notes: CBC: Other: Increase Notes: CBC:	accessible fountain. (Accessible fountain is to be located at 36" m standing fountain has an allowable range of 38" min to 43" max a : 11B-602.4, 11B-602.7 : ADA 602.4, ADA 602.7 wing walls : Drinking fountain protrudes 28" from vertical support at 31" AFF (than 4" must be mounted below 27" or above 80"). : 11B-602.8, 11B-602.9 : ADA 307 e or provide maneuvering or clear floor area : Drinking fountain is not oriented for front or side approach. : 11B-305, 11B-306, 11B-602.2	g person nor hax. above floor; bove floor). \$1,000 protrusion more \$1,000
CBC: Other: Provide Notes: CBC: Other: Notes: CBC: Other: 35 - 1	accessible fountain. (Accessible fountain is to be located at 36" m standing fountain has an allowable range of 38" min to 43" max a : 11B-602.4, 11B-602.7 : ADA 602.4, ADA 602.7 wing walls : Drinking fountain protrudes 28" from vertical support at 31" AFF (than 4" must be mounted below 27" or above 80"). : 11B-602.8, 11B-602.9 : ADA 307 e or provide maneuvering or clear floor area : Drinking fountain is not oriented for front or side approach. : 11B-305, 11B-306, 11B-602.2 : ADA 305, ADA 305.3, ADA 305.5, ADA 306	g person nor hax. above floor; bove floor). \$1,000 protrusion more \$1,000
CBC: Other: Provide Notes: CBC: Other: Increase Notes: CBC: Other: 35 - 1 Repositi	accessible fountain. (Accessible fountain is to be located at 36" m standing fountain has an allowable range of 38" min to 43" max a : 11B-602.4, 11B-602.7 : ADA 602.4, ADA 602.7 wing walls : Drinking fountain protrudes 28" from vertical support at 31" AFF (than 4" must be mounted below 27" or above 80"). : 11B-602.8, 11B-602.9 : ADA 307 e or provide maneuvering or clear floor area : Drinking fountain is not oriented for front or side approach. : 11B-305, 11B-306, 11B-602.2 : ADA 305, ADA 305.3, ADA 305.5, ADA 306 Other Category: 5	g person nor hax. above floor; bove floor). \$1,000 protrusion more \$1,000 33 \$200
CBC: Other: Provide Notes: CBC: Other: Increase Notes: CBC: 35 - 1 Repositi Notes:	accessible fountain. (Accessible fountain is to be located at 36" m standing fountain has an allowable range of 38" min to 43" max a : 11B-602.4, 11B-602.7 : ADA 602.4, ADA 602.7 wing walls : Drinking fountain protrudes 28" from vertical support at 31" AFF (than 4" must be mounted below 27" or above 80"). : 11B-602.8, 11B-602.9 : ADA 307 e or provide maneuvering or clear floor area : Drinking fountain is not oriented for front or side approach. : 11B-305, 11B-306, 11B-602.2 : ADA 305, ADA 305.3, ADA 305.5, ADA 306 Other Category: 5 ion controls : Mutt Mitt is 40" off the path of travel at 48" AFF (46" max when be	g person nor hax. above floor; bove floor). \$1,000 protrusion more \$1,000 \$1,000


Hoover Park

35 - 2 O	Other	Category: 3
Nodify ope	erating mechanism	\$250
Notes: N	1utt Mitt is located 49" AFF (48" max)	
CBC: -		
Other: -		
43 - 1 P	lay Equipment Area	Category: 2
Regrade o	r replace ramp	\$2,460
Notes: R	amp to play area has a slope of 10.1	% (6.25% max).
CBC: 1	1B-1008.2.5.1	
Other: A	DA 1008.2.5.1	
43 - 2 P	lay Equipment Area	Category: 2
Regrade o	r replace ramp	\$2,460
	amp to the play area has a slope of a amp surface to play area surface (1/4	8.8% (6.25% max). 1" change in level from " change in level max).
CBC: 1	1B-1008.2.5.1	
Other: A	DA 1008.2.5.1	
nstall or n	nodify transfer system	\$15,000
Notes: A	transfer system is not provided for o	ne part of the play area.
CBC: 1	1B-1008.3	
	DA 1008.3	

Jollyman Park Dumas Drive and Jollyman Road Cupertino, CA



Jollyman Park Dumas Drive and Jollyman Road Cupertino, CA

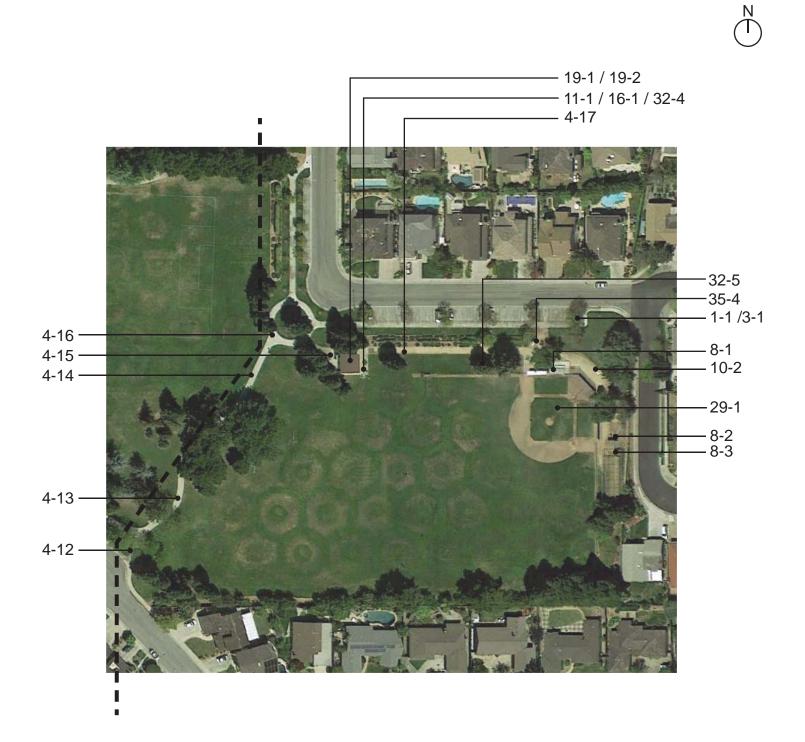

1 - 1	Parking Area	Category: 1
Provide	or modify accessible access ais	les \$210
Notes		not extend the entire length of the access aisle. e border. Access aisle width is 59" (60" min).
CBC	: 11B-502.2, 11B-502.3.1, 11B-502	2.3.2, 11B-502.3.3
Othe	r: ADA 502.3.1, ADA 502.3.2, ADA	502.3.3
Provide	e a pavement stencil	\$210
Notes	s: The ISA in the accessible parking	space is faded
CBC	: 11B-502.6.4.1, 11B-502.6.4.2	
Othe	r: ADA 502.6	
Provide	e adequate striping	\$100
Notes	: Accessible parking space is 17.5'	long (18' min).
CBC	: 11B-502.2	
Othe	r: ADA 502.2	
Regrad	e accessible parking space or ac	cess aisle \$1,600
Notes	s: Access aisle has a slope of 2.8%	and up to 7.6% at the last 18" (2% max).
CBC	: 11B-502.4	
Othe	r: ADA 502.4	

Cupertino ADA Jollyman Park

1 - 2 Parking Area	Category	:1
Install van accessible sign		\$375
	' sign is not provided. Required: A "Van Acce ped and designated to be van accessible.	ssible" sign is
CBC: 11B-502.6		
Other: ADA 208.2.4		
Install reserved parking sig	yn	\$375
Notes: No designated park	king sign is provided in one of two accessible	parking spaces.
CBC: 11B-502.6, 11B-50	2.6.1, 11B-502.6.2	
Other: ADA 502.6		
Provide adequate striping		\$100
Notes: Accessible parking	space is 16' long (18' min).	
CBC: 11B-502.2		
Other: ADA 502.2		
Provide or modify accessit	ole access aisles	\$210
Notes: Van access aisle w	<i>r</i> idth is 60" (96" min).	
CBC: 11B-502.2, 11B-50	2.3.1	
Other: ADA 502.3.1		
Provide an accessible path	n of travel	\$0
Notes: No path of travel fro is not aligned with a	om parking space without going behind parke access aisle.	ed cars. Curb ramp
CBC: 11B-502.7.1		
Other: ADA 502.3		
3 - 1 Curb Ramp	Category	r: 1
Provide a level landing		\$90
	at the bottom of parallel ramp has a slope of	2.4 % (2% max).
CBC: 11B-406.3.2		
Other: -		
3 - 2 Curb Ramp	Category	r: 1
Install, replace or modify c		\$2,460
	curb ramp is 2.6% (2.0% max).	
CBC: 11B-406	······································	
Other: ADA 405.3, ADA 4	06.1	
4 - 1 Walk	Category	r: 1
Regrade surface	· ·	\$1,440
	crete path is up to 3.4% for 36 linear feet (2.0	
CBC: 11B-403.3	······································	
Other: ADA 403.3		
12/19/2014	Jollyman Park	Page
		- 3-

4 - 2	Walk Category: 1	
Regrade	surface	\$4,240
Notes	Cross slope of concrete path is up to 2.8% for 106 linear feet (2.0% max).	
CBC	11B-403.3	
Other	ADA 403.3	
4 - 3	Walk Category: 1	
Regrade	surface	\$1,040
Notes	Cross slope of concrete path is up to 2.4% for 26 linear feet (2.0% max).	
CBC	11B-403.3	
Other	ADA 403.3	
4 - 4	Walk Category: 1	
Regrade	e surface	\$800
Notes	Cross slope of concrete path is up to 3.6% for 20 linear feet (2.0% max).	
CBC	11B-403.3	
Other	ADA 403.3	
4 - 5	Walk Category: 1	
Grind o	patch vertical change of grade	\$250
Notes	1/2" change in level at two concrete joints (1/4" max, up to 1/2" with a beve	el).
CBC	11B-303.2	
Other	ADA 303.2, ADA 303.3	
4 - 6	Walk Category: 1	
Regrade	e surface	\$1,560
Notes	Cross slope of concrete path is up to 3.6% for 39 linear feet (2.0% max).	
CBC	11B-403.3	
Other	ADA 403.3	
4 - 7	Walk Category: 1	
	surface	\$1,560
-	Cross slope of concrete path is up to 4.7% for 39 linear feet (2.0% max).	
	11B-403.3	
Other	ADA 403.3	
Remove	overhanging or protruding objects	\$125
	Oak tree branch overhangs over the walk at 63" high (80" min).	
	11B-307.4	
	ADA 307.4	

A 0		
4 - 8 Wall	5,	
legrade surfa		\$5,480
	s slope of concrete path is up to 3.9% for 137 linear feet (2.0% max).	
CBC: 11B-		
Other: ADA		
4 - 9 Wall	Category: 1	
Regrade surfa	ICE	\$2,000
Notes: Cros	s slope of concrete path is up to 2.8% for 50 linear feet (2.0% max).	
CBC: 11B-	403.3	
Other: ADA	403.3	
4 - 10 Wall	Category: 1	
Regrade surfa		\$880
Notes: Runr	ing slope of concrete path is up to 7.1% for 22 linear feet (5.0% max).	
CBC: 11B-	403.3	
Other: ADA	403.3	
4 - 11 Wall	Category: 1	
egrade surfa		\$1,080
Notes: Cros	s slope of concrete path is up to 3% for 27 linear feet (2.0% max).	
CBC: 11B-		
Other: ADA	403.3	
4 - 12 Wall	Category: 1	
Regrade surfa		\$560
	s slope of concrete path is up to 8% for 14 linear feet (2.0% max).	•
CBC: 11B-		
Other: ADA		
4 - 13 Walk		
Regrade surfa		\$760
-	s slope of concrete path is up to 2.7% for 19 linear feet (2.0% max).	
CBC: 11B-		
Other: ADA		
4 - 14 Wall		
Regrade surfa	5,	\$1,360
	s slope of concrete path is up to 2.4% for 34 linear feet (2.0% max).	ψ1,000
CBC: 11B-		
Other: ADA	400.0	

4 - 15 Wa	alk	Category: 1
Regrade su	Irface	\$2,160
Notes: Cr	oss slope of concrete path is up to 3.	3% for 54 linear feet (2.0% max).
CBC: 11	B-403.3	
Other: AD	DA 403.3	
4 - 16 Wa	alk	Category: 1
Regrade su	Irface	\$560
Notes: Cr	oss slope of concrete path is up to 5%	% for 14 linear feet (2.0% max).
CBC: 11	B-403.3	
Other: AD	DA 403.3	
4 - 17 Wa	alk	Category: 1
Grind or pa	tch vertical change of grade	\$250
	5" change in level at transition from co e of steps or changes in level).	oncrete to DG (an accessible route must be
CBC: 11	B-303.2	
Other: AD	DA 303.2, ADA 303.3	
6 - 1 St	airway	Category: 2
nstall tread	l striping	\$45
Notes: No	tread striping provided, 3 risers.	
CBC: 11	B-504.4.1	
Other: -		
Raise or lov	wer existing handrail	\$200
Notes: Ha	andrail top surface is mounted 32.75"	above the stair nosing (34" min to 38" max)
CBC: 11	B-505.4	
Other: AD	DA 505.4	
8 - 1 Do	oor/Gate	Category: 2
Provide or	modify door kickplate	\$225
Notes: A	smooth and uninterrupted kick plate s	surface is not provided.
CBC: 11	B-404.2.10	
Other: AD	DA 404.2.10	
Replace or	modify door threshold	\$125
Notes: Th	reshold has a vertical change of 1" (1	1/4" max, up to 1/2" with a bevel).
CBC: 11	B-404.2.5	
	DA 404.2.5	

8 - 2 Door/Gate	Category: 2
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick pla	te surface is not provided at batting cage.
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
8 - 3 Door/Gate	Category: 2
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick pla	te surface is not provided at batting cage.
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
10 - 1 Drinking Fountain	Category: 3
Increase or provide maneuvering or clear f	loor area \$1,000
	vater fountain is 5.9% (2.0% max). There is a ath of travel and the clear floor space (a clear nges in level).
CBC: 11B-305, 11B-306, 11B-602.2	
Other: ADA 305, ADA 305.3, ADA 305.5, A	NDA 306
Replace fountain	\$3,000
Notes: Bubbler height is 37" AFF. Fountain accessible fountain. (Accessible fou standing fountain has an allowable r	ntain is to be located at 36" max. above floor;
CBC: 11B-602.4, 11B-602.7	
Other: ADA 602.4, ADA 602.7	

10 - 2 Drinking Fountain	Category: 3
Install an additional high or low fountain	\$3,000
Notes: A wheelchair accessible fountain is not prov	
CBC: 11B-211.2	
Other: ADA 211.2	
Provide wing walls	\$1,000
Notes: Drinking fountain protrudes 32" from vertica than 4" must be mounted below 27" or above	
CBC: 11B-602.8, 11B-602.9	
Other: ADA 307	
Increase or provide maneuvering or clear floor are	ea \$1,000
Notes: There is a 1" change in level from concrete must be free of any changes in level). Drink approach.	
CBC: 11B-305, 11B-306, 11B-602.2	
Other: ADA 305, ADA 305.3, ADA 305.5, ADA 306	6
11 - 1 Telephone	Category: 3
Reposition phone equipment	\$500
Notes: Coin slot is 52" AFF (48" max).	
CBC: 11B-308.3	
Other: ADA 308.3, ADA 308.3.1, ADA 308.3.2	
16 - 1 Built-in Elements	Category: 2
Provide an accessible counter	\$1,500
Notes: Snack bar counter is 42" AFF (34" max for a	accessible counter).
CBC: 11B-904.4	
Other: ADA 904.4.1	

19 - 1 Multiple User Restroom	Category: 2
Install restroom sign	\$250
Notes: State sign is not provided in the women's lettering is centered 61.25" AFF, and Bra	•
CBC: 11B-216.8, 11B-703.7.2.6	
Other: ADA 703	
Provide or replace compartment door hardware	e \$175
Notes: Compartment door does not have an har closing (Compartment door must have U the door and be self-closing).	ndle on outside the door and is not self- I-shaped handles both inside and outside of
CBC: 11B-604.8.1.2	
Other: ADA 604.8.1.2	
Replace or reposition fixtures	\$1,250
Notes: The centerline of the water closet is 18.5	i" from side wall (18" max).
CBC: 11B-604.2	
Other: ADA 604.2	
Reposition toilet flush controls	\$750
Notes: Flush control is centered on the water clo	oset (flush control located on the wide side).
CBC: 11B-604.6	
Other: ADA 604.6	
Replace or modify grab bars	\$300
Notes: Rear grab bar extends 11" from the cent mounted with 12" to one side of centerlin	
CBC: 11B-604.5.2	
Other: ADA 604.5.2	
Replace or reposition dispenser	\$125
Notes: Centerline of one toilet paper dispenser i min to 9" max). Toilet seat cover dispens side grab bar (12" min).	is located 16" in front of the water closet (7" ser is 49.5" AFF (40" max) and 8" above the
CBC: 11B-603.5, 11B-604.7	
Other: ADA 604.7	

19 - 2	Multiple User Restroom	Category: 2
Install r	estroom sign	\$250
Notes	State sign is not provided in the men's r lettering is centered 61" AFF (60" max).	5
CBC	11B-216.8, 11B-703.7.2.6	
Other	ADA 703	
	or replace compartment door hardwa	
Notes		andle on outside the door and is not self- U-shaped handles both inside and outside o
CBC	11B-604.8.1.2	
Other	ADA 604.8.1.2	
Replace	or modify grab bars	\$300
Notes	Rear grab extends 10.5" from the center	rline of the water closet (12" min).
CBC	11B-604.5.2	
Other	ADA 604.5.2	
Replace	or reposition dispenser	\$125
Notes		I" in front of the water closet (7" min to 9" 5" AFF (40" max) and 7.5" above the side
CBC	11B-603.5, 11B-604.7	
Other	ADA 604.7	
29 - 1	Game and Sports Area	Category: 2
Provide	an accessible path of travel	\$240
Notes		not provided due to 1" change in surface ute must be free of any changes in level).
CBC	11B-206.2.12, 11B-206.2.2	
Other	ADA 206.2.2	
Provide	wheelchair seating	\$700
Notes		a 1" change is level from compacted surfac d. No companion seating is provided in the
CBC	11B-802.1.1	
	ADA 802.1.1	


32 - 1 Picnic Area	Category: 2
Provide an accessible table	\$500
Notes: Knee clearance at picnic table is 13 the ground).	3" deep and 26.75" AFF (19" deep at 27" above
CBC: 11B-306.3	
Other: -	
Increase or provide clear floor area	\$700
	picnic table is not provided. There is a 1" change acent to the picnic table (a clear floor space must
CBC: -	
Other: AGODA 1011.2.1	
32 - 2 Picnic Area	Category: 2
Provide an accessible table	\$500
Notes: Knee clearance is 25.75"measured tabletop (27" min).	d at 8" horizontally from the front face of the
CBC: 11B-306.3	
Other: -	
32 - 3 Picnic Area	Category: 2
Provide an accessible path of travel	\$2,000
Notes: An accessible route to the picnic ar	rea is not provided, 50 linear feet over grass.
CBC: 11B-403	
Other: AGODA F245.4	
Increase or provide clear floor area	\$700
Notes: A 36" min clear space around the p	picnic table is not provided.
CBC: -	
Other: AGODA 1011.2.1	
32 - 4 Picnic Area	Category: 2
Provide an accessible table	\$2,500
Notes: A wheelchair space is not provided	
CBC: -	······································
Other: AGODA 1011.4	

32 - 5 Picnic Area	Category: 2	
		400
Provide an accessible path of travel Notes: An accessible route to the picnic area is not	•	+00
change in level at curb.	provided, to inteal feet and a 1.5	
CBC: 11B-403		
Other: AGODA F245.4		
Increase or provide clear floor area	\$7	700
Notes: A 36" min clear space around the picnic table	e is not provided.	
CBC: -		
Other: AGODA 1011.2.1		
33 - 1 Outdoor Constructed Features	Category: 4	
Increase or provide clear floor area	\$7	700
Notes: A clear floor space is not provided adjacent t	to the bench (36" by 48" min).	
CBC: -		
Other: AGODA 1011.2.1		
35 - 1 Other	Category: 3	
Increase or provide maneuvering or clear floor are	a \$1,0	000
Notes: Clear floor space in front of the Mutt Mitt has	a 2"x1" hole (.5" max opening).	
CBC: 11B-305.5		
Other: ADA 305.3, ADA 305.5		
Reposition controls	\$2	200
Notes: Mutt Mitt opening is located 50" AFF (48" mi	n).	
CBC: 11B-308.3		
Other: ADA 308.3, ADA 308.3.1, ADA 308.3.2		
35 - 2 Other	Category: 3	
Reposition controls	\$2	200
Notes: Mutt Mitt opening is located 49.5" AFF (48" r	max).	
CBC: 11B-308.3		
Other: ADA 308.3, ADA 308.3.1, ADA 308.3.2		
35 - 3 Other	Category: 3	
Increase or provide maneuvering or clear floor are	a \$1,0	000
Notes: Clear floor space in front of the Mutt Mitt has	s a slope of 7% (2% max).	
CBC: 11B-305.5		
Other: ADA 305.3, ADA 305.5		

35 - 4 Other	Category: 3
Reposition controls	\$200
Notes: Mutt Mitt opening is located 49.5" AFF (48'	' max).
CBC: 11B-308.3	
Other: ADA 308.3, ADA 308.3.1, ADA 308.3.2	
Increase or provide maneuvering or clear floor a	rea \$1,000
Notes: Clear floor space in front of the Mutt Mitt ha in level in transition from concrete path to I clear floor space must be free of any chang	DG surface in front of the Mutt Mitt (a
CBC: 11B-305.5	
Other: ADA 305.3, ADA 305.5	
43 - 1 Play Equipment Area	Category: 2
Provide an accessible path of travel	\$400
Notes: Route around the play area leading to the level from concrete path to the play area (a changes in level).	
CBC: 11B-206.2.17	
Other: ADA 206.2.17	
Regrade or replace ramp	\$2,460
Notes: Ramp from walk to the play area has a slop	pe of 9.5% (6.25% max).
CBC: 11B-1008.2.5.1	
Other: ADA 1008.2.5.1	
43 - 2 Play Equipment Area	Category: 2
Provide an accessible path of travel	\$40
Notes: An accessible route to the play area is not and play area, 67 If (an accessible route m level).	•
CBC: 11B-206.2.17	
Other: ADA 206.2.17	

Library- Floor 1 10800 Torre Ave Cupertino, CA



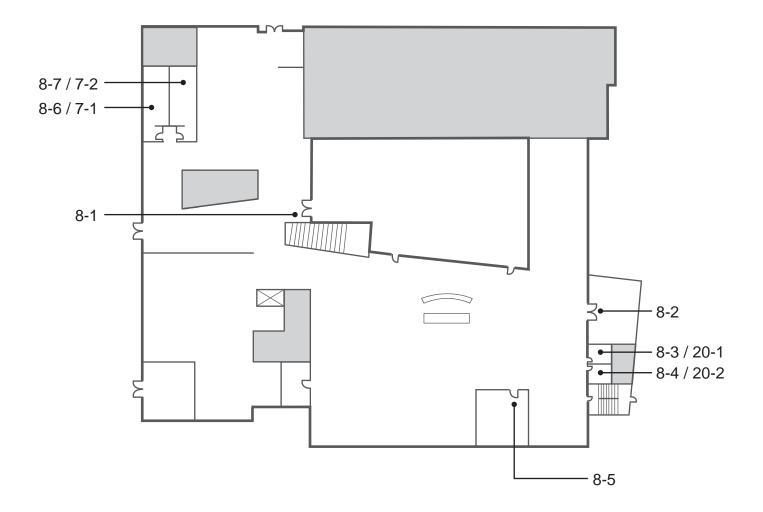

Library


Floor 1		
7 - 1 Hazard	Category: 4	
Remove overhanging o	r protruding objects	\$125
•	spenser protrudes 9" from the wall at 45" AFF in the wo usion more than 4" must be mounted below 27" or abo	
CBC: 11B-307.4		
Other: ADA 307.4		
7 - 2 Hazard	Category: 4	
Remove overhanging o	or protruding objects	\$125
•	spenser protrudes 10" from the wall at 44" AFF at men's re than 4" must be mounted below 27" or above 80").	s restroom
CBC: 11B-307.4		
Other: ADA 307.4		
8 - 1 Door/Gate	Category: 1	
Adjust door closer		\$125
Notes: Door opening for	orce is 16 lbs (5 lbs max).	
CBC: 11B-404.2.9		
Other: ADA 404.2.9		
8 - 2 Door/Gate	Category: 1	
Notes: No clear floor s centered on the CBC: 11B-703.4.2 Other: ADA 703.4.2	pace in front of the tactile and Braille sign in the story r e sign)	oom (18"x18"
8 - 3 Door/Gate	Category: 2	
Adjust door closer	Category. 2	\$125
	orce is 12 lbs (5 lbs max).	ψ120
CBC: 11B-404.2.9		
Other: ADA 404.2.9		
8 - 4 Door/Gate	Category: 2	
Adjust door closer		\$125
	orce is 11 lbs (5 lbs max).	¢.20
CBC: 11B-404.2.9		
Other: ADA 404.2.9		
8 - 5 Door/Gate	Category: 2	
Install or modify sign		\$250
	is is centered 68" AFF (48" min to 60" max).	<i>4</i> 2 00
CBC: 11B-703.4.1	,	
Other: ADA 703.4.1		
12/19/2014	Floor 1 First Floor	Page '

Library

8 - 6 Door/Gate Categ	nory: 2
djust door closer	<i>j</i> or <i>y</i> . <i>L</i>
•	\$125
Notes: Door opening force is 15 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
8 - 7 Door/Gate Categ	gory: 2
djust door closer	\$125
Notes: Door opening force is 12 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
20 - 1 Single User Restroom Category	jory: 2
rovide clear floor or turning space	\$3,000
Notes: The lavatory is 55" from the wall adjacent to the water closet	(60" min).
CBC: 11B-603.2.1	
Other: ADA 304.3.1, ADA 306.3, ADA 603.2.1	
emove overhanging or protruding objects	\$125
Notes: Paper towel dispenser protrudes 10" from the wall at 44" AFI may protrude no more than 4" where the lower edge is betwee CBC: 11B-307.2 Other: ADA 307.2	· ·
	jory: 2
rovide clear floor or turning space	\$3,000
Notes: The lavatory is 54" from the wall adjacent to the water closet	
CBC: 11B-603.2.1	
Other: ADA 304.3.1, ADA 306.3, ADA 603.2.1	
emove overhanging or protruding objects	\$125
Notes: Paper towel dispenser protrudes 10" from the wall at 44" AFI may protrude no more than 4" where the lower edge is betwee CBC: 11B-307.2	
Other: ADA 307.2	
Iodify lavatory or counter clearances	\$1,500
Notes: Knee space at the lavatory apron is 28.5" AFF (29" min).	. ,
CBC: 11B-306.3.1	
Other: -	

Library- Floor 2 10800 Torre Ave Cupertino, CA



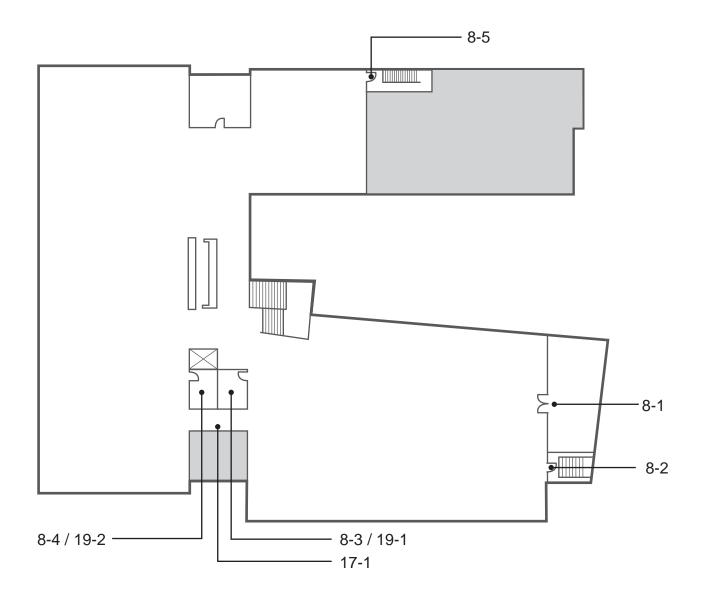

Library


Floor 2		
8 - 1 Door/Gate	Category: 2	
Adjust door closer	\$125	
Notes: Door opening force is 9 lbs (5 lbs max)).	
CBC: 11B-404.2.9		
Other: ADA 404.2.9		
8 - 2 Door/Gate	Category: 1	
Install or modify sign	\$250	
Notes: The tactile lettering on the Exit Stair Do 60" max).	own sign is located 61" AFF (48" AFF min to	
CBC: 11B-703.4.1		
Other: ADA 703.4.1		
8 - 3 Door/Gate	Category: 2	
Adjust door closer	\$125	
Notes: Door opening force is 10.5 lbs (5 lbs m	iax).	
CBC: 11B-404.2.9		
Other: ADA 404.2.9		
8 - 4 Door/Gate	Category: 2	
Adjust door closer	\$125	
Notes: Door opening force is 10 lbs (5 lbs ma	x).	
CBC: 11B-404.2.9		
Other: ADA 404.2.9		
8 - 5 Door/Gate	Category: 1	
Install or modify sign	\$250	
Notes: The tactile lettering on the Exit Stair Do 60" max).	own sign is located 61" AFF (48" AFF min to	
CBC: 11B-703.4.1		
Other: ADA 703.4.1		
17 - 1 Corridor / Aisle	Category: 2	
Widen corridor	\$0	
Notes: Corridor is 38.5" wide due to magazine	e rack (44" min).	
CBC: 11B-403.5.1		
Other: ADA 403.5.1		

Library

Floor 2	
19 - 1 Multiple User Restroom	Category: 2
Replace or reposition dispenser	\$125
Notes: Height of soap dispenser is 42" AFF (40)" max).
CBC: 11B-603.5	
Other: -	
Replace or reposition fixtures	\$1,250
Notes: Centerline of the water closet is 18.75"	from side wall (17" min to 18" max).
CBC: 11B-604.2	
Other: ADA 604.2	
19 - 2 Multiple User Restroom	Category: 2
Replace or reposition fixtures	\$1,250
Notes: Centerline of the water closet is 18.5" from	om side wall (17" min to 18" max).
CBC: 11B-604.2	
Other: ADA 604.2	


Linda Vista Park Linda Vista Drive Cupertino, CA



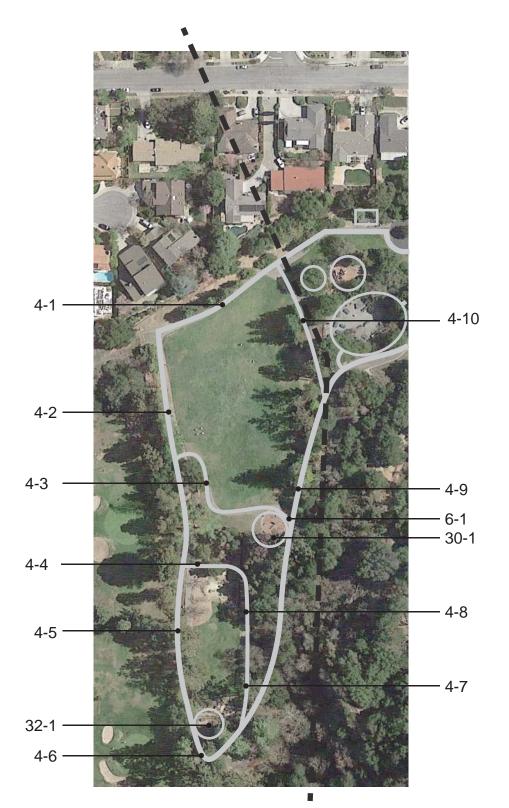

Linda Vista Park Linda Vista Drive Cupertino, CA



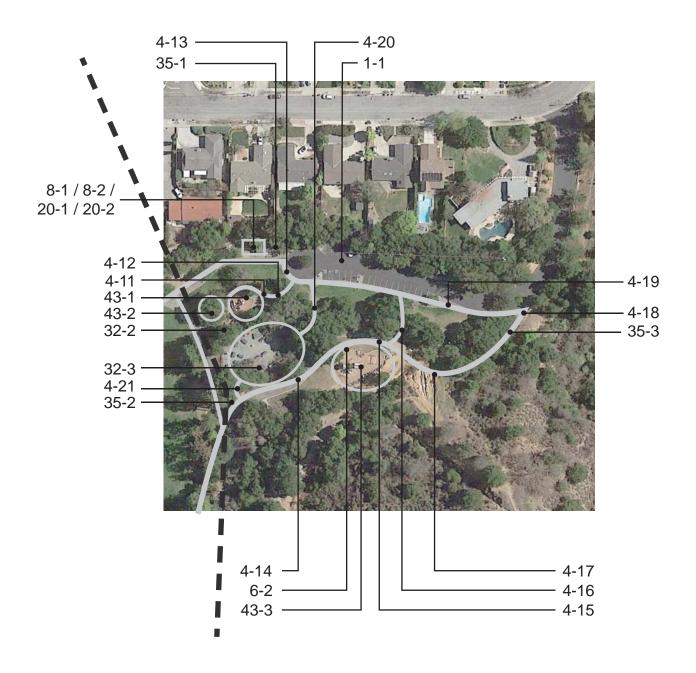

Linda Vista Park

1 - 1	Parking Area	Category: 1
Install re	eserved parking sign	\$375
Notes	Notes: Required signage is not provided. A reflectorized sign that is 70 sq. inches min. designates each space reserved for people with disabilities and will not be obscu by parked vehicles. Sign includes a white ISA on a dark blue background. An additional sign or additional language at each designated space states "Minimun Fine \$250".	
	11B-502.6, 11B-502.6.1, 11B-502.6.2, 1	IB-502.8
	ADA 502.6	
	an accessible sign	\$375
Notes	A "Van Accessible" sign is not provided. posted at stalls striped and designated to	
CBC	11B-502.6	
Other	ADA 208.2.4	
	or modify accessible access aisles	\$210
Notes	Access aisle width is 100" (108" min).	
	11B-502.2, 11B-502.3.1	
Other	ADA 502.3.1	
	accessible parking space or access a	
	Slope in parking spaces and access aisle	es is up to 7.2% (2.0% max).
	11B-502.4	
Other	ADA 502.4	
	an accessible path of travel	\$0
CBC	11B-502.7.1	the park without going behind parked cars.
	ADA 502.3	
4 - 1	Walk	Category: 4
	surface	\$7,920
Notes:	Running slope of asphalt path is up to 7.9 (Maintenance access road).	9% for 396 linear feet (5.0% max).
CBC	11B-403.3	
Other	ADA 403.3	
4 - 2	Walk	Category: 4
Regrade	surface	\$740
Notes	Running slope of asphalt path is up to 6.0 (Maintenance access road).	6% for 37 linear feet (5.0% max).
CBC:	11B-403.3	
Othor	ADA 403.3	

Linda Vista Park

Category: 2	
\$4,840	
unning slope of asphalt path is up to 11% (5.0% max) and cross slope is up to 8% 2.0% max) for 242 linear feet. Where road cross drainage channel running slope is p to 27% (5.0% max).	
Category: 2	
hange of grade \$250	
el from wood planks to natural surface on one side of the bridge, in level on the other side leading to asphalt road (1/4" max, up to).	
303.3	
\$500	
ooden bridge is up to 7% for 17 linear feet (2.0% max).	
Category: 4	
\$5,600	
f asphalt path is up to 10% for 280 linear feet (5.0% max).	
Category: 4	
\$3,500	
f asphalt path is between 10% and 24.8% for 175 linear feet (5.0% lk crosses drainage channel running slope is up to 28.1% for 10	
2. 6 1) A	

4 - 7	Walk	Category: 2
Regrade	surface	\$200
Notes:	Running slope of stone bridge is up to	16% for 10 linear feet (5.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
Grind or	patch vertical change of grade	\$250
Notes:	Up to 2" changes in level along the stor	ne bridge (1/4" max, up to 1/2" with a bevel).
CBC:	11B-303.2	
Other:	ADA 303.2, ADA 303.3	
4 - 8	Walk	Category: 2
Widen w	alk	\$500
Notes:	Width of walk across wood bridge is 42	25" (48" min).
CBC:	11B-403.5.1.3	
Other:	ADA 403.5.1	
4 - 9	Walk	Category: 4
Regrade	surface	\$12,040
Notes:	Running slope of asphalt path is up to 7 (2.0% max) for 602 linear feet.	10% (5.0% max) and cross slope is up to 4%
CBC:	11B-403.3	
Other:	ADA 403.3	
Grind or	patch vertical change of grade	\$250
Notes:	4" speed bump in the path of travel (1/ (Maintenance road).	4" max, up to 1/2" with a bevel).
CBC:	11B-303.2	
Other:	ADA 303.2, ADA 303.3	
4 - 10	Walk	Category: 4
Regrade	surface	\$3,580
Notes:	Running slope of asphalt path is up to 7 4.5% (2.0% max) for 179 linear feet.	16.9% (5.0% max) and cross slope is up to
CBC:	11B-403.3	
Other:	ADA 403.3	

4 - 11	Walk	Category: 2
Regrade	e surface	\$860
Notes	Cross slope of asphalt path is	s up to 8.3% for 43 linear feet (2.0% max).
CBC	11B-403.3	
Other	ADA 403.3	
Remove	overhanging or protruding o	objects \$125
Notes	Redwood tree branches over	hang walk at 70" AFF (80" min).
CBC	11B-307.4	
Other	ADA 307.4	
Grind o	• patch vertical change of gra	ade \$250
Notes	1" change in level at concrete with a bevel).	edging. Deteriorating asphalt (1/4" max, up to 1/2"
CBC	11B-303.2	
Other	ADA 303.2, ADA 303.3	
4 - 12	Walk	Category: 2
Regrade	e surface	\$1,420
Notes	Running slope of asphalt path 7.9% (2.0% max) for 71 linea	n is up to 11.5% (5.0% max) and cross slope is up to r feet.
CBC	11B-403.3	
Other	ADA 403.3	
4 - 13	Walk	Category: 1
Regrade	e surface	\$820
Notes	Running slope of asphalt path 5.8% (2.0% max) for 41 linea	n is up to 7.8% (5.0% max) and cross slope is up to r feet.
CBC	11B-403.3	
Other	ADA 403.3	
4 - 14	Walk	Category: 4
Regrade	e surface	\$2,540
Notes	Running slope of asphalt path 4.6% (2.0% max) for 127 line	n is up to 14.4% (5.0% max) and cross slope is up to ar feet.
CBC	11B-403.3	
Other	ADA 403.3	
4 - 15	Walk	Category: 4
Regrade	e surface	\$1,160
Notes	Running slope of asphalt path 4.2% (2.0% max) for 58 linea	n is up to 6.2% (5.0% max) and cross slope is up to r feet.
CBC	11B-403.3	
Othor	ADA 403.3	

4 - 16	Walk	Category: 2
Regrade	surface	\$1,340
Notes:	Running slope of asphalt path is up t	o 29.7% for 67 linear feet (5.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 17	Walk	Category: 4
Regrade	surface	\$1,920
Notes:	Running slope of asphalt path is up t 4.4% (2.0% max) for 96 linear feet.	o 5.5% (5.0% max) and cross slope is up to
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 18	Walk	Category: 4
Regrade	surface	\$2,100
Notes:	Running slope of asphalt path is up t (2.0% max) for 105 linear feet.	o 6.9% (5.0% max) and cross slope is up to 49
CBC:	11B-403.3	
Other:	ADA 403.3	
Detectab	le warnings	\$1,000
Notes:	No detectable warnings are provided	where a walk adjoins vehicular area.
CBC:	11B-705.1.2	
Other:	<u>-</u>	
4 - 19	Walk	Category: 1
Regrade	surface	\$4,600
Notes:	Running slope of asphalt path is up t 7.6% (2.0% max) for 230 linear feet.	o 10.4% (5.0% max) and cross slope is up to
CBC:	11B-403.3	
Other:	ADA 403.3	
Grind or	patch vertical change of grade	\$250
Notes:	0	on of path of travel. Two cracked sections of ravel that are 2" high, 6" wide and 1" deep. ax, up to 1/2" with a bevel).
CBC:	11B-303.2	
Other [.]	ADA 303.2, ADA 303.3	

4 - 20 Walk	Category: 2
Regrade surface	\$1,220
Notes: Running slope of asphalt path is u 7.4% (2.0% max) for 61 linear feet	p to 11.4% (5.0% max) and cross slope is up to up to picnic area.
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 21 Walk	Category: 2
Regrade surface	\$680
Notes: Running slope of asphalt path is u (2.0% max) for 34 linear feet.	p to 14% (5.0% max) and cross slope is up to 3%
CBC: 11B-403.3	
Other: ADA 403.3	
6 - 1 Stairway	Category: 2
Install tread striping	\$165
Notes: No tread striping provided for 11 ri	sers.
CBC: 11B-504.4.1	
Other: -	¢125
Other: - Install a handrail	\$125 d at the bottom of the handrail (one tread-width
Other: - Install a handrail Notes: A parallel extension is not provided	
Other: - Install a handrail Notes: A parallel extension is not provided min).	
Other: - Install a handrail Notes: A parallel extension is not provided min). CBC: 11B-505.10.3	
Other: - Install a handrail Notes: A parallel extension is not provided min). CBC: 11B-505.10.3 Other: ADA 505.10.3	d at the bottom of the handrail (one tread-width
Other: - Install a handrail Notes: A parallel extension is not provided min). CBC: 11B-505.10.3 Other: ADA 505.10.3 6 - 2 Stairway Install a handrail	d at the bottom of the handrail (one tread-width Category: 2
Other: - Install a handrail Notes: A parallel extension is not provided min). CBC: 11B-505.10.3 Other: ADA 505.10.3 6 - 2 Stairway Install a handrail Notes: Handrails are not provided on either	d at the bottom of the handrail (one tread-width Category: 2 \$2,500
Other: - Install a handrail Notes: A parallel extension is not provided min). CBC: 11B-505.10.3 Other: ADA 505.10.3 6 - 2 Stairway Install a handrail Notes: Handrails are not provided on either both sides req).	d at the bottom of the handrail (one tread-width Category: 2 \$2,500
Other: - Install a handrail Notes: A parallel extension is not provided min). CBC: 11B-505.10.3 Other: ADA 505.10.3 6 - 2 Stairway Install a handrail Notes: Handrails are not provided on either both sides req). CBC: 11B-505.2	d at the bottom of the handrail (one tread-width Category: 2 \$2,500
Other: - Install a handrail Notes: A parallel extension is not provided min). CBC: 11B-505.10.3 Other: ADA 505.10.3 6 - 2 Stairway Install a handrail Notes: Handrails are not provided on eithe both sides req). CBC: 11B-505.2 Other: ADA 505.2	d at the bottom of the handrail (one tread-width Category: 2 \$2,500 er side of the stairway for 9 risers (handrails on \$135
Other: - Install a handrail Notes: A parallel extension is not provided min). CBC: 11B-505.10.3 Other: ADA 505.10.3 6 - 2 Stairway Install a handrail Notes: Handrails are not provided on eithe both sides req). CBC: 11B-505.2 Other: ADA 505.2 Install tread striping	d at the bottom of the handrail (one tread-width Category: 2 \$2,500 er side of the stairway for 9 risers (handrails on \$135
Other: - Install a handrail Notes: A parallel extension is not provided min). CBC: 11B-505.10.3 Other: ADA 505.10.3 6 - 2 Stairway Install a handrail Notes: Handrails are not provided on eithe both sides req). CBC: 11B-505.2 Other: ADA 505.2 Install tread striping Notes: Striping made of wood railroad ties	d at the bottom of the handrail (one tread-width Category: 2 \$2,500 er side of the stairway for 9 risers (handrails on \$135
Other: - Install a handrail Notes: A parallel extension is not provided min). CBC: 11B-505.10.3 Other: ADA 505.10.3 6 - 2 Stairway Install a handrail Notes: Handrails are not provided on eithe both sides req). CBC: 11B-505.2 Other: ADA 505.2 Install tread striping Notes: Striping made of wood railroad ties CBC: 11B-504.4.1 Other: - Replace stairs	d at the bottom of the handrail (one tread-width Category: 2 \$2,500 er side of the stairway for 9 risers (handrails on \$135 s does not contrast the concrete surface. \$2,700
Other: - Install a handrail Notes: A parallel extension is not provided min). CBC: 11B-505.10.3 Other: ADA 505.10.3 6 - 2 Stairway Install a handrail Notes: Handrails are not provided on eithe both sides req). CBC: 11B-505.2 Other: ADA 505.2 Install tread striping Notes: Striping made of wood railroad ties CBC: 11B-504.4.1 Other: - Replace stairs Notes: Slopes of treads are up to 6.3% (2)	d at the bottom of the handrail (one tread-width Category: 2 \$2,500 er side of the stairway for 9 risers (handrails on \$135 s does not contrast the concrete surface. \$2,700
Other: - Install a handrail Notes: A parallel extension is not provided min). CBC: 11B-505.10.3 Other: ADA 505.10.3 6 - 2 Stairway Install a handrail Notes: Handrails are not provided on eithe both sides req). CBC: 11B-505.2 Other: ADA 505.2 Install tread striping Notes: Striping made of wood railroad ties CBC: 11B-504.4.1 Other: - Replace stairs	d at the bottom of the handrail (one tread-width Category: 2 \$2,500 er side of the stairway for 9 risers (handrails on \$135 s does not contrast the concrete surface. \$2,700

8 - 1	Door/Gate	Category: 2
Increase	e maneuvering space	\$1,000
Notes:	Latch-side approach maneuvering (42" min).	g clearance on the push side of the door is 40.5"
CBC:	11B-404.2.4.1	
Other:	ADA 404.2.4.1	
Replace	or modify door threshold	\$125
Notes:	Threshold has a vertical change o	f 1/2" (1/4" max, up to 1/2" with a bevel).
CBC:	11B-404.2.5	
Other:	ADA 404.2.5	
8 - 2	Door/Gate	Category: 2
ncrease	e maneuvering space	\$1,000
Notes:	Latch-side approach maneuvering (42" min).	g clearance on the push side of the door is 40.5"
CBC:	11B-404.2.4.1	
Other:	ADA 404.2.4.1	
Replace	or modify door threshold	\$125
Notes:	Threshold has a vertical change o	f 1/2" (1/4" max, up to 1/2" with a bevel).
CBC:	11B-404.2.5	
	ADA 404.2.5	

20 - 1 Single User Restroom	Category: 2
Install restroom sign	\$250
Notes: Federal required sign is not provided.	
CBC: -	
Other: ADA 703	
Provide clear floor or turning space	\$3,000
Notes: A 60" min diameter turning space unobstruis not provided. Water closet is located in this 11% (2% max).	0
CBC: 11B-603.2.1	
Other: ADA 304.3.1, ADA 306.3, ADA 603.2.1	
Replace or reposition fixtures	\$1,250
Notes: Centerline of the water closet is 26.5" from	n side wall (17"min to 18" max).
CBC: 11B-604.2	
Other: ADA 604.2	
Replace toilet or adjust toilet seat height	\$3,000
Notes: Water closet seat height is 14.5" AFF (17"	min to 19" max).
CBC: 11B-604.4	
Other: ADA 604.4	
Replace or modify grab bars	\$300
Notes: Rear grab bar is not provided. Side grab b 36.75" from the rear wall (54" min).	ar is 25" long (42" min) and extends
CBC: 11B-604.5.1, 11B-604.5.2	
Other: ADA 604.5.1, ADA 604.5.2	
Replace or reposition dispenser	\$125
Notes: Height of toilet seat cover dispenser is 59"	' AFF (40" max).
CBC: 11B-603.5	
Other: -	
Provide an accessible lavatory	\$3,000
Notes: Provide an accessible lavatory.	
CBC: 11B-606.2	
Other: ADA 606.2	

Linda Vista Park

20 - 2 Single User Restroom	Category: 2
Install restroom sign	\$250
Notes: Federal required sign is not provided.	
CBC: -	
Other: ADA 703	
Replace or reposition fixtures	\$1,250
Notes: Centerline of the water closet is 27" from	n side wall (17" min to 18" max).
CBC: 11B-604.2	
Other: ADA 604.2	
Replace toilet or adjust toilet seat height	\$3,000
Notes: Water closet seat height is 14.5" AFF (1	7" min to 19" max).
CBC: 11B-604.4	
Other: ADA 604.4	
Replace or modify grab bars	\$300
Notes: Rear grab bar is not provided. Side grab 36.75"from the rear wall (54" min).	bar is 25" long (42" min) and extends
CBC: 11B-604.5.1, 11B-604.5.2	
Other: ADA 604.5.1, ADA 604.5.2	
Replace or reposition dispenser	\$125
Notes: Toilet seat cover dispenser is 60" AFF (4	10" max).
CBC: 11B-603.5	
Other: -	
Replace urinal	\$3,000
Notes: Urinal rim is 24.5" AFF (17" max) and ex	tends 12.5" from rear wall (13.5" min).
CBC: 11B-605.2	
Other: ADA 605.2	
Replace or adjust water controls	\$500
Notes: Flush control on the urinal is located 45.	5" AFF (40" max).
CBC: 11B-606.4	
Other: ADA 309.4, ADA 606.4	
Provide an accessible lavatory	\$0
Notes: Provide an accessible lavatory (shared v	vith 20-1).
CBC: 11B-606.2	
Other: ADA 606.2	

20 - 2	Single User Restroom	Category: 2
Provide	clear floor or turning space	\$3,000
Notes:	•	tructed from the floor to a height of 27" min n turning space. Slope of clear floor space
CBC:	11B-603.2.1	
Other:	ADA 304.3.1, ADA 306.3, ADA 603.2.1	
30 - 1	Exercise Machines and Equipment	Category: 2
Provide	an accessible path of travel	\$125
Notes:	No accessible path of travel provided to to 1/2" with a bevel).	workout area due to 5" curb (1/4" max, up
CBC:	11B-206.2	
Other:	ADA 206.2, ADA 206.2.2	
32 - 1	Picnic Area	Category: 2
Provide	an accessible picnic unit	\$6,400
Notes:	An accessible table is not provided in a	picnic area with 6 tables. (2 required).
CBC:	11B-246.5	
Other:	-	
Provide	an accessible path of travel	\$400
Notes:	Route to picnic tables is 10 linear feet ov surface is not firm and stable.	ver compacted natural surface. Natural
CBC:	11B-403	
Other:	AGODA F245.4	
Provide	an accessible table	\$0
Notes:	Picnic table is 36" AFF (28" min to 34" m deep and 21.25" AFF.	hax). There are two supports that are 6"
CBC:	11B-902.3	
Other:	AGODA 1011.4.1	
Replace	or reposition picnic grill	\$750
Notes:	Clear floor space of the grill has a slope	of 7.3% (2% max).
CBC:	-	
Other:	AGODA 1011.5.2	


32 - 2 Picnic Area	Category: 2
Provide an accessible path of travel	\$240
Notes: 1" change in level from pavement to natur bevel). Natural surface is not firm and state	
CBC: 11B-403	
Other: AGODA F245.4	
Provide an accessible picnic unit	\$3,200
Notes: An accessible table is not provided in a pie	cnic area with 2X tables. (2 required).
CBC: 11B-246.5	
Other: -	
32 - 3 Picnic Area	Category: 2
Provide an accessible picnic unit	\$6,400
Notes: An accessible table is not provided in a pie	cnic area with 17 tables. (2 required).
CBC: 11B-246.5	
Other: -	
Provide an accessible path of travel	\$0
Notacy An accessible route to the pienie erec is n	at provided. Diapia area is an a graval
Notes: An accessible route to the picnic area is n surface that is not firm and stabile.	ot provided. Pichic area is on a graver
surface that is not firm and stabile. CBC: 11B-403	ot provided. Pichic area is on a graver
surface that is not firm and stabile.	ot provided. Pichic area is on a graver
surface that is not firm and stabile. CBC: 11B-403 Other: AGODA F245.4 Replace or reposition picnic grill	\$750
surface that is not firm and stabile. CBC: 11B-403 Other: AGODA F245.4	34" max). Cooking surface is 13.25" from
surface that is not firm and stabile. CBC: 11B-403 Other: AGODA F245.4 Replace or reposition picnic grill Notes: Grill operating mechanism is 34.75" AFF (the front ledge. Knee space is not provide	34" max). Cooking surface is 13.25" from
surface that is not firm and stabile. CBC: 11B-403 Other: AGODA F245.4 Replace or reposition picnic grill Notes: Grill operating mechanism is 34.75" AFF (the front ledge. Knee space is not provide (34" max).	\$750 (34" max). Cooking surface is 13.25" from
surface that is not firm and stabile. CBC: 11B-403 Other: AGODA F245.4 Replace or reposition picnic grill Notes: Grill operating mechanism is 34.75" AFF (the front ledge. Knee space is not provide (34" max). CBC: -	\$750 (34" max). Cooking surface is 13.25" from
surface that is not firm and stabile. CBC: 11B-403 Other: AGODA F245.4 Replace or reposition picnic grill Notes: Grill operating mechanism is 34.75" AFF (the front ledge. Knee space is not provide (34" max). CBC: - Other: AGODA 1011.5.2	\$750 (34" max). Cooking surface is 13.25" from d at the grill. Prep counter is 34.25" AFF Category: 3
surface that is not firm and stabile. CBC: 11B-403 Other: AGODA F245.4 Replace or reposition picnic grill Notes: Grill operating mechanism is 34.75" AFF (the front ledge. Knee space is not provide (34" max). CBC: - Other: AGODA 1011.5.2 35 - 1 Other	\$750 (34" max). Cooking surface is 13.25" from d at the grill. Prep counter is 34.25" AFF Category: 3 \$200
surface that is not firm and stabile. CBC: 11B-403 Other: AGODA F245.4 Replace or reposition picnic grill Notes: Grill operating mechanism is 34.75" AFF (the front ledge. Knee space is not provide (34" max). CBC: - Other: AGODA 1011.5.2 35 - 1 Other Reposition controls Notes: Mutt Mitt is located 28" off the path of trav	\$750 (34" max). Cooking surface is 13.25" from of at the grill. Prep counter is 34.25" AFF Category: 3 \$200 rel (24" max reach depth for a height of 46
surface that is not firm and stabile. CBC: 11B-403 Other: AGODA F245.4 Replace or reposition picnic grill Notes: Grill operating mechanism is 34.75" AFF (the front ledge. Knee space is not provide (34" max). CBC: - Other: AGODA 1011.5.2 35 - 1 Other Reposition controls Notes: Mutt Mitt is located 28" off the path of trav max) at 50" above the ground (48" max).	\$750 (34" max). Cooking surface is 13.25" from of at the grill. Prep counter is 34.25" AFF Category: 3 \$200 rel (24" max reach depth for a height of 46
surface that is not firm and stabile. CBC: 11B-403 Other: AGODA F245.4 Replace or reposition picnic grill Notes: Grill operating mechanism is 34.75" AFF (the front ledge. Knee space is not provide (34" max). CBC: - Other: AGODA 1011.5.2 35 - 1 Other Reposition controls Notes: Mutt Mitt is located 28" off the path of trav max) at 50" above the ground (48" max). CBC: 11B-308.3	\$750 (34" max). Cooking surface is 13.25" from d at the grill. Prep counter is 34.25" AFF <u>Category: 3</u> \$200 rel (24" max reach depth for a height of 46
surface that is not firm and stabile. CBC: 11B-403 Other: AGODA F245.4 Replace or reposition picnic grill Notes: Grill operating mechanism is 34.75" AFF (the front ledge. Knee space is not provide (34" max). CBC: - Other: AGODA 1011.5.2 35 - 1 Other Reposition controls Notes: Mutt Mitt is located 28" off the path of trav max) at 50" above the ground (48" max). CBC: 11B-308.3 Other: ADA 308.3, ADA 308.3.1, ADA 308.3.2	\$750 (34" max). Cooking surface is 13.25" from d at the grill. Prep counter is 34.25" AFF Category: 3 \$200 rel (24" max reach depth for a height of 46 area \$1,000
surface that is not firm and stabile. CBC: 11B-403 Other: AGODA F245.4 Replace or reposition picnic grill Notes: Grill operating mechanism is 34.75" AFF (the front ledge. Knee space is not provide (34" max). CBC: - Other: AGODA 1011.5.2 35 - 1 Other Reposition controls Notes: Mutt Mitt is located 28" off the path of trav max) at 50" above the ground (48" max). CBC: 11B-308.3 Other: ADA 308.3, ADA 308.3.1, ADA 308.3.2 Increase or provide maneuvering or clear floor a Notes: A clear floor space is not provided at the M	\$750 (34" max). Cooking surface is 13.25" from d at the grill. Prep counter is 34.25" AFF Category: 3 \$200 rel (24" max reach depth for a height of 46 area \$1,000

35 - 2	Other	Category: 3
	on controls	\$200
Notes	Mutt Mitt dispenser is located 54" off the path max; or 24" max reach depth for a height of 4	-
CBC	11B-308.3	
Other	ADA 308.3, ADA 308.3.1, ADA 308.3.2	
Increase	e or provide maneuvering or clear floor are	a \$1,000
Notes	A clear floor space is not provided at the Mut approach).	tt Mitt (36" by 48" min forward
CBC	11B-305.5	
Other	ADA 305.3, ADA 305.5	
35 - 3	Other	Category: 3
Reposit	on controls	\$200
Notes	Mutt Mitt dispenser is located 14" off the path max).	n of travel at 52" above the ground (48"
CBC	11B-308.3	
Other	ADA 308.3, ADA 308.3.1, ADA 308.3.2	
Increase	e or provide maneuvering or clear floor are	a \$1,000
Notes	Clear floor space of the Mutt Mitt has a slope	e of 9.5% (2% max).
CBC	11B-305.5	
A 1	ADA 305.3, ADA 305.5	

43 - 1	Play Equipment Area	Category: 2
	an accessible path of travel	\$125
Notes:	There is a 1" change in level from the path of travel 4" change in level from curb to play surface (1/4" m (maintenance).	
CBC:	11B-206.2.17	
Other:	ADA 206.2.17	
Regrade	or replace ramp	\$2,460
Notes:	Ramp to play area has a slope of 11% (6.25" max).	
CBC:	11B-1008.2.5.1	
Other:	ADA 1008.2.5.1	
Install or	r modify transfer system	\$15,000
Notes:	Transfer platform surface height is 19.25" (11" min surfacing.	to 18" max) above the accessible
CBC:	11B-1008.3.1.2	
Other:	ADA 1008.3.1.2	
Improve	play area surface	\$0
Notes:	Ground surface of the play area is wood chips. Furt surface is recommended.	her evaluation of fall attenuation
CBC:	11B-1008.2.6.1	
Other:	ADA 1008.2.6.1, ADA 1008.2.6.2	
43 - 2	Play Equipment Area	Category: 2
Improve	play area surface	\$O
Notes:	Ground surface of the play area is wood chips. Furt surface is recommended.	her evaluation of fall attenuation
CBC:	11B-1008.2.6.1	
Other:	ADA 1008.2.6.1, ADA 1008.2.6.2	
Provide	an accessible path of travel	\$0
Notes:	Ramp to swing area is 38.5" wide (44" min for play for play areas greater than 1,000 sf, route can be re	
CBC:	11B-1008.2.4.1	
Other:	ADA 1008.2.4.1	

43 - 3 Play Equipment Area	Category: 2
Provide an accessible path of travel	\$720
Notes: An accessible route to the play equipment a linear feet over grass.	area is not provided. The route is 18
CBC: 11B-206.2.17	
Other: ADA 206.2.17	
Improve play area surface	\$0
Notes: Ground surface of the play area is wood ch surface is recommended	ips. Further evaluation of fall attenuation
CBC: 11B-1008.2.6.1	
Other: ADA 1008.2.6.1, ADA 1008.2.6.2	

Mary Avenue Dog Park Mary Avenue Cupertino, CA

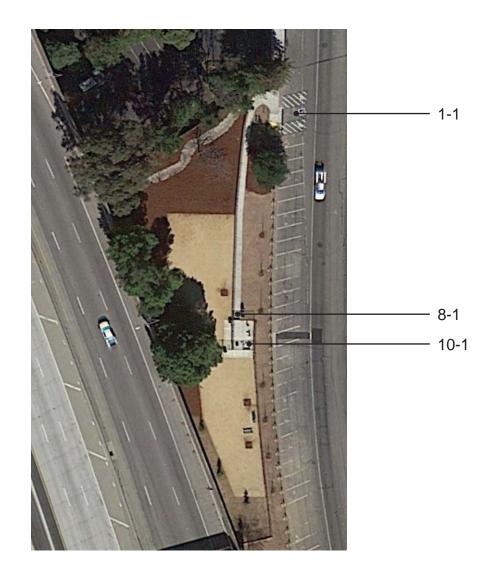


Mary Ave Dog Park

1 - 1	Parking Area	Category: 1
Regrade	accessible parking space or a	ccess aisle \$1,600
Notes:	The slope at the bottom of the a	ccessible parking is 5% (2% max).
CBC:	11B-502.4	
Other:	ADA 502.4	
8 - 1	Door/Gate	Category: 1
Provide	strike edge clearance	\$0
Notes:	Front approach strike-edge clean containers (18" min), move trash	rance on the pull side of the door is 4" due to trash o containers.
CBC:	11B-404.2.4.1	
Other:	ADA 404.2.4.1	
10 - 1	Drinking Fountain	Category: 3
Provide	wing walls	\$1,000
Notes:	Drinking fountain protrudes 20" f than 4" must be mounted below	from vertical support at 26.25" AFF (protrusion more 27" or above 80").
CBC:	11B-602.8, 11B-602.9	
Other:	ADA 307	
Raise or	lower fountain	\$1,500
Notes:	Space between floor/ground and	bottom of drinking fountain is 26.25" (27" min).
CBC:	11B-306.3	

McClellan Ranch 4H Building 22221 McClellan Rd Cupertino, CA




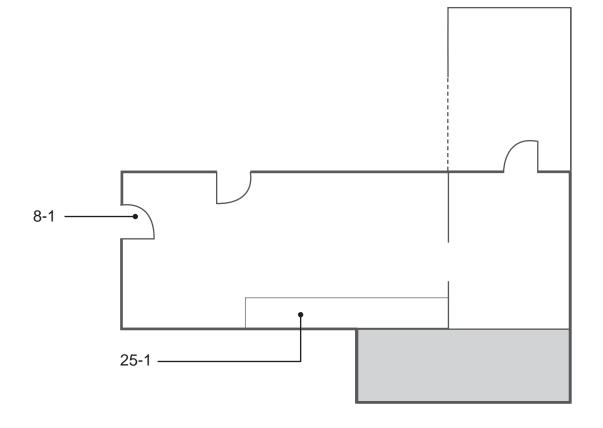

Building	
8 - 1 Door/Gate	Category: 1
Replace or modify door threshold	\$125
Notes: Threshold has a vertical change of 1" (1.	/4" max, up to 1/2" with a bevel).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
Regrade surface	\$2,500
Notes: Slope on the push side of the door is 7.1	% (2.0% max).
CBC: 11B-404.2.4.4	
Other: ADA 404.2.4.4	
25 - 1 Kitchen	Category: 4
Provide accessible sink	\$3,000
Notes: Sink is 8 inches deep (6.5 inches max).	
CBC: 11B-606.7	
Other: -	
Insulate water lines	\$125
Notes: Insulation on hot water pipe is not attach	ned.
CBC: 11B-606.5	
Other: ADA 606.5	
Provide knee and toe clearance	\$0
Notes: Knee clearance underneath the sink is 2 cleaning supplies.	26" (27" min). Knee space is obstructed by
CBC: 11B-306.3.3	
Other: ADA 306.3, ADA 306.3.3	
Modify counter height	\$1,500
Notes: Height of kitchen work surface is 34.25"	AFF (28" min to 34" max).
CBC: 11B-804.3.2	
Other: ADA 804.3.2	

McClellan Ranch Nature Museum 22221 McClellan Rd Cupertino, CA


N T

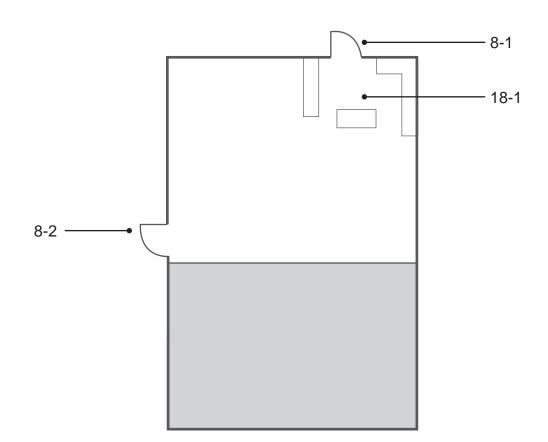

Buildin	g	
8 - 1	Door/Gate	Category: 4
Regrade	surface	\$2,500
Notes:	Slope on the swing side of the door is 1	5.2% for 36" (2.0% max).
CBC:	11B-404.2.4.4	
Other:	ADA 404.2.4.4	
8 - 2	Door/Gate	Category: 4
Replace	or modify door threshold	\$125
Notes:	Threshold has a vertical change of 1.5"	(0.25" max, up to 0.5" with a bevel).
CBC:	11B-404.2.5	
Other:	ADA 404.2.5	
Replace	door hardware	\$425
Notes:	Door knob requires grasping and twistin	ig to operate.
CBC:	11B-309.4, 11B-404.2.7	
Other:	ADA 309.4	
18 - 1	Room	Category: 4
Widen C	orridor	\$0
Notes:	Path of travel from door into the room is wide due to moveable furniture (36" wid Relocate furniture.	a 27" wide due to a moveable table or 34" le min; down to 32" wide for 24" max).
CBC:	11B-403.5.1	
Other:	ADA 403.5.1	

McClellan Ranch Office 22221 McClellan Rd Cupertino, CA

 $\stackrel{\mathsf{N}}{\uparrow}$

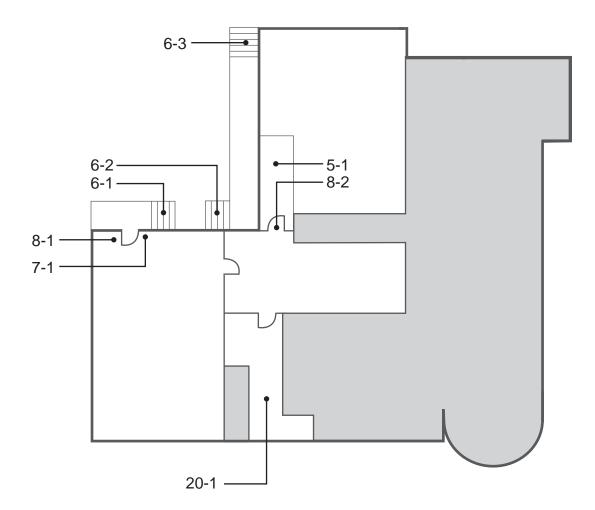


Building	
5 - 1 Ramp	Category: 2
Install a handrail	\$750
Notes: Handrail is not provided on one sic on both sides of ramp).	de of the ramp to the conference room (required
CBC: 11B-505.2	
Other: ADA 405.8	
6 - 1 Stairway	Category: 1
Install a handrail	\$250
Notes: Handrail on one side of the stairs h 6" is provided at the top of the han	has no parallel extension. A parallel extension of adrail (12" min).
CBC: 11B-505.10.2, 11B-505.10.3	
Other: ADA 505.10.2, ADA 505.10.3	
Replace stairs	\$1,200
Notes: Tread widths range from 11" to 12	.5" (uniform widths required).
CBC: 11B-504.2	
Other: ADA 504.2	
Install tread striping	\$60
Notes: No tread striping provided on 4 rise	ers.
CBC: 11B-504.4.1	
Other: -	
6 - 2 Stairway	Category: 1
Install a handrail	\$1,250
Notes: Handrails are not provided on eithe sides).	er side of the stairway (handrails required on both
CBC: 11B-505.2	
Other: ADA 505.2	
Install tread striping	\$75
Notes: No tread striping provided on 5 rise	ers.
CBC: 11B-504.4.1	
Other: -	

Building	
6 - 3 Stairway	Category: 1
Install a handrail	\$125
Notes: An extension is not provided at the b	ottom of the handrail (one tread-width min).
CBC: 11B-505.10.3	
Other: ADA 505.10.3	
Install tread striping	\$90
Notes: No tread striping provided on 6 risers	
CBC: 11B-504.4.1	
Other: -	
Replace stairs	\$300
Notes: Bottom riser meets the grade of walk height is required).	and varies from 8" to 5.5" in height (uniform
CBC: 11B-504.2	
Other: ADA 504.2	
7 - 1 Hazard	Category: 1
Remove overhanging or protruding objects	\$125
Notes: Bird house protrudes 5.5" from the w mounted below 27" or above 80").	all at 39" AFF (protrusion more than 4" must be
CBC: 11B-307.2, 11B-307.4	
Other: ADA 307.2, ADA 307.4	
8 - 1 Door/Gate	Category: 1
Provide strike edge clearance	\$2,500
Notes: Front approach strike-edge clearance steps (18" min).	e on the push side of the door is 11" due to
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.1	
Enlarge door opening	\$1,650
Notes: Height of clear opening is 79.75" AFF min).	(80" min). Width of clear opening is 29.5" (32"
CBC: 11B-404.2.3	
Other: ADA 404.2.3, ADA 404.2.3.2	
Provide sign(s) indicating accessible entrie	s \$500
Notes: Sign indicating the location of an acc accessible entry.	essible entry are not provided at non-
CBC: 11B-216.6	
Other: ADA 216.6	

Building 8 - 2 Door/Gate Category: 4 Increase maneuvering space \$1,0 Notes: Maneuvering clearance on the push side of the door with a latch-side approach 38" (44" min). CBC: 11B-404.2.4 Other: ADA 404.2.4.1 Other: ADA 404.2.4.1 20 - 1 Single User Restroom Category: 4 Install restroom sign Notes: No federal or state required signs provided (both are required). CBC: 11B-216.8, 703.7.2.6 Other: ADA 703 Provide clear floor or turning space Notes: Path to the water closet is 15.5" wide due to movable furniture (36" min). No clear floor space adjacent to the water closet because fixture is set into an alcove (30 48" min). No 60" turnaround space provided. CBC: 11B-305.5, 11B-603.2.1 Other: ADA 304.3.1, ADA 305.3, ADA 305.5, ADA 306.3, ADA 603.2.1 Replace or modify grab bars Notes: Side grab bar extends 53.5" from the rear wall (54" min). Rear grab bar is 31" lo	\$0 \$0 ar
Notes: Maneuvering Clearance on the push side of the door with a latch-side approach 38" (44" min). CBC: 11B-404.2.4 Other: ADA 404.2.4.1 20 - 1 Single User Restroom Category: 4 Install restroom sign Notes: No federal or state required signs provided (both are required). CBC: 11B-216.8, 703.7.2.6 Other: ADA 703 Provide clear floor or turning space Notes: Path to the water closet is 15.5" wide due to movable furniture (36" min). No clear floor space adjacent to the water closet because fixture is set into an alcove (30 48" min). No 60" turnaround space provided. CBC: 11B-305.5, 11B-603.2.1 Other: ADA 304.3.1, ADA 305.3, ADA 305.5, ADA 306.3, ADA 603.2.1 Replace or modify grab bars	\$0 \$0 ar
38" (44" min). CBC: 11B-404.2.4 Other: ADA 404.2.4.1 20 - 1 Single User Restroom Category: 4 Install restroom sign Notes: No federal or state required signs provided (both are required). CBC: 11B-216.8, 703.7.2.6 Other: ADA 703 Provide clear floor or turning space Notes: Path to the water closet is 15.5" wide due to movable furniture (36" min). No clear floor space adjacent to the water closet because fixture is set into an alcove (30 48" min). No 60" turnaround space provided. CBC: 11B-305.5, 11B-603.2.1 Other: ADA 304.3.1, ADA 305.3, ADA 305.5, ADA 306.3, ADA 603.2.1 Replace or modify grab bars	\$0 \$0 ar
Other: ADA 404.2.4.1 20 - 1 Single User Restroom Category: 4 Install restroom sign Notes: No federal or state required signs provided (both are required). CBC: 11B-216.8, 703.7.2.6 Other: ADA 703 Provide clear floor or turning space Notes: Path to the water closet is 15.5" wide due to movable furniture (36" min). No cleat floor space adjacent to the water closet because fixture is set into an alcove (30 48" min). No 60" turnaround space provided. CBC: 11B-305.5, 11B-603.2.1 Other: ADA 304.3.1, ADA 305.3, ADA 305.5, ADA 306.3, ADA 603.2.1 Replace or modify grab bars	\$0 ar
20 - 1 Single User Restroom Category: 4 Install restroom sign Notes: No federal or state required signs provided (both are required). CBC: 11B-216.8, 703.7.2.6 Other: ADA 703 Provide clear floor or turning space Notes: Path to the water closet is 15.5" wide due to movable furniture (36" min). No clear floor space adjacent to the water closet because fixture is set into an alcove (30 48" min). No 60" turnaround space provided. CBC: 11B-305.5, 11B-603.2.1 Other: ADA 304.3.1, ADA 305.3, ADA 305.5, ADA 306.3, ADA 603.2.1 Replace or modify grab bars Replace or modify grab bars	\$0 ar
Install restroom sign Notes: No federal or state required signs provided (both are required). CBC: 11B-216.8, 703.7.2.6 Other: ADA 703 Provide clear floor or turning space Notes: Path to the water closet is 15.5" wide due to movable furniture (36" min). No cleat floor space adjacent to the water closet because fixture is set into an alcove (30 48" min). No 60" turnaround space provided. CBC: 11B-305.5, 11B-603.2.1 Other: ADA 304.3.1, ADA 305.3, ADA 305.5, ADA 306.3, ADA 603.2.1 Replace or modify grab bars	\$0 ar
Notes: No federal or state required signs provided (both are required). CBC: 11B-216.8, 703.7.2.6 Other: ADA 703 Provide clear floor or turning space Notes: Path to the water closet is 15.5" wide due to movable furniture (36" min). No clear floor space adjacent to the water closet because fixture is set into an alcove (30 48" min). No 60" turnaround space provided. CBC: 11B-305.5, 11B-603.2.1 Other: ADA 304.3.1, ADA 305.3, ADA 305.5, ADA 306.3, ADA 603.2.1 Replace or modify grab bars	\$0 ar
CBC: 11B-216.8, 703.7.2.6 Other: ADA 703 Provide clear floor or turning space Notes: Path to the water closet is 15.5" wide due to movable furniture (36" min). No clear floor space adjacent to the water closet because fixture is set into an alcove (30 48" min). No 60" turnaround space provided. CBC: 11B-305.5, 11B-603.2.1 Other: ADA 304.3.1, ADA 305.3, ADA 305.5, ADA 306.3, ADA 603.2.1 Replace or modify grab bars	ar
Other: ADA 703 Provide clear floor or turning space Notes: Path to the water closet is 15.5" wide due to movable furniture (36" min). No cleat floor space adjacent to the water closet because fixture is set into an alcove (30 48" min). No 60" turnaround space provided. CBC: 11B-305.5, 11B-603.2.1 Other: ADA 304.3.1, ADA 305.3, ADA 305.5, ADA 306.3, ADA 603.2.1 Replace or modify grab bars	ar
Provide clear floor or turning space Notes: Path to the water closet is 15.5" wide due to movable furniture (36" min). No clear floor space adjacent to the water closet because fixture is set into an alcove (30 48" min). No 60" turnaround space provided. CBC: 11B-305.5, 11B-603.2.1 Other: ADA 304.3.1, ADA 305.3, ADA 305.5, ADA 306.3, ADA 603.2.1 Replace or modify grab bars	ar
Notes: Path to the water closet is 15.5" wide due to movable furniture (36" min). No clea floor space adjacent to the water closet because fixture is set into an alcove (30 48" min). No 60" turnaround space provided. CBC: 11B-305.5, 11B-603.2.1 Other: ADA 304.3.1, ADA 305.3, ADA 305.5, ADA 306.3, ADA 603.2.1 Replace or modify grab bars	ar
floor space adjacent to the water closet because fixture is set into an alcove (30 48" min). No 60" turnaround space provided. CBC: 11B-305.5, 11B-603.2.1 Other: ADA 304.3.1, ADA 305.3, ADA 305.5, ADA 306.3, ADA 603.2.1 Replace or modify grab bars	
Other: ADA 304.3.1, ADA 305.3, ADA 305.5, ADA 306.3, ADA 603.2.1 Replace or modify grab bars	
Replace or modify grab bars	
Notes: Side grab bar extends 53.5" from the rear wall (54" min). Rear grab bar is 31" lo	\$0
(36" min).	ng
CBC: 11B-604.5.1, 11B-604.5.2	
Other: ADA 604.5.1, ADA 604.5.2	
Modify lavatory or counter clearances	\$0
Notes: Height of the lavatory rim is 34-1/8" AFF (34" max). Knee space under the lavatory is obstructed by boxes.	ory
CBC: 11B-306.3.3, 11B-606.3	
Other: ADA 306.3, ADA 306.3.3, ADA 606.3	
Remove overhanging or protruding objects	\$0
Notes: First aid kit protrudes 5.25" from the wall at 54.25" AFF (Objects may protrude n more than 4" where the lower edge is between 27" and 80" AFF).	0
CBC: 11B-307.2	
Other: ADA 307.2	
Renovate restroom\$75,0	000
Notes: Restroom is not accessible.	
CBC: 11B-213, 11B-604	
Other: ADA 213.3, ADA 604.8	

McClellan Ranch 22221 McClellan Road Cupertino, CA



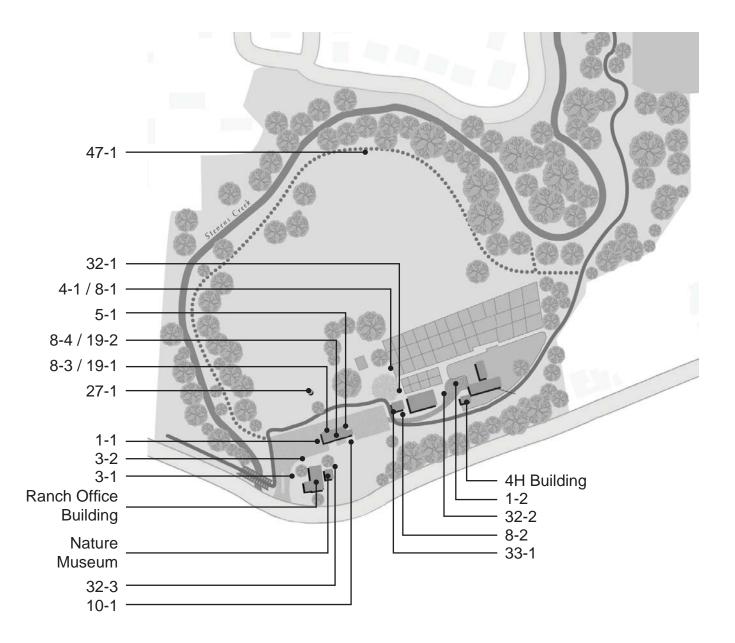

Park	
1 - 1 Parking Area	Category: 1
Provide a pavement stencil	\$210
Notes: The ISA is a 24" from the bottom of the spa	ace (ISA must be flush with bottom of
space).	
CBC: 11B-502.6.4.1, 11B-502.6.4.2	
Other: ADA 502.6	
Provide adequate striping	\$100
Notes: The words "No Parking" are not painted in t	the access aisle.
CBC: 11B-502.3.3	
Other: -	
Provide or modify accessible access aisles	\$210
Notes: Access aisle does not have a blue border.	
CBC: 11B-502.3.2, 11B-502.3.3	
Other: ADA 502.3.3	
Install reserved parking sign	\$375
Notes: Parking signs are not located in front of des	signated accessible parking spaces.
CBC: 11B-502.6, 11B-502.6.1	
Other: ADA 502.6	
Regrade accessible parking space or access aisl	e \$1,600
Notes: Slope of parking spaces and access aisles	is up to 4% (2.0% max).
CBC: 11B-502.4	
Other: ADA 502.4	
1 - 2 Parking Area	Category: 1
Install reserved parking sign	\$125
Notes: Contact information is not provided on tow-	away warning sign.
CBC: 11B-502.8	
Other: -	
Provide a firm, stable and slip resistant surface	\$1,640
Notes: Accessible parking surface is compacted g	ravel.
CBC: 11B-302.1	
Other: ADA 302.1	
Provide adequate striping	\$100
Notes: No striping provided at accessible parking a	and access aisle.
CBC: 11B-502.2	
Other: ADA 502.2	

Park	Cotogo	one 1
3 - 1 Curb Ramp	Catego	•
Provide detectable warni		\$0
Notes: Detectable warni		
CBC: 11B-247.1.2, 11E	3-406.5.12	
Other: -		\$ 2,422
Install, replace or modify	•	\$2,460
Notes: Running slope of is 7.6% (2.0% ma	the curb ramp is 9.6% (8.33% max). Cross s ax).	slope of the curb ramp
CBC: 11B-405.2, 11B-4	406	
Other: ADA 405.2, ADA	405.3, ADA 406.1	
Provide a level landing		\$0
Notes: Top landing has	a slope of 13.9% (2% max).	
CBC: 11B-406.5.3		
Other: ADA 406.4, ADA	406.7	
3 - 2 Curb Ramp	Catego	ory: 1
Provide a level landing		\$0
Notes: Top landing has	a slope of 3.4% (2% max).	
CBC: 11B-406.5.3		
Other: ADA 406.4, ADA	406.7	
Install, replace or modify	curb ramp	\$2,460
Notes: Cross slope of th is 14.6% (8.33%	e curb ramp is 3.7% (2.0% max). Running slo max).	ope of the curb ramp
CBC: 11B-405.2, 11B-4	406	
Other: ADA 405.2, ADA	405.3, ADA 406.1	
Provide detectable warni	ings	\$0
Notes: Detectable warni	ngs not provided.	
CBC: 11B-247.1.2, 11E	3-406.5.12	
Other: -		
Provide surface texture		\$0
Notes: No grooved bord	er provided.	
CBC: 11B-406.5.11		
Other: -		
4 - 1 Walk	Catego	ory: 2
Provide an accessible pa		\$600
•	ute is not provided to the community garden.	
CBC: 11B-206.2.2		
Other: ADA 206.2.2		
12/19/2014	Park	Page
		i aye i

Park		
5 - 1	Ramp	Category: 2
Install a	handrail	\$1,250
Notes:	Handrails are not provided on either si gripping surfaces are required on both	de of the ramp (handrails with continuous sides of ramp).
CBC:	11B-505.2	
Other:	ADA 405.8	
Regrade	or replace ramp	\$2,125
Notes:	Ramp slope is 24.1% for 41" (8.33% m	nax).
CBC:	11B-405.2	
Other:	ADA 405.2	
Grind or	patch vertical change of grade	\$250
Notes:	2.25" wide and 3/4" deep gap betweer (1/4" max vertical, up to 1/2" with a between	h the top of the ramp and the concrete floor vel, and 1/2" max opening).
CBC:	11B-405.4	
Other:	ADA 405.4	
8 - 1	Door/Gate	Category: 2
Provide	or modify door kickplate	\$225
Notes:	A smooth and uninterrupted kick plate	surface is not provided.
CBC:	11B-404.2.10	
Other:	ADA 404.2.10	
Raise or	lower existing hardware	\$125
Notes:	Center of door hardware is 47.5" AFF	(34" min to 44" max).
CBC:	11B-404.2.7	
Other:	ADA 404.2.7	
8 - 2	Door/Gate	Category: 2
Replace	or modify door threshold	\$125
Notes:	Threshold at garden shed door has a v a bevel).	vertical change of 3" (.25" max, up to .5" with
CBC:	11B-404.2.5	
Other:	ADA 404.2.5	
8 - 3	Door/Gate	Category: 2
Adjust d	oor closer	\$125
Notes:	Door opening force at men's restroom	is 8 lbs (5 lbs max).
CBC:	11B-404.2.9	
Other:	ADA 404.2.9	


Park		
8 - 4	Door/Gate	Category: 2
Adjust door closer \$125		
Notes	: Door opening force at women's rest	room is 7 lbs (5 lbs max).
CBC	: 11B-404.2.9	
Other	: ADA 404.2.9	
10 - 1	Drinking Fountain	Category: 3
Replace	e fountain	\$3,000
Notes: Bubbler height is 36.5" AFF. Fountain is neither standing person nor accessible fountain (accessible fountain bubbler 36" max above floor; standing fountain has 38 min to 43" max)		
CBC	: 11B-602.4, 11B-602.7	
Other	: ADA 602.4, ADA 602.7	
Increas	e or provide maneuvering or clear f	loor area \$0
Notes	: The drinking fountain is not oriented path of travel.	to provide the clear floor space adjacent to the
CBC	: 11B-305, 11B-306, 11B-602.2	
Other	: ADA 305, ADA 305.3, ADA 305.5, A	DA 306
Install a	n additional high or low fountain	\$0
Notes	: A wheelchair accessible fountain an provided.	d a higher standing person fountain is not
CBC	: 11B-211.2	
Other	: ADA 211.2	

19 - 1 Multiple User Restroom	Categor	'y: 2
Replace or reposition dispenser		\$125
	2.5" AFF and toilet seat cover disp	enser is located 43"
CBC: 11B-603.5		
Other: -		
Replace or reposition fixtures		\$1,250
Notes: Centerline of the water close	et to the sidewall is 19.5" (17" min t	o 18" max).
CBC: 11B-604.2		
Other: ADA 604.2		
Provide or replace compartment do	oor hardware	\$175
•	t have handle on outside the door a ave U-shaped handles both inside a	
CBC: 11B-604.8.1.2		
Other: ADA 604.8.1.2		
Replace toilet or adjust toilet seat l	height	\$3,000
Notes: Water closet seat height is	19.5" AFF (17" min to 19" max).	
CBC: 11B-604.4		
Other: ADA 604.4		
Modify lavatory or counter clearand	ces	\$1,500
Notes: Clear space at the lavatory	apron is 27.5" (29" min).	
CBC: 11B-306.3.1		
Other: -		
Regrade surface		\$3,000
Notes: Clear floor space of the toile	et has a slope of 6.5% (2% max).	
CBC: 11B-404.2.4.4		
Other: ADA 404.2.4.4		
Replace urinal		\$3,000
Notes: Height of the urinal rim is 18	3" AFF (17" max).	
CBC: 11B-605.2		
Other: ADA 605.2		
Replace or modify grab bars		\$300
bar to any object). Reposition	above the grab bar (12" min clear s on toilet paper dispenser to below th n to 9" max in front of the water clos	ne grab bar with the
CBC: 11B-609.3		
Other: ADA 609.3		
2/19/2014	Park	Page 1
	i un	1 aye 1


Park		
19 - 2	Multiple User Restroom	Category: 2
Replace	or reposition dispenser	\$125
Notes:	Toilet paper dispenser is located 40.5" AFF (40" max)	•
CBC:	11B-603.5	
Other:	-	
Replace	or reposition fixtures	\$1,250
Notes:	Centerline of the water closet to the sidewall is 19.75"	(17" min to 18" max).
CBC:	11B-604.2	
Other:	ADA 604.2	
Provide of	or replace compartment door hardware	\$175
Notes:	Compartment door does not have handle outside the (compartment door must have U-shaped handles both door and be self-closing).	
CBC:	11B-604.8.1.2	
Other:	ADA 604.8.1.2	
Replace	toilet or adjust toilet seat height	\$3,000
Notes:	Water closet seat height is 19.5" AFF (17" min to 19"	max).
CBC:	11B-604.4	
Other:	ADA 604.4	
Modify la	vatory or counter clearances	\$1,500
Notes:	Clear space beneath the lavatory apron is 27.5" (29" r	nin).
CBC:	11B-306.3.1	
Other:	-	
Regrade	surface	\$3,000
Notes:	Clear floor space of the toilet has a slope of 6% (2% n	nax).
CBC:	11B-404.2.4.4	
Other:	ADA 404.2.4.4	
Replace	or modify grab bars	\$300
	The toilet paper dispenser is 5" above the grab bar (12 grab bar to any object). Reposition toilet paper dispen the toilet paper centerline 7" min to 9" max in front of t	ser to below the grab bar with
	11B-609.3	
Other:	ADA 609.3	

Park			
27 - 1	Assembly Area	Category: 2	
Provide	an accessible path of travel		\$600
Notes:	An accessible path of travel to the assembly are is 30 linear feet over natural surface.	a and sundial is not provided	Route
CBC:	11B-206.2.2		
Other:	ADA 206.2.2		
32 - 1	Picnic Area	Category: 2	
Provide	an accessible path of travel		\$400
Notes:	An accessible route to the picnic area is not pro- wood chips to two tables.	vided. Route is 20 linear feet	over
CBC:	11B-403		
Other:	AGODA F245.4		
Increase	e or provide clear floor area		\$700
Notes:	A 36" min clear space around the picnic table is	not provided.	
CBC:	-		
Other:	AGODA 1011.2.1		
Provide	an accessible table		\$500
Notes:	Knee clearance is 7.75" deep (8" min).		
CBC:	11B-306.3		
Other:	-		
32 - 2	Picnic Area	Category: 2	
Provide	an accessible path of travel		\$125
Notes:	An accessible route to the picnic area is not pro- to the picnic area (1/4" max, up to 1/2" with a be		ne route
CBC:	11B-403		
Other:	AGODA F245.4		
Increase	e or provide clear floor area		\$700
Notes:	A 36" min clear space around the picnic table is	not provided.	
CBC:	-		
Other:	AGODA 1011.2.1		
Provide	an accessible table	:	\$2,500
Notes:	Knee space is not provided at tables.		
CBC:	-		
Other [.]	AGODA 1011.4		

Park	
32 - 3 Picnic Area	Category: 2
Increase or provide clear floor area	\$700
Notes: A 36" min clear space around the picnic ta	able is not provided.
CBC: -	
Other: AGODA 1011.2.1	
33 - 1 Outdoor Constructed Features	Category: 3
Increase or provide clear floor area	\$700
Notes: Compost and recycling containers are not and do not have adequate clear floor space	t located on an accessible path of travel ce, 100 sf of accessible surfacing needed.
CBC: -	
Other: AGODA 1011.2	
47 - 1 Trails	Category: 2
Repair surface	\$250
Notes: There is a 2" change in level from concret (1/4" max, up to 1/2" with a bevel).	te path to trail surface at the two trailheads
CBC: -	
Other: AGODA 1017.5	
Provide a firm, stable and slip resistant surface	\$0
Notes: Trail surface is a variety of natural surface etc. and is the nature of program.	es: compacted soil, dry grass, tree duff,
CBC: -	
Other: AGODA 1017.2	
Other: AGODA 1017.2 Widen trail	\$0
Widen trail	
Widen trail Notes: Clear width of trail ranges from 16" to 36"	
Widen trail Notes: Clear width of trail ranges from 16" to 36" CBC: -	
Widen trail Notes: Clear width of trail ranges from 16" to 36" CBC: - Other: AGODA 1017.3	(36" min). \$0
Widen trail Notes: Clear width of trail ranges from 16" to 36" CBC: - Other: AGODA 1017.3 Install sign Notes: Informational signs along the trail do not h	(36" min). \$0
Widen trail Notes: Clear width of trail ranges from 16" to 36" CBC: - Other: AGODA 1017.3 Install sign Notes: Informational signs along the trail do not h programmatic alternative.	(36" min). \$0
Widen trail Notes: Clear width of trail ranges from 16" to 36" CBC: - Other: AGODA 1017.3 Install sign Notes: Informational signs along the trail do not h programmatic alternative. CBC: -	(36" min). \$0
Widen trail Notes: Clear width of trail ranges from 16" to 36" CBC: - Other: AGODA 1017.3 Install sign Notes: Informational signs along the trail do not h programmatic alternative. CBC: - Other: AGODA 1017.10	(36" min). \$0 nave Braille or tactile numbering. Provide \$300
 Widen trail Notes: Clear width of trail ranges from 16" to 36" CBC: - Other: AGODA 1017.3 Install sign Notes: Informational signs along the trail do not h programmatic alternative. CBC: - Other: AGODA 1017.10 Regrade surface Notes: Running slope up to 18.7% for 10 linear feet 	(36" min). \$0 nave Braille or tactile numbering. Provide \$300

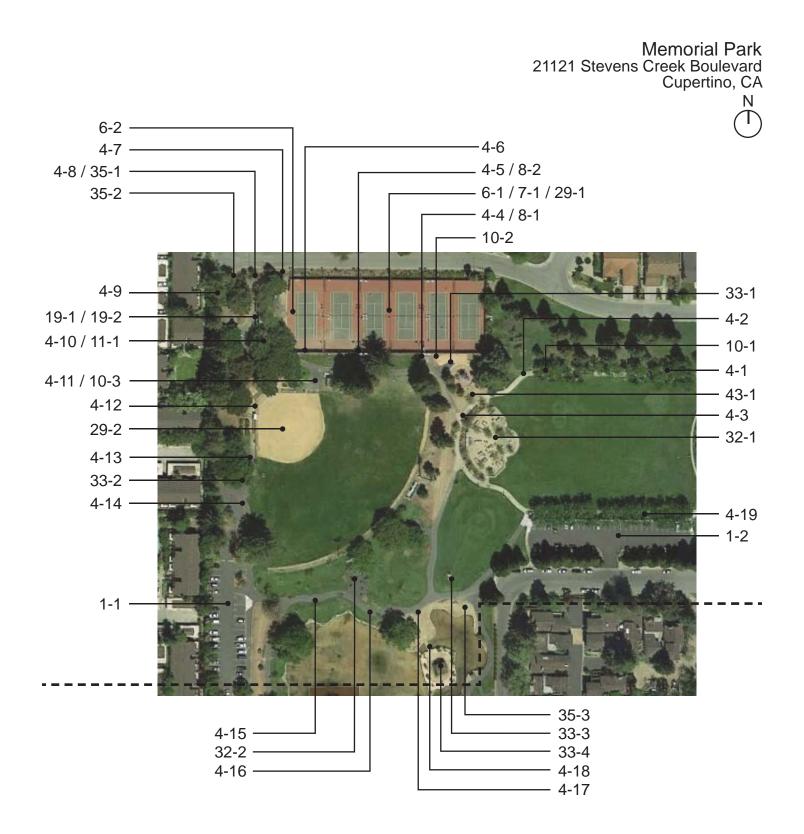

Memorial Park 21121 Stevens Creek Boulevard Cupertino, CA N

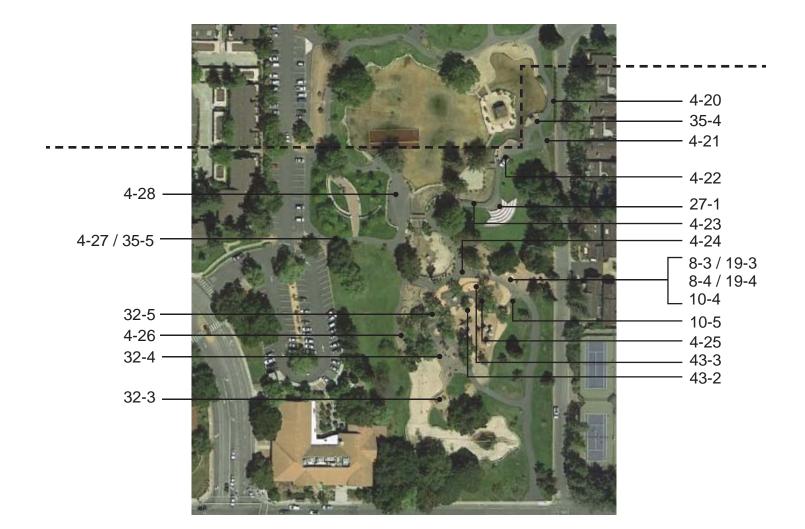

Memorial Park

1 - 1	Parking Area Category	y: 1
nstall v	an accessible sign	\$375
Notes	A "Van Accessible" sign is not provided. Required: A "Van Acce posted at stalls striped and designated to be van accessible.	essible" sign is
CBC:	11B-502.6	
Other	ADA 208.2.4	
Provide	adequate striping	\$100
Notes:	Faded striping in the accessible parking space.	
CBC:	11B-502.3.3	
Other	-	
Regrade	e accessible parking space or access aisle	\$1,600
Notes:	Slope in the parking space is 2.5%, slope in the access aisle is	3% (2% max).
CBC:	11B-502.4	
Other	ADA 502.4	
Donair a		\$ 050
vehan s	surface	\$250
	There is 1/2" change in level at the joint between asphalt and co level landing of curb ramp (1/4" max).	•
Notes:	There is 1/2" change in level at the joint between asphalt and c	•
Notes: CBC:	There is 1/2" change in level at the joint between asphalt and concerning of curb ramp (1/4" max).	•
Notes: CBC:	There is 1/2" change in level at the joint between asphalt and concerning of curb ramp (1/4" max). 11B-302.3	oncrete in the top
Notes: CBC: Other: 1 - 2	There is 1/2" change in level at the joint between asphalt and ca level landing of curb ramp (1/4" max). 11B-302.3 ADA 302.3	oncrete in the top y: 1
Notes: CBC: Other: 1 - 2 Regrade	 There is 1/2" change in level at the joint between asphalt and callevel landing of curb ramp (1/4" max). 11B-302.3 ADA 302.3 Parking Area Category 	oncrete in the top y: 1
Notes: CBC: Other: 1 - 2 Regrade Notes:	 There is 1/2" change in level at the joint between asphalt and callevel landing of curb ramp (1/4" max). 11B-302.3 ADA 302.3 Parking Area Category accessible parking space or access aisle 	oncrete in the top y: 1
Notes: CBC: Other: 1 - 2 Regrade Notes: CBC:	 There is 1/2" change in level at the joint between asphalt and callevel landing of curb ramp (1/4" max). 11B-302.3 ADA 302.3 Parking Area Category accessible parking space or access aisle Slope of the access aisle is 2.4% (2% max). 	oncrete in the top y: 1
Notes: CBC: Other: 1 - 2 Regrade Notes: CBC: Other:	 There is 1/2" change in level at the joint between asphalt and callevel landing of curb ramp (1/4" max). 11B-302.3 ADA 302.3 Parking Area Category accessible parking space or access aisle Slope of the access aisle is 2.4% (2% max). 11B-502.4 	
Notes: CBC: Other: 1 - 2 Regrade Notes: CBC: Other: Provide	 There is 1/2" change in level at the joint between asphalt and callevel landing of curb ramp (1/4" max). 11B-302.3 ADA 302.3 Parking Area Category accessible parking space or access aisle Slope of the access aisle is 2.4% (2% max). 11B-502.4 ADA 502.4 	oncrete in the top y: 1 \$1,600 \$100
Notes: CBC: Other: 1 - 2 Regrade Notes: CBC: Other: Provide Notes:	 There is 1/2" change in level at the joint between asphalt and callevel landing of curb ramp (1/4" max). 11B-302.3 ADA 302.3 Parking Area Category accessible parking space or access aisle Slope of the access aisle is 2.4% (2% max). 11B-502.4 ADA 502.4 adequate striping The "No Parking" striping is partially scraped off. Accessible parking partially scraped off. Accessible parking partially scraped off. Accessible parking partially scraped off. 	oncrete in the top y: 1 \$1,600 \$100
Notes: CBC: Other: 1 - 2 Regrade Notes: CBC: Provide Notes:	 There is 1/2" change in level at the joint between asphalt and callevel landing of curb ramp (1/4" max). 11B-302.3 ADA 302.3 Parking Area Category accessible parking space or access aisle Slope of the access aisle is 2.4% (2% max). 11B-502.4 ADA 502.4 adequate striping The "No Parking" striping is partially scraped off. Accessible para access aisle are 17' long (18' min). 	oncrete in the top y: 1 \$1,600 \$100
Notes: CBC: Other: 1 - 2 Regrade Notes: CBC: Other: Notes: CBC:	 There is 1/2" change in level at the joint between asphalt and concerning of curb ramp (1/4" max). 11B-302.3 ADA 302.3 Parking Area Category accessible parking space or access aisle Slope of the access aisle is 2.4% (2% max). 11B-502.4 ADA 502.4 adequate striping The "No Parking" striping is partially scraped off. Accessible paraccess aisle are 17' long (18' min). 11B-502.2, 11B-502.3.3 	oncrete in the top <u>y: 1</u> \$1,600 \$100 rking space and
Notes: CBC: Other: 1 - 2 Regrade Notes: CBC: Other: CBC: CBC: CBC: Other: 4 - 1	 There is 1/2" change in level at the joint between asphalt and concernent level landing of curb ramp (1/4" max). 11B-302.3 ADA 302.3 Parking Area Category accessible parking space or access aisle Slope of the access aisle is 2.4% (2% max). 11B-502.4 ADA 502.4 adequate striping The "No Parking" striping is partially scraped off. Accessible paraccess aisle are 17' long (18' min). 11B-502.2, 11B-502.3.3 ADA 502.2 	oncrete in the top <u>y: 1</u> \$1,600 \$100 rking space and <u>y: 2</u>
Notes: CBC: Other: 1 - 2 Regrade Notes: CBC: Other: Provide Notes: CBC: Other: 4 - 1 Regrade	 There is 1/2" change in level at the joint between asphalt and callevel landing of curb ramp (1/4" max). 11B-302.3 ADA 302.3 Parking Area Category accessible parking space or access aisle Slope of the access aisle is 2.4% (2% max). 11B-502.4 ADA 502.4 adequate striping The "No Parking" striping is partially scraped off. Accessible paraccess aisle are 17' long (18' min). 11B-502.2, 11B-502.3.3 ADA 502.2 Walk Category 	oncrete in the top <u>y: 1</u> \$1,600 \$100 rking space and <u>y: 2</u> \$640
Notes: CBC: Other: 1 - 2 Regrade Notes: CBC: Other: Provide Notes: CBC: Other: 4 - 1 Regrade Notes:	 There is 1/2" change in level at the joint between asphalt and callevel landing of curb ramp (1/4" max). 11B-302.3 ADA 302.3 Parking Area Category accessible parking space or access aisle Slope of the access aisle is 2.4% (2% max). 11B-502.4 ADA 502.4 adequate striping The "No Parking" striping is partially scraped off. Accessible paraccess aisle are 17' long (18' min). 11B-502.2, 11B-502.3.3 ADA 502.2 Walk Category 	oncrete in the top <u>y: 1</u> \$1,600 \$100 rking space and <u>y: 2</u> \$640

Memorial Park

	Walk	Category: 2	
Regrade			\$1,320
Notes:	Cross slope of concrete path is up to 39	% for 33 linear feet (2.0% max).	
	11B-403.3		
Other:	ADA 403.3		
4 - 3	Walk	Category: 2	
Grind or	patch vertical change of grade		\$250
	3/4" gap (1/2" max) and 3/4" change in (1/4" max, up to 1/2" with a bevel).	level in transition from asphalt to c	oncrete
CBC:	11B-303.2		
Other:	ADA 303.2, ADA 303.3		
4 - 4	Walk	Category: 2	
Regrade	surface		\$280
Notes:	Up to 6% running slope for 14 linear fee	et (5.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 5	Walk	Category: 2	
Regrade	surface		\$360
Notes:	Running slope of path is up to 17.7% for	or 18 linear feet (5.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 6	Walk	Category: 2	
Regrade	surface		\$3,440
Notes:	Cross slope of path is up to 5% for 172	linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
			-

Memorial Park

4 - 7	Walk	Category: 1
Provide	an accessible path of travel	\$2,460
Notes:	No curb ramp or detectable warning p	provided where pedestrian path crosses curb.
CBC:	11B-206.2.2	
Other:	ADA 206.2.2	
Regrade	surface	\$540
Notes:	Running slope of path is up to 9.7% ((2.0% max) for 27 linear feet.	5.0% max) and cross slope is up to 3.9%
CBC:	11B-403.3	
Other:	ADA 403.3	
Grind or	patch vertical change of grade	\$250
Notes:	1" change in level at joint (1/4" max, u	ιp to 1/2" with a bevel).
CBC:	11B-303.2	
Other:	ADA 303.2, ADA 303.3	
4 - 8	Walk	Category: 1
Regrade	surface	\$640
Notes:	Running slope of path is up to 6.4% for	or 32 linear feet (5.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 9	Walk	Category: 1
Regrade	surface	\$660
Notes:	Cross slope of path is up to 6.2% for	33 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 10	Walk	Category: 2
Regrade	surface	\$520
Notes:	Running slope of path is up to 12.6%	for 26 linear feet (5.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 11	Walk	Category: 2
Regrade	surface	\$940
	Running slope of path is up to 6.5% for	or 47 linear feet (5.0% max).
CBC:	11B-403.3	
	ADA 403.3	

4 - 12	Walk	Category: 2
	e surface	\$1,380
		for 69 linear feet behind ball field backstop (2.0%
CBC:	11B-403.3	
Other:	ADA 403.3	
Reduce	or eliminate opening	\$250
Notes:	Grate openings are 1" wide (1/2" m	ax).
CBC:	11B-302.3	
Other:	ADA 302.3	
4 - 13	Walk	Category: 2
Regrade	surface	\$560
Notes:	Cross slope of path is up to 2.5% for	or 28 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 14	Walk	Category: 2
Regrade	surface	\$600
Notes:	Cross slope of path is up to 3.6% for	or 30 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 15	Walk	Category: 2
Regrade	surface	\$560
Notes:	Cross slope of path is up to 3% for	28 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 16	Walk	Category: 2
Regrade	surface	\$780
Notes:	Cross slope of path is up to 3.4% for	or 39 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	

4 - 17	Walk	Category: 2
Regrade		\$160
<u> </u>	Cross slope of path is up to 3.3% for 8 line	
	11B-403.3	XX
Other:	ADA 403.3	
Grind or	patch vertical change of grade	\$250
Notes:	1" marked change in level at joint (1/4" ma	ax, up to 1/2" with a bevel).
CBC:	11B-303.2	
Other:	ADA 303.2, ADA 303.3	
4 - 18	Walk	Category: 2
Regrade	surface	\$400
Notes:	Running slope of path is up to 14.9% for 2	0 linear feet up to the bridge (5.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
Grind or	patch vertical change of grade	\$250
	1" change in level in the transition from as max, up to 1/2" with a bevel).	phalt to dirt at the end of the bridge (1/4"
CBC:	11B-303.2	
Other:	ADA 303.2, ADA 303.3	
4 - 19	Walk	Category: 1
Regrade	surface	\$940
Notes:	Cross slope of path is up to 4% for 47 line	ar feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 20	Walk	Category: 2
Regrade	surface	\$1,100
Notes:	Cross slope of path is up to 2.8% for 55 lir	near feet (2.0% max).
	11B-403.3 ADA 403.3	

4 - 21 Walk	Category: 2
nstall curb, barrier, or guardrail	\$25
Notes: No warning curb provided at abrupt d	rop off 10" (6" warning curb required)
CBC: 11B-303.5	
Other: -	
Repair surface	\$250
Notes: Partially deteriorated asphalt.	
CBC: 11B-302.3	
Other: ADA 302.3	
Provide an accessible path of travel	\$2,460
Notes: No curb ramp or detectable warning p	provided where pedestrian path crosses curb.
CBC: 11B-206.2.2	
Other: ADA 206.2.2	
4 - 22 Walk	Category: 2
Regrade surface	\$1,460
Notes: Cross slope of path is up to 5% for 73	3 linear feet (2.0% max)
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 23 Walk	Category: 2
Regrade surface	\$4,160
Notes: Cross slope of path is up to 7% for 20	08 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 24 Walk	Category: 2
Regrade surface	\$1,540
Notes: Cross slope of path is up to 4% for 77	7 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 25 Walk	Category: 2
Regrade surface	\$580
	5.0% max) and cross slope is up to 4% (2.0%
max) for 29 linear feet.	
CBC: 11B-403.3	

4 - 26 Walk Category: 2 Regrade surface \$1,540 Notes: Running slope of path is up to 11% for 77 linear feet (5.0% max). CBC: 11B-403.3 Other: ADA 403.3 4 - 27 4 - 27 Walk Category: 2 Regrade surface \$1,320 Notes: Running slope of path is up to 5.8% for 66 linear feet (5.0% max). CBC: 11B-403.3 Other: ADA 403.3				
Notes: Running slope of path is up to 11% for 77 linear feet (5.0% max). CBC: 11B-403.3 Other: ADA 403.3 4 - 27 Walk Category: 2 Regrade surface \$1,320 Notes: Running slope of path is up to 5.8% for 66 linear feet (5.0% max). CBC: 11B-403.3 Other: ADA 403.3 4 - 28 Walk Category: 2 Regrade surface \$1,980 Notes: Running slope of path is up to 8.1% (5.0% max) and cross slope is up to 4.6% (2.0% max) for 99 linear feet. CBC: 11B-403.3 Other: ADA 403.3 Category: 2 Install a handrail \$3,250 Notes: Two sets of 13 risers with no handrails (one central handrail required for stair runs at assembly areas). CBC: 11B-505.2 CBC: 11B-505.2 Category: 4 Other: ADA 505.2 Repair stair nosing Rest stair nosing \$125 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Category: 4 Other: ADA 505.2 Repair stair nosing CBC: 11B-505.2 Category: 4 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 118-505.2 Other: A	4 - 26	Walk	Category: 2	
CBC: 11B-403.3 Other: ADA 403.3 4 - 27 Walk Category: 2 Regrade surface \$1,320 Notes: Running slope of path is up to 5.8% for 66 linear feet (5.0% max). CBC: 11B-403.3 Other: ADA 403.3 4 - 28 Walk Category: 2 Regrade surface \$1,980 Notes: Running slope of path is up to 8.1% (5.0% max) and cross slope is up to 4.6% (2.0% max) for 99 linear feet. CBC: 11B-403.3 Other: ADA 403.3 6 - 1 Stairway Category: 2 Install a handrail \$3,250 Notes: Two sets of 13 risers with no handrails (one central handrail required for stair runs at assembly areas). CBC: 11B-505.2 Other: ADA 505.2 Repair stair nosing \$125 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 504.5 6 - 2 Stairway Category: 4 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Notes: No infer ADA 505.2 Notes: No tread striping provided (required for all treads on an exterior stairway). CBC: 11B-504.4.1	Regrade	surface	\$1,	,540
Other: ADA 403.3 4 - 27 Walk Category: 2 Regrade surface \$1,320 Notes: Running slope of path is up to 5.8% for 66 linear feet (5.0% max). CBC: 11B-403.3 Other: ADA 403.3 Category: 2 Regrade surface \$1,980 Notes: Running slope of path is up to 8.1% (5.0% max) and cross slope is up to 4.6% (2.0% max) for 99 linear feet. CBC: 11B-403.3 Other: ADA 403.3 Category: 2 Regrade surface \$1,980 Notes: Running slope of path is up to 8.1% (5.0% max) and cross slope is up to 4.6% (2.0% max) for 99 linear feet. CBC: 11B-403.3 Other: ADA 403.3 Category: 2 Install a handrail \$3,250 Notes: Two sets of 13 risers with no handrails (one central handrail required for stair runs at assembly areas). CBC: 11B-505.2 Other: ADA 505.2 Category: 4 Repair stair nosing \$125 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 505.2 Other: ADA 505.2 Category: 4 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2	Notes:	Running slope of path is up to 11% for	[•] 77 linear feet (5.0% max).	
4-27 Walk Category: 2 Regrade surface \$1,320 Notes: Running slope of path is up to 5.8% for 66 linear feet (5.0% max). CBC: 11B-403.3 Other: ADA 403.3 Category: 2 Regrade surface \$1,980 Notes: Running slope of path is up to 8.1% (5.0% max) and cross slope is up to 4.6% (2.0% max) for 99 linear feet. CBC: 11B-403.3 Other: ADA 403.3 Category: 2 Restal a handrail \$3,250 Notes: Two sets of 13 risers with no handrails (one central handrail required for stair runs at assembly areas). CBC: 11B-505.2 Other: ADA 505.2 Other: ADA 505.2 Repair stair nosing \$125 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 505.2 Other: ADA 505.2 Repair stair nosing \$125 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Other: ADA 505.2 Other: ADA 505.2 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Other: ADA 505	CBC:	11B-403.3		
Regrade surface \$1,320 Notes: Running slope of path is up to 5.8% for 66 linear feet (5.0% max). CBC: 11B-403.3 Other: ADA 403.3 Category: 2 Regrade surface \$1,980 Notes: Running slope of path is up to 8.1% (5.0% max) and cross slope is up to 4.6% (2.0% max) for 99 linear feet. CBC: 11B-403.3 Other: ADA 403.3 Category: 2 Regrade surface \$1,980 Notes: Running slope of path is up to 8.1% (5.0% max) and cross slope is up to 4.6% (2.0% max) for 99 linear feet. CBC: 11B-403.3 Other: ADA 403.3 Category: 2 Install a handrail \$3,250 Notes: Two sets of 13 risers with no handrails (one central handrail required for stair runs at assembly areas). CBC: 11B-505.2 Other: ADA 505.2 Category: 4 Repair stair nosing \$125 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 504.5 Category: 4 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Other: ADA 505.2 Theta 4 striping Restall tread striping provided (required for all treads on an exte	Other:	ADA 403.3		
Notes: Running slope of path is up to 5.8% for 66 linear feet (5.0% max). CBC: 11B-403.3 Other: ADA 403.3 4 - 28 Walk Category: 2 Regrade surface \$1,980 Notes: Running slope of path is up to 8.1% (5.0% max) and cross slope is up to 4.6% (2.0% max) for 99 linear feet. CBC: 11B-403.3 Other: ADA 403.3 6 - 1 Stairway Category: 2 Install a handrail \$3,250 Notes: Two sets of 13 risers with no handrails (one central handrail required for stair runs at assembly areas). CBC: 11B-505.2 Other: ADA 505.2 Repair stair nosing \$125 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 504.5 Other: ADA 504.5 Stairway Category: 4 \$750 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Stairway Other: ADA 505.2 \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Install tread striping \$45	4 - 27	Walk	Category: 2	
CBC: 11B-403.3 Other: ADA 403.3 4 - 23 Walk Category: 2 Regrade surface \$1,980 Notes: Running slope of path is up to 8.1% (5.0% max) and cross slope is up to 4.6% (2.0% max) for 99 linear feet. CBC: 11B-403.3 Other: ADA 403.3 6 - 1 Stairway Category: 2 Install a handrail \$3,250 Notes: Two sets of 13 risers with no handrails (one central handrail required for stair runs at assembly areas). CBC: 11B-505.2 Other: ADA 505.2 Repair stair nosing \$125 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 504.5 6 - 2 Stairway Category: 4 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Install tread striping \$45 Notes: No tread striping provided (required for all treads on an exterior stairway). CBC: 11B-504.4.1	Regrade	surface	\$1,	,320
Other: ADA 403.3 4 - 28 Walk Category: 2 Regrade surface \$1,980 Notes: Running slope of path is up to 8.1% (5.0% max) and cross slope is up to 4.6% (2.0% max) for 99 linear feet. CBC: 11B-403.3 CBC: 11B-403.3 Other: ADA 403.3 6 -1 Stairway Category: 2 Install a handrail \$3,250 Notes: Two sets of 13 risers with no handrails (one central handrail required for stair runs at assembly areas). CBC: 11B-505.2 CBC: 11B-505.2 Other: ADA 505.2 Repair stair nosing \$125 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 504.5 Category: 4 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Cher: ADA 505.2 Cher: ADA 505.2 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Cher: ADA 505.2 Cher: ADA 505.2 Install tread striping \$45 Notes: No tread striping provided (required for all treads on an exterior stairwa	Notes:	Running slope of path is up to 5.8% fo	r 66 linear feet (5.0% max).	
4 - 28 Walk Category: 2 Regrade surface \$1,980 Notes: Running slope of path is up to 8.1% (5.0% max) and cross slope is up to 4.6% (2.0% max) for 99 linear feet. CBC: 11B-403.3 Other: ADA 403.3 Category: 2 Install a handrail \$3,250 Notes: Two sets of 13 risers with no handrails (one central handrail required for stair runs at assembly areas). CBC: 11B-505.2 Other: ADA 505.2 CBC: 11B-505.2 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 504.5 Category: 4 for 2 Stairway Category: 4 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Cher: ADA 505.2 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Cher: ADA 505.2 \$45 Notes: No tread striping provided (required for all treads on an exterior stairway). CBC: 11B-504.4.1	CBC:	11B-403.3		
Regrade surface \$1,980 Notes: Running slope of path is up to 8.1% (5.0% max) and cross slope is up to 4.6% (2.0% max) for 99 linear feet. CBC: 11B-403.3 Other: ADA 403.3 6-1 Stairway Category: 2 Install a handrail \$3,250 Notes: Two sets of 13 risers with no handrails (one central handrail required for stair runs at assembly areas). CBC: 11B-505.2 Other: ADA 505.2 Other: ADA 505.2 Repair stair nosing \$125 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 504.5 Category: 4 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Other: ADA 505.2 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Other: ADA 505.2 \$45 Notes: No tread striping provided (required for all treads on an exterior stairway). CBC: 11B-504.4.1	Other:	ADA 403.3		
Notes: Running slope of path is up to 8.1% (5.0% max) and cross slope is up to 4.6% (2.0% max) for 99 linear feet. CBC: 11B-403.3 Other: ADA 403.3 6 - 1 Stairway Category: 2 Install a handrail \$3,250 Notes: Two sets of 13 risers with no handrails (one central handrail required for stair runs at assembly areas). CBC: 11B-505.2 Other: ADA 505.2 Other: ADA 505.2 Repair stair nosing \$125 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 504.5 Other: ADA 504.5 6 - 2 Stairway Category: 4 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Other: ADA 505.2 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Other: ADA 505.2 \$45 Notes: No tread striping \$45 Notes: No tread striping provided (required for all treads on an exterior stairway). CBC: 11B-504.4.1	4 - 28	Walk	Category: 2	
(2.0% max) for 99 linear feet. CBC: 11B-403.3 Other: ADA 403.3 6-1 Stairway Category: 2 nstall a handrail \$3,250 Notes: Two sets of 13 risers with no handrails (one central handrail required for stair runs at assembly areas). CBC: 11B-505.2 Other: ADA 505.2 Repair stair nosing \$125 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 504.5 6 - 2 Stairway Category: 4 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Install tread striping provided (required for all treads on an exterior stairway). CBC: 11B-504.4.1	Regrade	surface	\$1,	,980
Other: ADA 403.3 6 - 1 Stairway Category: 2 Install a handrail \$3,250 Notes: Two sets of 13 risers with no handrails (one central handrail required for stair runs at assembly areas). CBC: 11B-505.2 Other: ADA 505.2 Other: ADA 505.2 Repair stair nosing \$125 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 504.5 Category: 4 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Other: ADA 505.2 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Other: ADA 505.2 \$45 Notes: No tread striping provided (required for all treads on an exterior stairway). CBC: 11B-504.4.1	Notes:		.0% max) and cross slope is up to 4.6%	
6 - 1 Stairway Category: 2 Install a handrail \$3,250 Notes: Two sets of 13 risers with no handrails (one central handrail required for stair runs at assembly areas). CBC: 11B-505.2 CBC: 11B-505.2 Other: ADA 505.2 Repair stair nosing \$125 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 504.5 Other: ADA 504.5 6 - 2 Stairway Category: 4 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Other: ADA 505.2 \$45 Notes: No tread striping \$45 Notes: No tread striping provided (required for all treads on an exterior stairway). CBC: 11B-504.4.1	CBC:	11B-403.3		
nstall a handrail \$3,250 Notes: Two sets of 13 risers with no handrails (one central handrail required for stair runs at assembly areas). CBC: 11B-505.2 Other: ADA 505.2 (11B-505.2) Repair stair nosing \$125 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 504.5 (11B-504.5) Other: ADA 504.5 (128 max) CBC: 11B-504.5 (128 max) Other: ADA 504.5 (128 max) CBC: 11B-504.5 (128 max) Other: ADA 504.5 (128 max) CBC: 11B-504.5 (128 max) Other: ADA 504.5 (128 max) CBC: 11B-505.2 (128 max) Other: ADA 505.2 (128 max) Motes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). (128 max) CBC: 11B-505.2 (118 max) (128 max) Other: ADA 505.2 (128 max) (128 max) Install tread striping \$45 Notes: No tread striping provided (required for all treads on an exterior stairway). (CBC: 11B-504.4.1	Other:	ADA 403.3		
Notes: Two sets of 13 risers with no handrails (one central handrail required for stair runs at assembly areas). CBC: 11B-505.2 Other: ADA 505.2 Repair stair nosing \$125 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 504.5 Other: ADA 505.2 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Install tread striping \$45 Notes: No tread striping provided (required for all treads on an exterior stairway). CBC: 11B-504.4.1	6 - 1	Stairway	Category: 2	
assembly areas). CBC: 11B-505.2 Other: ADA 505.2 Repair stair nosing \$125 Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 504.5 6 - 2 Stairway Category: 4 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Install tread striping provided (required for all treads on an exterior stairway). CBC: 11B-504.4.1	Install a	handrail	\$3,	,250
Other: ADA 505.2Repair stair nosing\$125Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max).CBC: 11B-504.5Other: ADA 504.56 - 2StairwayCategory: 4Install a handrail\$750Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req).CBC: 11B-505.2Other: ADA 505.2Install tread striping\$45Notes: No tread striping provided (required for all treads on an exterior stairway).CBC: 11B-504.4.1	Notes:		(one central handrail required for stair ru	uns at
Repair stair nosing\$125Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max).CBC: 11B-504.5Other: ADA 504.56 - 2StairwayCategory: 4Install a handrail\$750Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req).CBC: 11B-505.2Other: ADA 505.2Install tread striping\$45Notes: No tread striping provided (required for all treads on an exterior stairway).CBC: 11B-504.4.1	CBC:	11B-505.2		
Notes: 6 risers have 1.5" nosings (nosings must be rounded with a radius of 1/2" max). CBC: 11B-504.5 Other: ADA 504.5 6 - 2 Stairway Category: 4 Install a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). CBC: 11B-505.2 Other: ADA 505.2 Other: ADA 505.2 Install tread striping \$45 Notes: No tread striping provided (required for all treads on an exterior stairway). CBC: 11B-504.4.1	Other:	ADA 505.2		
CBC: 11B-504.5 Other: ADA 504.5 6 - 2 Stairway nstall a handrail \$750 Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req). \$750 CBC: 11B-505.2 Other: ADA 505.2 Other: ADA 505.2 \$45 Notes: No tread striping provided (required for all treads on an exterior stairway). \$45 CBC: 11B-504.4.1 \$45	Repair s	tair nosing	\$	\$125
Other: ADA 504.56 - 2StairwayCategory: 4Install a handrail\$750Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req).CBC: 11B-505.2CBC: 11B-505.2Other: ADA 505.2\$45Install tread striping\$45Notes: No tread striping provided (required for all treads on an exterior stairway).\$45	Notes:	6 risers have 1.5" nosings (nosings mu	ust be rounded with a radius of 1/2" max).	•
6 - 2StairwayCategory: 4Install a handrail\$750Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req).CBC: 11B-505.2CBC: 11B-505.2Cher: ADA 505.2Other: ADA 505.2\$45Notes: No tread striping provided (required for all treads on an exterior stairway).CBC: 11B-504.4.1	CBC:	11B-504.5		
Install a handrail\$750Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req).CBC: 11B-505.2 Other: ADA 505.2Other: ADA 505.2\$45Install tread striping\$45Notes: No tread striping provided (required for all treads on an exterior stairway).CBC: 11B-504.4.1	Other:	ADA 504.5		
Notes: No handrails provided at stairs from spectator seating area to court, 3 risers (handrails on both sides req).CBC: 11B-505.2 Other: ADA 505.2Install tread striping\$45Notes: No tread striping provided (required for all treads on an exterior stairway). CBC: 11B-504.4.1	6 - 2	Stairway	Category: 4	
(handrails on both sides req).CBC: 11B-505.2Other: ADA 505.2Install tread striping\$45Notes: No tread striping provided (required for all treads on an exterior stairway).CBC: 11B-504.4.1	Install a	handrail	\$	\$750
Other: ADA 505.2 \$45 Install tread striping \$45 Notes: No tread striping provided (required for all treads on an exterior stairway). CBC: 11B-504.4.1	Notes:	•	pectator seating area to court, 3 risers	
Install tread striping\$45Notes: No tread striping provided (required for all treads on an exterior stairway).CBC: 11B-504.4.1	CBC:	11B-505.2		
Notes: No tread striping provided (required for all treads on an exterior stairway). CBC: 11B-504.4.1	Other:	ADA 505.2		
CBC: 11B-504.4.1	Install tr	ead striping		\$45
	Notes:	No tread striping provided (required fo	r all treads on an exterior stairway).	
Other: -	CBC:	11B-504.4.1		
	Other:	-		

7 - 1	Hazard	Category: 2
Install c	urb, barrier, or guardrail	\$0
Notes	No warning curb or guard provided at 26.5" dro surface (6" warning curb min).	p from spectator area to court
CBC	11B-303.5	
Other	-	
8 - 1	Door/Gate	Category: 2
Provide	or modify door kickplate	\$225
Notes	A smooth and uninterrupted kick plate surface the tennis court.	is not provided at the gate leading to
CBC	11B-404.2.10	
Other	ADA 404.2.10	
Increase	e maneuvering space	\$1,000
Notes	Clear floor space on push side of the gate has 10.9% (2% max).	a combined counter slope of up to
CBC	11B-404.2.4.1	
Other	ADA 404.2.4.2	
8 - 2	Door/Gate	Category: 2
Provide	or modify door kickplate	\$225
Notes	A smooth and uninterrupted kick plate surface the tennis court.	is not provided at the gate leading to
CBC	11B-404.2.10	
Other	ADA 404.2.10	
Raise or	lower existing hardware	\$125
Notes	Center of door hardware is 52" AFF (34" min to	o 44" max).
CBC	11B-404.2.7	
Other	ADA 404.2.7	
Increase	e maneuvering space	\$1,000
Notes	Clear floor space in the pull side of the gate ha	s a 17.7% slope (2% max).
CBC	11B-404.2.4.1	
Other	ADA 404.2.4.2	
Enlarge	door opening	\$1,650
Notes	The gate to the tennis court does not open to 9	0 degrees.
CBC	11B-404.2.3	
Other	ADA 404.2.3	

8 - 3	Door/Gate	Category: 2
	door closer	\$125
	: Door opening force is 8 lbs (5 lbs max)	•
CBC	: 11B-404.2.9	
Other	: ADA 404.2.9	
8 - 4	Door/Gate	Category: 2
Adjust o	door closer	\$125
Notes	: Door opening force is 7 lbs (5 lbs max)	
CBC	: 11B-404.2.9	
Other	:: ADA 404.2.9	
10 - 1	Drinking Fountain	Category: 3
	Drinking i buntani	Category. C
	e fountain	5
Replace	e fountain Bubbler height is 37" AFF (accessible f	\$3,000 fountain bubbler is 36" max. above floor; 3" max above floor). The water fountain was
Replace Notes	e fountain Bubbler height is 37" AFF (accessible f standing fountain bubbler 38" min to 43	\$3,000 fountain bubbler is 36" max. above floor; 3" max above floor). The water fountain was
Replace Notes CBC	e fountain Bubbler height is 37" AFF (accessible f standing fountain bubbler 38" min to 43 not operating on the day of the survey.	\$3,000 fountain bubbler is 36" max. above floor; 3" max above floor). The water fountain was
Replace Notes CBC Other	 Fountain Bubbler height is 37" AFF (accessible f standing fountain bubbler 38" min to 43 not operating on the day of the survey. 11B-602.4, 11B-602.7 	\$3,000 fountain bubbler is 36" max. above floor; 3" max above floor). The water fountain was
Replace Notes CBC Other	 Fountain Bubbler height is 37" AFF (accessible f standing fountain bubbler 38" min to 43 not operating on the day of the survey. 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 e or provide maneuvering or clear flood 	\$3,000 fountain bubbler is 36" max. above floor; 3" max above floor). The water fountain was or area \$1,000
Replace Notes CBC Other Increas Notes	 Fountain Bubbler height is 37" AFF (accessible f standing fountain bubbler 38" min to 43 not operating on the day of the survey. 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 e or provide maneuvering or clear flood 	\$3,000 fountain bubbler is 36" max. above floor; 3" max above floor). The water fountain was or area \$1,000
Replace Notes CBC Other Increas Notes CBC	 Fountain Bubbler height is 37" AFF (accessible f standing fountain bubbler 38" min to 43 not operating on the day of the survey. 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 e or provide maneuvering or clear floor Clear floor space at fountain has a 1" or 	\$3,000 fountain bubbler is 36" max. above floor; 3" max above floor). The water fountain was or area \$1,000 change in level and .75" gap (30" by 48" min)
Replace Notes CBC Other Increas Notes CBC Other	 Fountain Bubbler height is 37" AFF (accessible f standing fountain bubbler 38" min to 43 not operating on the day of the survey. 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 e or provide maneuvering or clear floot Clear floor space at fountain has a 1" of the survey. 11B-305, 11B-306, 11B-602.2 	\$3,000 fountain bubbler is 36" max. above floor; 3" max above floor). The water fountain was or area \$1,000 change in level and .75" gap (30" by 48" min)
Replace Notes CBC Other Increas Notes CBC Other	 Fountain Bubbler height is 37" AFF (accessible f standing fountain bubbler 38" min to 43 not operating on the day of the survey. 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 e or provide maneuvering or clear floot Clear floor space at fountain has a 1" of 11B-305, 11B-306, 11B-602.2 ADA 305, ADA 305.3, ADA 305.5, ADA 	\$3,000 fountain bubbler is 36" max. above floor; 3" max above floor). The water fountain was or area \$1,000 change in level and .75" gap (30" by 48" min) A 306 \$3,000
Replace Notes CBC Other Increas Notes CBC Other Install a Notes	 Fountain Bubbler height is 37" AFF (accessible f standing fountain bubbler 38" min to 43 not operating on the day of the survey. 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 Clear floor space at fountain has a 1" c Clear floor space at fountain has a 1" c 11B-305, 11B-306, 11B-602.2 ADA 305, ADA 305.3, ADA 305.5, ADA an additional high or low fountain A higher standing person fountain and 	\$3,000 fountain bubbler is 36" max. above floor; 3" max above floor). The water fountain was or area \$1,000 change in level and .75" gap (30" by 48" min) A 306 \$3,000

10 - 2	Drinking Fountain	Category: 3
Adjust tl	he water stream height or direction	\$125
Notes:	The flow of the water is 3.5" high (4" high m	nin).
CBC:	11B-602.6	
Other:	ADA 602.6	
ncrease	or provide maneuvering or clear floor ar	rea \$1,000
Notes:	Slope of clear space in front of the water for	untain is 4% (2.0% max).
CBC:	11B-305, 11B-306, 11B-602.2	
Other:	ADA 305, ADA 305.3, ADA 305.5, ADA 306	6
Replace	fountain	\$3,000
Notes:	Bubbler height is 37" AFF(accessible founta standing fountain bubbler 38" min to 43" ma	
CBC:	11B-602.4, 11B-602.7	
Other:	ADA 602.4, ADA 602.7	
10 - 3	Drinking Fountain	Category: 3
-	fountain	\$3,000
Notes:	The bubbler height is 37" AFF (accessible f standing fountain bubbler 38" min to 43" ma	
CBC:	11B-602.4, 11B-602.7	
Other:	ADA 602.4, ADA 602.7	
ncrease	or provide maneuvering or clear floor ar	rea \$1,000
Notes:	Slope of clear space in front of the water for	untain is 6.6% (2.0% max).
CBC:	11B-305, 11B-306, 11B-602.2	
Other:	ADA 305, ADA 305.3, ADA 305.5, ADA 306	6
10 - 4	Drinking Fountain	Category: 3
Provide	wing walls	\$1,000
Notes:	Drinking fountain protrudes 18" from vertica than 4" must be mounted below 27" or abo	
CBC:	11B-602.8, 11B-602.9	
Other:	ADA 307	
Replace	fountain	\$3,000
Notes:	Bubbler height is 36.5" above AFF (access floor; standing fountain bubbler 38" min to 4	
CBC:	11B-602.4, 11B-602.7	
Other [.]	ADA 602.4, ADA 602.7	

10 - 5 Drinking Fountain	Category: 3
Replace fountain	\$3,000
Notes: Bubbler height is 37.5" AFF (accessible standing fountain bubbler 38" min to 43	
CBC: 11B-602.4, 11B-602.7	
Other: ADA 602.4, ADA 602.7	
Provide an accessible path of travel	\$40
Notes: The drinking fountain is not oriented to	wards the path of travel.
CBC: 11B-206.2	
Other: ADA 206.2	
11 - 1 Telephone	Category: 3
Provide TTY shelf and outlet	\$1,800
Notes: TTY is not provided on the public phon	е.
CBC: 11B-704.5	
Other: ADA 704.5	
Provide clear floor space	\$1,000
Notes: Clear floor space of the public phone h	as a slope of 4.3% (2% max).
CBC: 11B-704.2.1	
Other: ADA 305.3, ADA 704.2.1	
Reposition phone equipment	\$500
Notes: Coin slot is 50" AFF (48" max).	
CBC: 11B-308.3	
Other: ADA 308.3, ADA 308.3.1, ADA 308.3.2	

19 - 1 Multiple User Restroom	Category: 2
Install restroom sign	\$500
Notes: No state or federal required signs provide	ed.
CBC: 11B-216.8, 11B-703.7.2.6	
Other: ADA 703	
Provide or replace compartment door hardware	e \$175
Notes: Compartment door does not have handle (Compartment door must have U-shaped door and be self-closing).	•
CBC: 11B-604.8.1.2	
Other: ADA 604.8.1.2	
Reposition clothing hooks	\$125
Notes: Height of coat hook is 67.5" (48" max).	
CBC: 11B-603.4	
Other: ADA 308	
Modify stall partitions	\$500
Notes: The water closet compartment is 40.5" w	<i>r</i> ide (60" min).
CBC: 11B-604.8.1.1	
Other: ADA 604.3.1	
Reposition toilet flush controls	\$750
Notes: Urinal flush controls are 45" AFF (44" ma the water closet (flush control located or	,
CBC: 11B-604.6, 11B-605.4	
Other: ADA 604.6	
Replace or reposition dispenser	\$125
Notes: Centerline of the toilet paper is located 1 max).	5" in front of the water closer (7" min to 9"
CBC: 11B-604.7	
Other: ADA 604.7	
Replace or modify grab bars	\$300
Notes: Side grab bar extends 53" from the rear	wall (54" min).
CBC: 11B-604.5.1	
Other: ADA 604.5.1	
Provide an accessible lavatory	\$3,000
Notes: Centerline of the lavatory is 14" from side	e wall (18" min).
CBC: 11B-606.6	
Other: -	

19 - 1 Multiple User Restroom	Category: 2
Provide an accessible path of travel	\$0
Notes: Entrance to the restroom is 35" wide (36" n	nin).
CBC: 11B-206.2	
Other: ADA 206.2	

Memorial Park

19 - 2	Multiple User Restroom	Category: 2
Install r	estroom sign	\$500
Notes	: No state or federal required signs provided	
CBC	: 11B-216.8, 11B-703.7.2.6	
Othe	:: ADA 703	
Provide	or replace compartment door hardware	\$175
Notes	: Compartment door does not have handle or closing (compartment door must have U-sh the door and be self-closing).	
CBC	: 11B-604.8.1.2	
Othe	: ADA 604.8.1.2	
Modify	stall partitions	\$500
Notes	: The water closet compartment is side oper	ning and is 37.5" wide (60" min).
	: 11B-604.8.1.1	
Othe	: ADA 604.3.1	
Replace	e or reposition dispenser	\$125
Notes	The toilet paper is located behind the wate to 9" max in front of the water closet). Toile AFF(40" max).	· · · · · · · · · · · · · · · · · · ·
CBC	: 11B-603.5, 11B-604.7	
Othe	:: ADA 604.7	
Replace	e or modify grab bars	\$600
Notes	: Side grab bar extends 52" from the rear war provided. The toilet paper and toilet seat co (12" min clear space above grab bar).	
CBC	: 11B-604.5.1, 11B-604.5.2, 11B-609.3	
Othe	: ADA 604.5.1, ADA 604.5.2, ADA 609.3	
Provide	an accessible lavatory	\$3,000
Notes	: Center line of the lavatory is 16" from side	wall (18" min).
CBC	: 11B-606.6	
Othe	1 -	
	tion clothing hooks	\$125
Reposit		
	: Height of coat hook is 48.5" (48" max).	
Notes		

19 - 2	Multiple User Restroom	Category: 2
Replac	e or reposition fixtures	\$1,250
Notes	s: Centerline of the water closet is 19.5" f	from side wall. (17"min to18" max).
CBC	C: 11B-604.2	
Othe	r: ADA 604.2	
Replac	e urinal	\$3,000
Notes	s: Height of the urinal rim is 23" AFF (17"	max).
CBC	C: 11B-605.2	
Othe	r: ADA 605.2	
Reposi	tion toilet flush controls	\$750
Notes	s: Urinal flush controls is 49" AFF (48" ma the water closet (flush control on the o	ax). Flush control is centered on the back of pen side of the fixture).
CBC	C: 11B-604.6, 11B-605.4	
Othe	r: ADA 604.6	
Provide	e an accessible path of travel	\$0
Notes	s: Entrance to the restroom is 35.5" wide	(36" min).
CBC	C: 11B-206.2	
	r: ADA 206.2	

19 - 3Multiple User RestroomCa	ategory: 2
Provide or replace compartment door hardware	\$175
Notes: Water closet compartment is not self-closing.	
CBC: 11B-604.8.1.2	
Other: ADA 604.8.1.2	
Modify stall partitions	\$500
Notes: Water closet compartment is 59.75" wide (60" min).	
CBC: 11B-604.8.1.1	
Other: ADA 604.3.1	
Reposition toilet flush controls	\$750
Notes: Flush control is centered behind the water closet (flush control fixture).	ontrol on the open side of
CBC: 11B-604.6	
Other: ADA 604.6	
Replace or reposition dispenser	\$125
Notes: Centerline of the toilet paper is located 11" in front of the max). Seat cover dispenser is located at 40.5" AFF (40" n	
CBC: 11B-603.5, 11B-604.7	
Other: ADA 604.7	
Replace or modify grab bars	\$300
Notes: Side grab bar extends 53.75" from the rear wall (54" min)	
CBC: 11B-604.5.1	
Other: ADA 604.5.1	
Replace or reposition fixtures	\$1,250
Notes: Centerline of water closet is 18.5" from side wall (17" min	to 18" max).
CBC: 11B-604.2	
Other: ADA 604.2	

19 - 4 Multiple User Restroom	Category: 2
Provide or replace compartment door hardwa	r e \$175
Notes: Water closet compartment door is not s closing).	elf-closing (compartment door must be self-
CBC: 11B-604.8.1.2	
Other: ADA 604.8.1.2	
Reposition toilet flush controls	\$750
Notes: Flush control is centered behind the war of the fixture).	ter closet (control located on the open side
CBC: 11B-604.6	
Other: ADA 604.6	
Modify lavatory or counter clearances	\$1,500
Notes: Height of the lavatory rim is 34 5/8" AFF	⁻ (34" max).
CBC: 11B-606.3	
Other: ADA 606.3	
Replace or reposition dispenser	\$250
	ehind to water closet, no clear floor space toilet paper is located 12" in front the water the soap dispenser is 44" AFF (40" max).
CBC: 11B-603.5	
Other: -	
Replace or reposition fixtures	\$1,250
Notes: Centerline of water closet is 18.5" from	side wall (17" min to 18" max).
CBC: 11B-604.2	
Other: ADA 604.2	
27 - 1 Assembly Area	Category: 2
	\$0
Provide accessible seating	ΨŪ
Provide accessible seating Notes: Accessible seating is not integrated into	

00 4		Cata nom v 2
	Game and Sports Area	Category: 2
	on controls and outlets	\$200
	Light switch at the tennis court is located 66" AFF (15'	' min to 48" max).
	11B-308.2	
	ADA 308.2, ADA 308.2.1	
	an accessible path of travel	\$0
	The route to the seating area has a marked 1/2" change concrete joints (1/4" max vertical change and 1/2" max slope at the first 5 linear feet of the route to the seating	x opening). There is a 7.6%
CBC:	11B-206.2.2	
Other:	ADA 206.2.2	
Provide	wheelchair seating	\$0
Notes:	There are no accessible seats in the spectator seating	area.
CBC:	11B-221.2.1.1	
Other:	ADA 221.2.1.1	
29 - 2	Game and Sports Area	Category: 2
Modify w	heelchair seating	\$0
Notes:	There is no integrated accessible seating area in the b	bleachers.
CBC:	11B-221.2.2	
Other:	ADA 221.2.2	
Enlarge	door opening	\$300
Notes:	Clear width of the door opening to the dugout area is 2 min).	23.5" at two entrances (32"
CBC:	11B-404.2.3	
Other:	ADA 404.2.3	
Provide a	an accessible path of travel	\$0
Notes:	An accessible route to spectator seating is not provide not striped and do not have a handrail.	ed due to 10 risers. Risers are
CBC:	11B-206.2.2	

Memorial Park

32 - 1 Picnic Area	Category: 2
Provide an accessible path of travel	\$400
Notes: An accessible route to 9 picnic table from concrete path to sand surface	es is not provided. There is a 2" change in level (1/4" max_up to 1/2" with a bevel)
CBC: 11B-403	
Other: AGODA F245.4	
Provide an accessible table	\$0
Notes: Toe clearance at 9" above the group	nd extends 10.5" under the table (17" min).
CBC: 11B-306.2	
Other: -	
Provide an accessible picnic unit	\$6,400
Notes: An accessible table is not provided	in a picnic area with 9 tables. (2 required).
CBC: 11B-246.5	
Other: -	
Replace or reposition picnic grill	\$750
Notes: No accessible grill provided. The gr 34" max). Prep counter is 35" AFF (ill operating mechanism is 37" AFF (15" min to (34" max).
CBC: -	
Other: AGODA 1011.5.2	
32 - 2 Picnic Area	Category: 2
Provide an accessible picnic unit	\$6,400
Notes: An accessible table is not provided	in a picnic area with 2 tables. (2 required).
CBC: 11B-246.5	
Other: -	
Replace or reposition picnic grill	\$750
Notes: Grill operating mechanism is located	d 35" AFF (15" min to 34" max).
CBC: -	
Other: $AGODA 1011 5 2$	

Other: AGODA 1011.5.2


32 - 3	Picnic Area	Category: 2
Provide	an accessible path of travel	\$400
Notes:	Accessible route to picnic area is not provided. 2" char route to the picnic area (1/4" max, up to 1/2" with a be	
CBC:	11B-403	
Other:	AGODA F245.4	
Increase	or provide clear floor area	\$700
	There is a 1" change in level from the clear floor space surface.	e beside the picnic table to
CBC:		
Other:	AGODA 1011.2.1	
32 - 4	Picnic Area	Category: 2
Provide	an accessible path of travel	\$400
	Accessible route to the picnic area is not provided. The from concrete route to the picnic area (1/4" max, up to 11B-403	u
	AGODA F245.4	
	or provide clear floor area	\$700
Notes:	1" change in level from the clear floor space beside th (36" min clear floor space around the usable portions	e picnic table and the surface
CBC:		
Other:	AGODA 1011.2.1	
Regrade		\$1,200
	Slope of the clear floor space around the picnic table i the clear floor space at the grill is 7.8% (2% max).	s 12.1% (2.0% max). Slope at
	11B-305	
	AGODA 1011.2.3	
32 - 5	Picnic Area	Category: 2
-	an accessible path of travel	\$40
Notes:	Accessible route to the picnic area is not provided. The from asphalt route to the picnic area (1/4" max, up to 2	-
CBC:	11B-403	
Other:	AGODA F245.4	
Increase	or provide clear floor area	\$700
Notes:	3" change in level from the clear floor space adjacent (36" min clear floor space around the usable portions	
CBC:	-	
Other:	AGODA 1011.2.1	

33 - 1 Outdoor Constructed Features	Category: 2
Provide an accessible path of travel	\$1,000
Notes: An accessible route to the fixed bench is no	t provided. Route is 50 linear feet over
natural surface.	
Other: AGODA 1011.2.1	¢700
Increase or provide clear floor area	\$700
Notes: A clear floor space is not provided adjacent	to the bench (36° by 48° min).
CBC: - Other: AGODA 1011.2.1	
	Cotogon // 2
33 - 2 Outdoor Constructed Features	Category: 3
Provide an accessible path of travel	\$120
Notes: An accessible route to the fixed trash/recycl 65" to container.	ing container is not provided. Route is
CBC: -	
Other: AGODA 1011.2.1	
33 - 3 Outdoor Constructed Features	Category: 2
Provide an accessible path of travel	\$420
Notes: Path of travel to monument is not provided.	Route is 21 linear feet over grass.
CBC: -	
Other: AGODA 1011.2.1	
33 - 4 Outdoor Constructed Features	Category: 2
Provide an accessible path of travel	\$0
Notes: An accessible route to the pergola is not pro .75" nosings on each side of the pergola. No	
CBC: -	
Other: AGODA 1011.2.1	
35 - 1 Other	Category: 3
Reposition controls	\$200
Notes: Mutt Mitt is 30" off the path of travel at 35" located between 10" to 24" off path of travel	
CBC: 11B-308.3	
Other: ADA 308.3, ADA 308.3.1, ADA 308.3.2	


35 - 2	Other	Category: 3	
	on controls		\$200
Notes:	Mutt Mitt is 14.5" off the path of travel at 50 24" off path of travel).	" AFF (46" max when between	•
	11B-308.3		
Other:	ADA 308.3, ADA 308.3.1, ADA 308.3.2		
35 - 3	Other	Category: 3	
Repositi	on controls		\$200
Notes:	Mutt Mitt is located 61" AFF (15" min to 48"	max).	
CBC:	11B-308.3		
Other:	ADA 308.3, ADA 308.3.1, ADA 308.3.2		
35 - 4	Other	Category: 3	
Repositi	on controls		\$200
Notes:	Mutt Mitt is 20" off the path of travel at 38.5" off path of travel).	AFF (46" max when between	10" to 24"
CBC:	11B-308.3		
Other:	ADA 308.3, ADA 308.3.1, ADA 308.3.2		
Provide	an accessible path of travel		\$0
Notes:	2" change in level between asphalt and natubevel).	Iral surface (.25" max; .5" max	with
CBC:	11B-206.2		
Other:	ADA 206.2		
35 - 5	Other	Category: 3	
Repositi	on controls		\$200
-	Mutt Mitt is 33" off the path of travel at 50" A off path of travel).	FF (46" max when between 10)" to 24"
CBC:	11B-308.3		
Other:	ADA 308.3, ADA 308.3.1, ADA 308.3.2		
43 - 1	Play Equipment Area	Category: 2	
Regrade	or replace ramp		\$2,460
Notes:	Broken concrete at ramp leading to the play	area.	
	11B-1008.2.5.1		
	ADA 1008.2.5.1		
Provide	play components		\$5,000
	There are five elevated play components an components min of different types).	d one ground component (2	+ - ,
CBC:	11B-240.2.1.2		
	ADA 240.2.1.2		
12/19/20	14 Memorial Par	1.	
17/19/20	IA Memorial Par	ĸ	Page 22

43 - 2 Play Equipment Area	Category: 2
Provide an accessible path of travel	\$240
Notes: An accessible route to the play equip change in level to play surface and 4 to 1/2" with a bevel).	oment area is not provided. There is a 2" 4.5" change is level to the bridge (1/4" max, up
CBC: 11B-206.2.17	
Other: ADA 206.2.17	
43 - 3 Play Equipment Area	Category: 2
Provide an accessible path of travel	\$240
Notes: An accessible route to the swings ar to play surface in swing area (1/4" r	ea is not provided. There is a 2" change in level nax, up to 1/2" with a bevel).
CBC: 11B-206.2.17	
Other: ADA 206.2.17	

Monta Vista Park 22601 Voss Avenue Cupertino, CA N

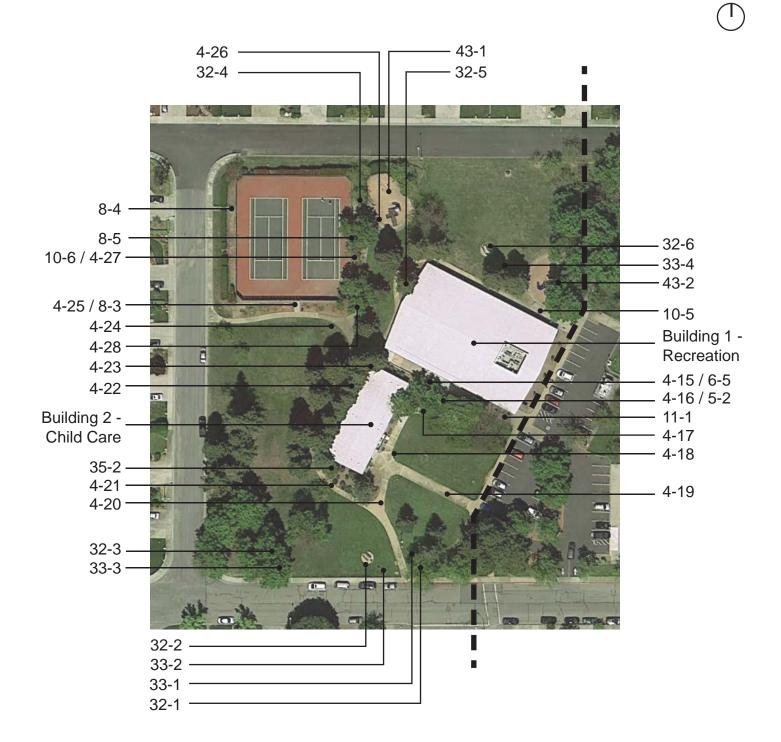

Monta Vista Park 22601 Voss Avenue Cupertino, CA

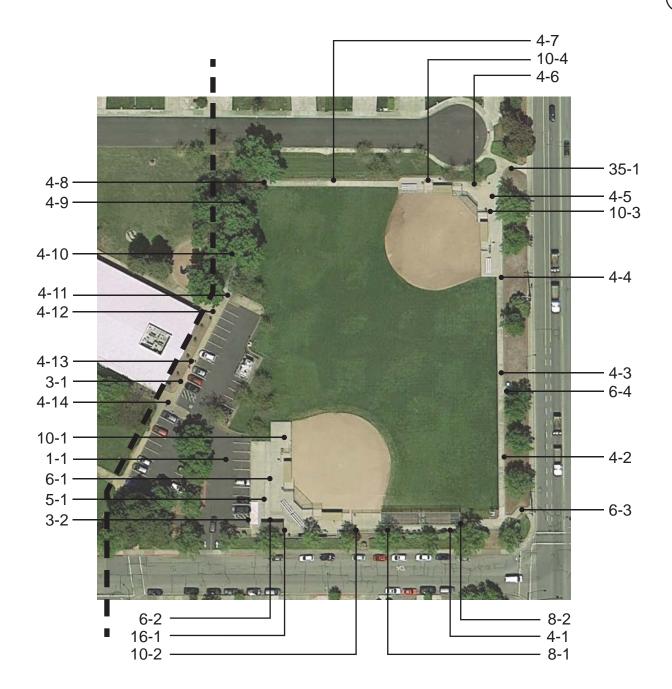

1 - 1 Parking Area	Category: 1
Regrade accessible parking space or access	aisle \$3,200
Notes: Parking space and access aisle near ba	· · ·
space and access aisle near community	center have a slope of up to 3% (2% max).
CBC: 11B-502.4	
Other: ADA 502.4	
Provide or modify accessible spaces	\$0
Notes: Accessible van parking is not provided.	
CBC: 1011, 11B-208.2	
Other: ADA 208.2.4	
Install reserved parking sign	\$375
Notes: No tow-away warning sign provided at s	treet entry or at accessible parking space.
CBC: 11B-502.8	
Other: -	
Install van accessible sign	\$375
Notes: A "Van Accessible" sign is not provided	
posted at stalls striped and designated	to be van accessible.
CBC: 11B-502.6	
Other: ADA 208.2.4	
3 - 1 Curb Ramp	Category: 1
	Category: 1 \$0
3 - 1 Curb Ramp	
3 - 1 Curb Ramp Provide detectable warnings	
3 - 1 Curb Ramp Provide detectable warnings Notes: Detectable warnings not provided.	
3 - 1Curb RampProvide detectable warningsNotes: Detectable warnings not provided.CBC: 11B-247.1.2, 11B-406.5.12Other: -	
3 - 1Curb RampProvide detectable warningsNotes: Detectable warnings not provided.CBC: 11B-247.1.2, 11B-406.5.12Other: -	\$0
3 - 1Curb RampProvide detectable warningsNotes: Detectable warnings not provided.CBC: 11B-247.1.2, 11B-406.5.12Other: -Provide surface texture	\$0
3 - 1 Curb Ramp Provide detectable warnings Notes: Detectable warnings not provided. CBC: 11B-247.1.2, 11B-406.5.12 Other: - Provide surface texture Notes: No grooved border provided.	\$0
3 - 1Curb RampProvide detectable warningsNotes: Detectable warnings not provided.CBC: 11B-247.1.2, 11B-406.5.12Other: -Provide surface textureNotes: No grooved border provided.CBC: 11B-406.5.11Other: -	\$0
3 - 1Curb RampProvide detectable warningsNotes: Detectable warnings not provided.CBC: 11B-247.1.2, 11B-406.5.12Other: -Provide surface textureNotes: No grooved border provided.CBC: 11B-406.5.11	\$0 \$0 \$0 \$90
3 - 1Curb RampProvide detectable warningsNotes: Detectable warnings not provided.CBC: 11B-247.1.2, 11B-406.5.12Other: -Provide surface textureNotes: No grooved border provided.CBC: 11B-406.5.11Other: -Provide a level landing	\$0 \$0 \$0 \$90
3 - 1 Curb Ramp Provide detectable warnings Notes: Detectable warnings not provided. CBC: 11B-247.1.2, 11B-406.5.12 Other: - Provide surface texture Notes: No grooved border provided. CBC: 11B-406.5.11 Other: - Provide a level landing Notes: Landing at the top of the curb ramp has	\$0 \$0 \$0 \$90
 3 - 1 Curb Ramp Provide detectable warnings Notes: Detectable warnings not provided. CBC: 11B-247.1.2, 11B-406.5.12 Other: - Provide surface texture Notes: No grooved border provided. CBC: 11B-406.5.11 Other: - Provide a level landing Notes: Landing at the top of the curb ramp has CBC: 11B-406.5.3 Other: ADA 406.4, ADA 406.7 	\$0 \$0 \$0 \$90
 3 - 1 Curb Ramp Provide detectable warnings Notes: Detectable warnings not provided. CBC: 11B-247.1.2, 11B-406.5.12 Other: - Provide surface texture Notes: No grooved border provided. CBC: 11B-406.5.11 Other: - Provide a level landing Notes: Landing at the top of the curb ramp has CBC: 11B-406.5.3 	\$0 \$0 \$0 a slope of 2.9% (2% max). \$2,460
 3 - 1 Curb Ramp Provide detectable warnings Notes: Detectable warnings not provided. CBC: 11B-247.1.2, 11B-406.5.12 Other: - Provide surface texture Notes: No grooved border provided. CBC: 11B-406.5.11 Other: - Provide a level landing Notes: Landing at the top of the curb ramp has CBC: 11B-406.5.3 Other: ADA 406.4, ADA 406.7 Install, replace or modify curb ramp 	\$0 \$0 \$0 a slope of 2.9% (2% max). \$2,460

3 - 2 Curb Ramp	Category: 1	
Provide a level landing		\$90
Notes: Top landing at blended transition has a s	lope of 2.5% (2% max).	
CBC: 11B-406.5.3		
Other: ADA 406.4, ADA 406.7		
4 - 1 Walk	Category: 2	
Regrade surface		\$4,760
Notes: Cross slope of concrete path is up to 3.89	% for 119 linear feet (2.0% max).	
CBC: 11B-403.3		
Other: ADA 403.3		
4 - 2 Walk	Category: 2	
Regrade surface		\$4,320
Notes: Cross slope of concrete path is up to 2.9	% for 108 linear feet (2.0% max).	
CBC: 11B-403.3		
Other: ADA 403.3		
4 - 3 Walk	Category: 2	
Regrade surface		\$480
Notes: Cross slope of concrete path is up to 2.89	% for 12 linear feet (2.0% max).	
CBC: 11B-403.3		
Other: ADA 403.3		
4 - 4 Walk	Category: 2	
Grind or patch vertical change of grade		\$250
Notes: 5/8" change in level at concrete joint (1/4	" max, up to 1/2" with a bevel).	
CBC: 11B-303.2		
Other: ADA 303.2, ADA 303.3		
4 - 5 Walk	Category: 1	
Regrade surface		\$2,520
Notes: Cross slope of concrete path is up to 3.3	% for 63 linear feet (2.0% max).	
CBC: 11B-403.3		
Other: ADA 403.3		
Repair surface		\$250
Notes: .75 inch wide gap at expansion joint (.5 ir	nch max).	
CBC: 11B-302.3		
Other: ADA 302.3		

4 - 6 Walk Category: 1 Regrade surface Category: 1	
Regrade surface	
0	\$1,400
Notes: Cross slope of concrete path is up to 2.4% for 35 linear feet (2.0% m	iax).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 7 Walk Category: 2	
Regrade surface	\$6,280
Notes: Cross slope of concrete path is up to 4% for 157 linear feet and up to 10 linear feet (2.0% max).	5% in the last
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 8WalkCategory: 2	
Grind or patch vertical change of grade	\$250
Notes: 1" change in level at concrete joint (1/4" max, up to 1/2" with a bevel)).
CBC: 11B-303.2	
Other: ADA 303.2, ADA 303.3	
4 - 9WalkCategory: 1	
Regrade surface	\$3,600
Notes: Cross slope of concrete path is up to 2.4% for 90 linear feet (2.0% m	lax).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 10 Walk Category: 2	
Regrade surface	\$3,840
Notes: Running slope of concrete path is up to 7% for 96 linear feet (5.0% n	nax).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 11 Walk Category: 2	
Regrade surface	\$1,200
Notes: Cross slope of concrete path is up to 4% for 30 linear feet (2.0% max	x).
CBC: 11B-403.3	
Other: ADA 403.3	

4 - 12	Walk	Category: 2
Regrade	surface	\$3,680
Notes:	Cross slope of concrete path is up to	o 7% for 368 square feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
Grind or	patch vertical change of grade	\$250
Notes:	3/4" wide and 1" deep change in leve with a bevel).	el at cracked pavement (1/4" max, up to 1/2"
CBC:	11B-303.2	
Other:	ADA 303.2, ADA 303.3	
4 - 13	Walk	Category: 2
Regrade	surface	\$2,720
Notes:	Cross slope of concrete path is up to	2.4% for 68 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
Widen w	alk	\$900
Notes:	No wheel stops are provided a the p	arking spaces, 9 spaces. Width of walk is
	reduced to 42" when a car is parked	(48" min).
CBC:	reduced to 42" when a car is parked 11B-403.5.1.3	(48" min).
	•••••••••••••••••••••••••••••••••••••••	(48" min).
	11B-403.5.1.3 ADA 403.5.1	(48" min). Category: 1
Other: 4 - 14	11B-403.5.1.3 ADA 403.5.1	
Other: 4 - 14 Regrade	11B-403.5.1.3 ADA 403.5.1 Walk surface	Category: 1
Other: 4 - 14 Regrade Notes:	11B-403.5.1.3 ADA 403.5.1 Walk surface Running slope of concrete path is up	Category: 1 \$4,640
Other: 4 - 14 Regrade Notes: CBC:	11B-403.5.1.3 ADA 403.5.1 Walk surface Running slope of concrete path is up 3% (2.0% max) for 464 square feet.	Category: 1 \$4,640
Other: 4 - 14 Regrade Notes: CBC:	11B-403.5.1.3 ADA 403.5.1 Walk surface Running slope of concrete path is up 3% (2.0% max) for 464 square feet. 11B-403.3 ADA 403.3	Category: 1 \$4,640
Other: 4 - 14 Regrade Notes: CBC: Other: 4 - 15	11B-403.5.1.3 ADA 403.5.1 Walk surface Running slope of concrete path is up 3% (2.0% max) for 464 square feet. 11B-403.3 ADA 403.3	Category: 1 \$4,640 to 12% (5.0% max) and cross slope is up to
Other: 4 - 14 Regrade Notes: CBC: Other: 4 - 15 Regrade	11B-403.5.1.3 ADA 403.5.1 Walk surface Running slope of concrete path is up 3% (2.0% max) for 464 square feet. 11B-403.3 ADA 403.3 Walk surface	Category: 1 \$4,640 to 12% (5.0% max) and cross slope is up to Category: 1
Other: 4 - 14 Regrade Notes: CBC: Other: 4 - 15 Regrade Notes:	11B-403.5.1.3 ADA 403.5.1 Walk surface Running slope of concrete path is up 3% (2.0% max) for 464 square feet. 11B-403.3 ADA 403.3 Walk surface Cross slope of concrete path is betw	Category: 1 \$4,640 to 12% (5.0% max) and cross slope is up to Category: 1 \$6,400
Other: 4 - 14 Regrade Notes: CBC: 0ther: 4 - 15 Regrade Notes: CBC:	11B-403.5.1.3 ADA 403.5.1 Walk surface Running slope of concrete path is up 3% (2.0% max) for 464 square feet. 11B-403.3 ADA 403.3 Walk surface Cross slope of concrete path is betw max).	Category: 1 \$4,640 to 12% (5.0% max) and cross slope is up to Category: 1 \$6,400
Other: 4 - 14 Regrade Notes: CBC: 0ther: 4 - 15 Regrade Notes: CBC:	11B-403.5.1.3 ADA 403.5.1 Walk surface Running slope of concrete path is up 3% (2.0% max) for 464 square feet. 11B-403.3 ADA 403.3 Walk surface Cross slope of concrete path is betw max). 11B-403.3	Category: 1 \$4,640 to 12% (5.0% max) and cross slope is up to Category: 1 \$6,400
Other: 4 - 14 Regrade Notes: CBC: Other: 4 - 15 Regrade Notes: CBC: CBC: Other: 4 - 16	11B-403.5.1.3 ADA 403.5.1 Walk surface Running slope of concrete path is up 3% (2.0% max) for 464 square feet. 11B-403.3 ADA 403.3 Walk surface Cross slope of concrete path is betw max). 11B-403.3 ADA 403.3	Category: 1 \$4,640 to to 12% (5.0% max) and cross slope is up to Category: 1 \$6,400 veen 2.1% to 5.2% for 640 square feet (2.0%
Other: 4 - 14 Regrade Notes: CBC: Other: 4 - 15 Regrade Notes: CBC: Other: 4 - 16 Regrade	11B-403.5.1.3 ADA 403.5.1 Walk surface Running slope of concrete path is up 3% (2.0% max) for 464 square feet. 11B-403.3 ADA 403.3 Walk surface Cross slope of concrete path is betw max). 11B-403.3 ADA 403.3 Walk	Category: 1 \$4,640 o to 12% (5.0% max) and cross slope is up to Category: 1 \$6,400 veen 2.1% to 5.2% for 640 square feet (2.0% Category: 1 \$480
Other: 4 - 14 Regrade Notes: CBC: Other: 4 - 15 Regrade Notes: CBC: Other: 4 - 16 Regrade Notes:	11B-403.5.1.3 ADA 403.5.1 Walk surface Running slope of concrete path is up 3% (2.0% max) for 464 square feet. 11B-403.3 ADA 403.3 Walk surface Cross slope of concrete path is betw max). 11B-403.3 ADA 403.3 Walk surface	Category: 1 \$4,640 o to 12% (5.0% max) and cross slope is up to Category: 1 \$6,400 veen 2.1% to 5.2% for 640 square feet (2.0% Category: 1 \$480

4 - 17	Walk	Category: 2	
Regrade	surface		\$800
Notes:	Running slope of concrete path is	s between 5.3% to 8% for 20 linear feet (5.	0% max
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 18	Walk	Category: 2	
Regrade	surface		\$600
Notes:	Cross slope of concrete path is b	etween 4.2% to 6% for 15 linear feet (2.0%	6 max).
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 19	Walk	Category: 1	
Regrade	surface		\$1,600
Notes:	Cross slope of concrete path is u	p to 4.2% for 40 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 20	Walk	Category: 1	
Regrade	surface		\$880
Notes:	Running slope of concrete path is	s up to 7.5% for 22 linear feet (5.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 21	Walk	Category: 2	
Regrade	surface		\$480
Notes:	Cross slope of concrete path is u	p to 4% for 12 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
Grind or	patch vertical change of grade		\$250
		oint across walk (1/4" max, up to 1/2" with	a bevel).
CBC:	11B-303.2		
Other:	ADA 303.2, ADA 303.3		
4 - 22	Walk	Category: 2	
Regrade	surface		\$3,480
Notes:	Cross slope of concrete path is u	p to 4.2% for 87 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		

4 - 23	Walk	Category: 2	
Regrade	surface		\$480
Notes:	Running slope of concrete path is up	to 7.6% for 12 linear feet (5.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
Grind or	patch vertical change of grade		\$250
Notes:	1" change in level at concrete joint ad	cross walk (1/4" max, up to 1/2" with a	bevel).
CBC:	11B-303.2		
Other:	ADA 303.2, ADA 303.3		
4 - 24	Walk	Category: 1	
Regrade	surface		\$3,920
Notes:	Cross slope of concrete path is up to	4.6% for 98 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 25	Walk	Category: 2	
Regrade	surface		\$400
Notes:	Running slope of concrete path is up	to 11.5% for 10 linear feet (2.0% max).
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 26	Walk	Category: 2	
Grind or	patch vertical change of grade		\$250
Notes:	2.25" change in level at concrete join	t (1/4" max, up to 1/2" with a bevel).	
CBC:	11B-303.2		
Other:	ADA 303.2, ADA 303.3		
4 - 27	Walk	Category: 2	
Regrade	surface		\$1,360
Notes:	Cross slope of concrete path is up to	4.8% for 34 linear feet (2.0% max).	
	11B-403.3		
Other:	ADA 403.3		
Grind or	patch vertical change of grade		\$250
	3/4" change in level at concrete joint	(1/4" max, up to 1/2" with a bevel).	
	11B-303.2		
	ADA 303.2, ADA 303.3		

4 - 28	Walk	Category: 2	
	surface	\$1,40	00
	Cross slope of concrete path is up to 7		
	11B-403.3	······	
	ADA 403.3		
Grind or	patch vertical change of grade	\$25	50
Notes:	1" change in level at concrete joint acro	oss walk (1/4" max, up to 1/2" with a bevel)).
CBC:	11B-303.2		
Other:	ADA 303.2, ADA 303.3		
5 - 1	Ramp	Category: 1	
nstall a	handrail	\$3,75	50
Notes:	Handrails are not provided on one side continuous gripping surfaces are provided on the provided of the provi	of the ramp for 30 linear feet (handrails wind the sides of ramp).	ith
CBC:	11B-505.2		
Other:	ADA 405.8		_
Raise or	lower existing handrail	\$50	00
Notes:	Handrail top surface is mounted 41.5" t 38" max).	to 47.5" above the ramp surface (34" min t	0
CBC:	11B-505.4		
Other:	ADA 505.4		
5 - 2	Ramp	Category: 2	
nstall a	handrail	\$2,50	00
Notes:	Handrails are not provided on either sid gripping surfaces are provided on both	de of the ramp (handrails with continuous sides of ramp).	
CBC:	11B-505.2		
Other:	ADA 405.8		_
6 - 1	Stairway	Category: 1	
nstall a	handrail	\$75	50
Notes:	Handrails are not provided on either sid req).	de of a single step (handrails on both sides	;
CBC:	11B-505.2		
Other:	ADA 505.2		

6 - 2 Stairway	Category: 2
Install a handrail	\$1,250
Notes: Handrails are not provided on either side	of the stairway (handrails on both sides
req).	
CBC: 11B-505.2	
Other: ADA 505.2	
Install tread striping	\$45
Notes: No tread striping provided on three risers	3.
CBC: 11B-504.4.1	
Other: -	
Replace stairs	\$300
Notes: There is a 3/4" gap at the top riser (solid	risers).
CBC: 11B-504.3	
Other: ADA 504.3	
6 - 3 Stairway	Category: 1
Install a handrail	\$1,250
Notes: Handrails are not provided on either side	of the stairway (handrails on both sides
req).	
CBC: 11B-505.2	
Other: ADA 505.2	
Install tread striping	\$45
Notes: No tread striping provided on 3 risers.	
CBC: 11B-504.4.1	
Other: -	
6 - 4 Stairway	Category: 1
Install a handrail	\$1,250
Notes: Handrails are not provided on either side	of the stairway (handrails on both sides
req).	
CBC: 11B-505.2	
Other: ADA 505.2	
Install tread striping	\$45
Notes: No tread striping provided on 3 risers.	
CBC: 11B-504.4.1	
Other: -	

6 - 5	Stairway	Category: 2
Install a	handrail	\$1,250
Notes	Handrails are not provided on either sid req).	le of the stairway (handrails on both sides
CBC	11B-505.2	
	ADA 505.2	
Install tr	ead striping	\$45
Notes	No tread striping provided.	
CBC	11B-504.4.1	
Other	-	
Replace	stairs	\$300
Notes	Tread height ranges from 6" on three ris req). Slope of the treads is 12% (2.0%)	sers and 5" on one riser (uniform heights max).
CBC	11B-504.2	
Other	ADA 504.2	
8 - 1	Door/Gate	Category: 2
Provide	or modify door kickplate	\$225
Notes	A smooth and uninterrupted kick plate s	surface is not provided.
CBC	11B-404.2.10	
Other	ADA 404.2.10	
	lower existing hardware	\$125
Notes	Center of door hardware is 50" AFF (34	" min to 44" max).
	11B-404.2.7	
Other	ADA 404.2.7	
	or modify door threshold	\$125
Notes	1.5" change in level at threshold betwee 1/2" with a bevel).	en concrete and dirt surface (1/4" max, up to
CBC	11B-404.2.5	
Other	ADA 404.2.5	

8 - 2 Door/Gate	Category: 2
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate s	· · · · · · · · · · · · · · · · · · ·
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Replace or modify door threshold	\$125
Notes: 1/2" change in level at the threshold betw up to 1/2" with a bevel).	
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
8 - 3 Door/Gate	Category: 2
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate s	urface is not provided.
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Regrade surface	\$2,500
Notes: Slope on the push side of the door is 10	.5% (2.0% max).
CBC: 11B-404.2.4.4	
Other: ADA 404.2.4.4	
8 - 4 Door/Gate	Category: 4
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate s	urface is not provided.
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Replace or modify door threshold	\$125
Notes: Threshold has a vertical change of 1/2"	(1/4" max, up to 1/2" with a bevel).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
Locked or Alarmed Door - Not Surveyed	\$0
Notes: Locked gate.	
CBC: -	
Other: -	

8 - 5 Door/Gate	Category: 2
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate su	
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Enlarge door opening	\$1,650
Notes: Width of clear opening is 31" (32" min).	
CBC: 11B-404.2.3	
Other: ADA 404.2.3	
10 - 1 Drinking Fountain	Category: 3
Replace fountain	\$3,000
Notes: The bubbler height is 37.25" AFF (access floor; standing fountain 38"min to 43" max	
CBC: 11B-602.4, 11B-602.7	
Other: ADA 602.4, ADA 602.7	
ncrease or provide maneuvering or clear floor a	area \$1,000
Notes: Slope of clear space in front of the water	fountain is 2.9% (2.0% max).
CBC: 11B-305, 11B-306, 11B-602.2	
Other: ADA 305, ADA 305.3, ADA 305.5, ADA 3	06
Provide wing walls	\$1,000
Notes: Drinking fountain protrudes 21" from verti- than 4" must be mounted below 27" or ab	
CBC: 11B-602.8, 11B-602.9	
Other: ADA 307	
Replace or adjust water controls	\$125
Notes: Operating effort of water control is 10 lbs	(5 lbs max).
CBC: 11B-309	
Other: ADA 309	
nstall an additional high or low fountain	\$3,000
Notes: A higher standing person fountain and a v provided.	wheelchair accessible fountain are not
CBC: 11B-211.2	
Other: ADA 211.2	

10 - 2	Drinking Fountain	Category: 3	
Replace	fountain		\$3,000
Notes	The bubbler height is 36-5/8" AFF (a floor; standing fountain 38"min to 43		k. above
CBC:	11B-602.4, 11B-602.7		
Other	ADA 602.4, ADA 602.7		
ncrease	e or provide maneuvering or clear f	loor area	\$1,000
Notes:	Slope of clear space in front of the w	ater fountain is 4.1% (2.0% max).	
CBC:	11B-305, 11B-306, 11B-602.2		
Other	ADA 305, ADA 305.3, ADA 305.5, A	DA 306	
Provide	wing walls		\$1,000
Notes:	Drinking fountain protrudes 21" from than 4" must be mounted below 27"		on more
CBC	11B-602.8, 11B-602.9		
Other	: ADA 307		
nstall a	n additional high or low fountain		\$3,000
Notes	A higher standing person fountain ar provided.	nd a wheelchair accessible fountain a	re not
CBC:	11B-211.2		
Other	ADA 211.2		

10 - 3 Drinking Fountain	Category: 3
Replace fountain	\$3,000
Notes: The bubbler height is 37.25" AFF (accessil floor; standing fountain 38"min to 43" max	
CBC: 11B-602.4, 11B-602.7	
Other: ADA 602.4, ADA 602.7	
Provide wing walls	\$1,000
Notes: Drinking fountain protrudes 21" from vertice than 4" must be mounted below 27" or abo	
CBC: 11B-602.8, 11B-602.9	
Other: ADA 307	
Replace or adjust water controls	\$125
Notes: Operating effort of control is 7 lbs (5 lbs ma	ax).
CBC: 11B-309	
Other: ADA 309	
Adjust the water stream height or direction	\$125
Notes: The flow of the water is 1/2" high (4" high r	nin).
CBC: 11B-602.6	
Other: ADA 602.6	
Install an additional high or low fountain	\$3,000
Notes: A higher standing person fountain and a w provided.	heelchair accessible fountain are not
CBC: 11B-211.2	
Other: ADA 211.2	

10 - 4 Drinking Fountain	Category: 3
Replace fountain	\$3,000
Notes: The bubbler height is 36.75" AFF floor; standing fountain 38"min to	(accessible fountain bubbler is 36" max. above 43" max above floor).
CBC: 11B-602.4, 11B-602.7	
Other: ADA 602.4, ADA 602.7	
Provide wing walls	\$1,000
Notes: Drinking fountain protrudes 21" fro than 4" must be mounted below 2	om vertical support at 28" AFF (protrusion more 7" or above 80").
CBC: 11B-602.8, 11B-602.9	
Other: ADA 307	
Replace or adjust water controls	\$125
Notes: Operating effort of control is 7 lbs	(5 lbs max).
CBC: 11B-309	
Other: ADA 309	
Install an additional high or low fountain	\$3,000
Notes: A higher standing person fountain provided.	and a wheelchair accessible fountain are not
CBC: 11B-211.2	
Other: ADA 211.2	

10 - 5 Dr	inking Fountain	Category: 3
Replace for	Intain	\$3,000
	e bubbler height is 37" AFF (accessible Inding fountain 38"min to 43" max abov	fountain bubbler is 36" max. above floor; e floor).
CBC: 11	B-602.4, 11B-602.7	
Other: AD	0A 602.4, ADA 602.7	
Provide wir	ig walls	\$1,000
	nking fountain protrudes 21" from vertic an 4" must be mounted below 27" or abo	cal support at 28" AFF (protrusion more ove 80").
CBC: 11	B-602.8, 11B-602.9	
Other: AD	DA 307	
Replace or	adjust water controls	\$125
Notes: Op	erating effort of control is 7 lbs (5 lbs m	ax).
CBC: 11	B-309	
Other: AD	0A 309	
nstall an a	dditional high or low fountain	\$3,000
	nigher standing person fountain and a w ovided.	heelchair accessible fountain are not
CBC: 11	B-211.2	
Other: AD	0A 211.2	
10 - 6 Dr	inking Fountain	Category: 3
Replace for	Intain	\$3,000
	bbler height on standing person fountai Inding person fountain).	n is 26.75" AFF (38" min to 43" max for a
CBC: 11	B-602.7	
Other: AD		
11 - 1 Te	lephone	Category: 3
Provide TT	/ phone	\$1,500
Notes: TT	Y phone is not provided.	
CBC: 11	B-704.4	
Other: AD	0A 704.4	
Reposition	phone equipment	\$500
Notes: Co	in slot is 63" AFF (48" max).	
CBC: 11	B-308.3	
	A 308.3, ADA 308.3.1, ADA 308.3.2	

16 - 1 Built-in Elements	Category: 2
Provide an accessible counter	\$1,500
Notes: Counters at ball field building are 41.	.5" AFF and 41" AFF (34" max).
CBC: 11B-904.4	
Other: ADA 904.4.1	
32 - 1 Picnic Area	Category: 2
Provide an accessible path of travel	\$520
Notes: An accessible route to the picnic are grass.	a is not provided. Route is 13 linear feet over
CBC: 11B-403	
Other: AGODA F245.4	
ncrease or provide clear floor area	\$700
Notes: Clear floor space at the grill is 21" (3 36" on one side and 10" on the other	6" min). Clear floor space at the picnic table is r (36" min around the table).
CBC: -	
Other: AGODA 1011.2.1	
Provide an accessible table	\$500
Notes: Knee space at the picnic table is 25"	AFF (27" min).
CBC: 11B-306.3	
Other: -	
32 - 2 Picnic Area	Category: 2
Provide an accessible path of travel	\$800
grass.	a is not provided. Route is 20 linear feet over
CBC: 11B-403	
Other: AGODA F245.4	
ncrease or provide clear floor area	\$700
Notes: Clear floor space at the grill is 24" (3 picnic table is not provided.	6 min). A 36 min clear space around the
CBC: -	
Other: AGODA 1011.2.1	
Provide an accessible table	\$500
Notes: Knee space beneath the picnic table	is 24.75" AFF (27" min).
CBC: 11B-306.3 Other: -	


32 - 3 Picnic Area	Category: 2
Provide an accessible path	travel \$2,22
Notes: An accessible route	the picnic area is not provided. Route is 55.5 linear feet ove
grass.	
CBC: 11B-403	
Other: AGODA F245.4	
Increase or provide clear flo	area \$70
Notes: Clear floor space ar is not provided (36"	nd the picnic table is 6" (36" min). Clear floor space at the g n).
CBC: -	
Other: AGODA 1011.2.1	
Provide an accessible table	\$50
Notes: Knee space beneat	e picnic table is 25.25" AFF at 13.5" deep.
CBC: 11B-306.3	
Other: -	
32 - 4 Picnic Area	Category: 2
Provide an accessible picni	nit \$3,20
Notes: An accessible table	not provided in a picnic area.
CBC: 11B-246.5	
Other: -	
32 - 5 Picnic Area	Category: 2
Provide an accessible picni	nit \$3,20
Notes: An accessible table	not provided in a picnic area.
CBC: 11B-246.5	
Other: -	

32 - 6 Picnic Area	Category: 2
Increase or provide clear floor area	\$700
Notes: A 36" min clear space around the picnic table	e is not provided.
CBC: -	
Other: AGODA 1011.2.1	
Replace or reposition picnic grill	\$750
Notes: Clear floor space at the grill is 22" (36" min).	
CBC: -	
Other: AGODA 1011.5.2	
Provide an accessible table	\$500
Notes: Knee space beneath the picnic table is 25.75	" AFF (27" min).
CBC: 11B-306.3	
Other: -	
Provide an accessible path of travel	\$1,000
Notes: An accessible route to the picnic area is not p picnic area.	provided, 25 linear feet over grass to
CBC: 11B-403	
Other: AGODA F245.4	
33 - 1 Outdoor Constructed Features	Category: 3
Provide an accessible path of travel	\$240
Notes: An accessible route to the fixed trash/recyclin feet over grass.	ng container is not provided, 6 linear
CBC: -	
Other: AGODA 1011.2.1	
33 - 2 Outdoor Constructed Features	Category: 3
Provide an accessible path of travel	\$320
Notes: An accessible route to the fixed trash/recyclin linear feet over grass.	ng container is not provided. Route is 8
CBC: -	
Other: AGODA 1011.2.1	
33 - 3 Outdoor Constructed Features	Category: 3
Provide an accessible path of travel	\$220
Notes: An accessible route to the fixed trash/recyclin	ng container is not provided. Route is
65" over grass.	

33 - 4 Outdoor Constructed Features	Category: 3
Provide an accessible path of travel	\$360
Notes: An accessible route to the fixed trash feet to container.	n/recycling container is not provided for 9 linear
CBC: -	
Other: AGODA 1011.2.1	
35 - 1 Other	Category: 3
Reposition controls	\$200
Notes: Mutt Mitt is 44" off the path of travel off path of travel).	at 51" AFF (46" max when between 10" to 24"
CBC: 11B-308.3	
Other: ADA 308.3, ADA 308.3.1, ADA 308.3	3.2
35 - 2 Other	Category: 3
Reposition controls	\$200
Notes: Mutt Mitt is 42" off the path of travel off path of travel).	at 48" AFF (46" max when between 10" to 24"
CBC: 11B-308.3	
Other: ADA 308.3, ADA 308.3.1, ADA 308.3	3.2
43 - 1 Play Equipment Area	Category: 2
Provide an accessible path of travel	\$2,460
Notes: An accessible route to the play area (continuous surface without steps).	is not provided due to two 5.5" steps
CBC: 11B-206.2.17	
Other: ADA 206.2.17	
Raise or lower ramp handrail	\$70
Notes: Top of the gripping surface of the ha is 15.5" AFF (20" min to 28" max).	ndrails at the ramp to elevated play equipment
CBC: 11B-1008.2.5.3.2	
Other: ADA 1008.2.5.3.2	
Install or modify transfer system	\$15,000
Notes: Transfer platform surface height is 9 surfacing.	.5" (11" min to 18" max) above the accessible
CBC: 11B-1008.3.1.2	
Other: ADA 1008.3.1.2	

43 - 2 Play Equipment Area	Category: 2
Regrade or replace ramp	\$4,250
Notes: Ramp connecting ground level and pl	ay area has a slope of 10.9% (6.25% max).
CBC: 11B-1008.2.5.1	
Other: ADA 1008.2.5.1	

Monta Vista Park- Recreation Center 22601 Voss Avenue Cupertino, CA

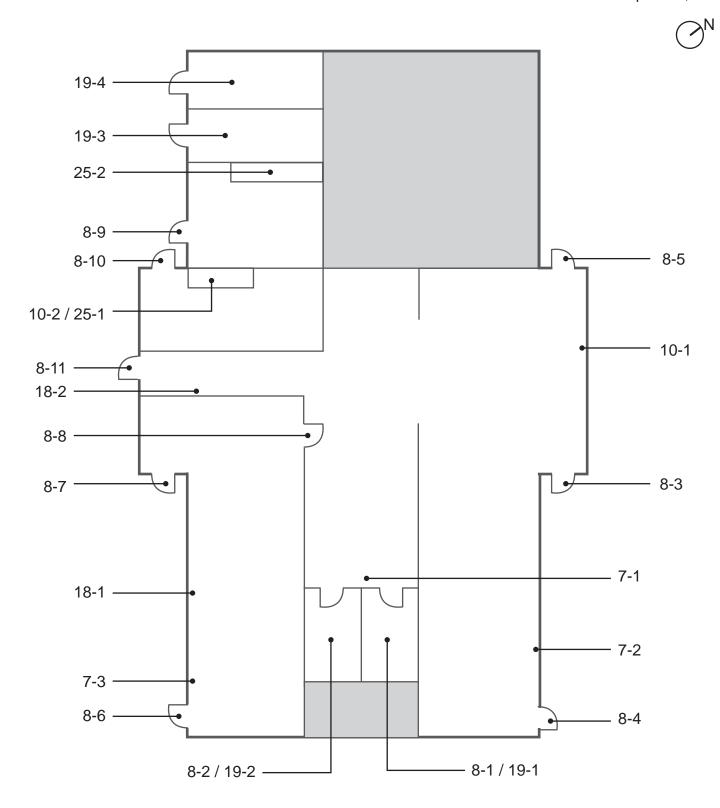

Building 1	
7 - 1 Hazard	Category: 2
Remove overhanging or protruding objects	\$125
Notes: AED and first aid kit protrudes 7.5" from th 4" must be mounted below 27" or above 8	
CBC: 11B-307.4	
Other: ADA 307.4	
7 - 2 Hazard	Category: 2
Remove overhanging or protruding objects	\$125
Notes: Fire extinguisher protrudes 6" from the wa must be mounted below 27" or above 80")	
CBC: 11B-307.2	
Other: ADA 307.2	
7 - 3 Hazard	Category: 2
Remove overhanging or protruding objects	\$125
Notes: Fire extinguisher protrudes 6.5" from the v must be mounted below 27" or above 80")	N N
CBC: 11B-307.2	
Other: ADA 307.2	
8 - 1 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Door opening force is 8 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
8 - 2 Door/Gate	Category: 3
Adjust door closer	\$125
Notes: Door opening force is 10 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	

Building 1	
8 - 3 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Door opening force is 15 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
nstall or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not provid	ed in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Replace or modify door threshold	\$125
Notes: Threshold has a vertical change of 1.25" (1	I/4" max, up to 1/2" with a bevel).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
8 - 4 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Door opening force is 13 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
nstall or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not provid	ed in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
8 - 5 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Door opening force is 16 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
8 - 6 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Door opening force is 14 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Replace or modify door threshold	\$125
Notes: Threshold has a vertical change of 1.25" a up to 1/2" with a bevel).	nd an additional 2" at matting (1/4" max,
CBC: 11B-404.2.5	

8 - 7 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Door opening force is 18 lbs (5 lbs r	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Replace or modify door threshold	\$125
	1/2" and 3/4" with bevel (1/4" max, up to 1/2"
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
8 - 8 Door/Gate	Category: 2
Replace or modify door threshold	\$125
Notes: Threshold has a vertical change of 2 1/2" with a bevel).(Entrance to partic	2" due to matting on the floor (1/4" max, up to cipants only, no parents).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
8 - 9 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Door opening force is 15 lbs (5 lbs r	nax).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
nstall or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not	provided in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
8 - 10 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Door opening force is 13 lbs (5 lbs r	nax).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	

Building 1	
8 - 11 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Door opening force is 15 lbs (5 lbs ma	x).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate in the 10" space above the finished flo	•
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
10 - 1 Drinking Fountain	Category: 3
Provide wing walls	\$1,000
Notes: Kids area drinking fountain protrudes 8 (protrusion more than 4" must be mou	
CBC: 11B-602.8, 11B-602.9	
Other: ADA 307	
10 - 2 Drinking Fountain	Category: 3
Adjust the water stream height or direction	\$125
Notes: The bubbler is attached to the sink and max).	d is 12" back from the front of the counter (5"
CBC: 11B-602.6	
Other: ADA 602.6	
18 - 1 Room	Category: 2
Install or modify visible fire alarm	\$250
Notes: Visible fire alarm is located 78" AFF (8 whichever is lower).	30" min to 96" max, or 6" below the ceiling,
CBC: 11B-702.1	
Other: ADA 702.1	
18 - 2 Room	Category: 2
Install or modify visible fire alarm	\$250
Notes: Visual fire alarm is located 79" AFF (8 whichever is lower).	0" min to 96" max, or 6" below the ceiling,
CBC: 11B-702.1	
Other: ADA 702.1	

Building 1	
19 - 1 Multiple User Restroom	Category: 2
Provide or replace compartment door har	dware \$175
	not self closing (compartment door must have U- utside of the door and be self-closing).
CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2	
Replace or modify grab bars	\$300
Notes: Side grab bar extends 50.75" from	the rear wall (54" min).
CBC: 11B-604.5.1	
Other: ADA 604.5.1	
Replace or reposition dispenser	\$125
· · · · · · · · · · · · · · · · · · ·	ed 45" AFF (40" max). Toilet paper is located (7" min to 9" max in front of the water closet). 2.75" AFF (40" max).
CBC: 11B-603.5, 11B-604.7	
Other: ADA 604.7	
Modify lavatory or counter clearances	\$1,500
Notes: Clear space beneath the lavatory a	pron is 28" (29" min).
CBC: 11B-306.3.1	
Other: -	
Provide or modify urinal shields	\$1,000
Notes: Centerline of the urinal from partitic	on is 14" (15" min).
CBC: 11B-305.7.1, 11B-605.3	
Other: ADA 305.3, ADA 305.7.1, ADA 605	5.3

	ig 1	
19 - 2	Multiple User Restroom Category: 2	
Provide	or replace compartment door hardware	\$175
Notes:	Compartment does not have a handle on outside the compartment does self closing (compartment door must have U-shaped handles both insi outside of the door and be self-closing).	
CBC:	11B-604.8.1.2	
Other:	ADA 604.8.1.2	
Replace	or modify grab bars	\$300
Notes:	Side grab bar extends 52.25" from the rear wall (54" min).	
CBC:	11B-604.5.1	
Other:	ADA 604.5.1	
Replace	or reposition dispenser	\$375
Notes:	Toilet seat cover dispenser is located 46.5" AFF and is located behind	
	the water closet (40" max). Soap dispenser is located 40.25" AFF(40"	max).
CBC:	11B-603.5, 11B-604.7	max).
		max).
Other:	11B-603.5, 11B-604.7	max). \$1,500
Other: Modify la	11B-603.5, 11B-604.7 ADA 604.7	
Other: Modify Ia Notes:	11B-603.5, 11B-604.7 ADA 604.7 avatory or counter clearances	
Other: Modify Ia Notes:	11B-603.5, 11B-604.7 ADA 604.7 avatory or counter clearances Clear space beneath the lavatory apron is 28.5" (29" min). 11B-306.3.1	
Other: Modify Ia Notes: CBC: Other:	11B-603.5, 11B-604.7 ADA 604.7 avatory or counter clearances Clear space beneath the lavatory apron is 28.5" (29" min). 11B-306.3.1	
Other: Modify Ia Notes: CBC: Other: Replace	11B-603.5, 11B-604.7 ADA 604.7 avatory or counter clearances Clear space beneath the lavatory apron is 28.5" (29" min). 11B-306.3.1	\$1,500 \$1,250
Other: Modify Ia Notes: CBC: Other: Replace Notes:	11B-603.5, 11B-604.7 ADA 604.7 avatory or counter clearances Clear space beneath the lavatory apron is 28.5" (29" min). 11B-306.3.1 - or reposition fixtures	\$1,500 \$1,250
Other: Modify Ia Notes: CBC: Other: Replace Notes: CBC:	11B-603.5, 11B-604.7 ADA 604.7 avatory or counter clearances Clear space beneath the lavatory apron is 28.5" (29" min). 11B-306.3.1 - or reposition fixtures Centerline of water closet is 19" from the side wall (17"min to 18" max)	\$1,500 \$1,250
Other: Modify Ia Notes: CBC: Other: Replace Notes: CBC: Other:	11B-603.5, 11B-604.7 ADA 604.7 avatory or counter clearances Clear space beneath the lavatory apron is 28.5" (29" min). 11B-306.3.1 - or reposition fixtures Centerline of water closet is 19" from the side wall (17"min to 18" max) 11B-604.2	\$1,500 \$1,250
Other: Modify Ia Notes: CBC: Other: Replace Notes: CBC: Other: Replace	11B-603.5, 11B-604.7 ADA 604.7 avatory or counter clearances Clear space beneath the lavatory apron is 28.5" (29" min). 11B-306.3.1 - or reposition fixtures Centerline of water closet is 19" from the side wall (17"min to 18" max) 11B-604.2 ADA 604.2	\$1,500 \$1,250).
Other: Modify Ia Notes: CBC: Other: Replace Notes: CBC: Other: Replace Notes:	11B-603.5, 11B-604.7 ADA 604.7 avatory or counter clearances Clear space beneath the lavatory apron is 28.5" (29" min). 11B-306.3.1 - or reposition fixtures Centerline of water closet is 19" from the side wall (17"min to 18" max) 11B-604.2 ADA 604.2 or reposition mirror	\$1,500 \$1,250).


Buildin		
19 - 3	Multiple User Restroom	Category: 2
Replace	or reposition dispenser	\$250
Notes:	Height of soap dispenser is 41.5" AFF (40" m located 3" from the front of the water closet (closet).	
CBC:	11B-603.5, 11B-604.7	
Other:	ADA 604.7	
Replace	or reposition fixtures	\$1,250
Notes:	Centerline of the water closet is 18.5" from th	ne side wall (17" min to18" max).
CBC:	11B-604.2	
Other:	ADA 604.2	
Replace	toilet or adjust toilet seat height	\$3,000
Notes:	Water closet seat height is 16" AFF (17" min	to 19" max).
CBC:	11B-604.4	
Other:	ADA 604.4	
Provide	or replace compartment door hardware	\$175
Notes:	Compartment door does not have handles or closing (compartment door must have U-sha the door and be self-closing).	
CBC:	11B-604.8.1.2	
Other:	ADA 604.8.1.2	
Modify I	avatory or counter clearances	\$1,500
Notes:	Clear space beneath the lavatory apron is 28	3.75" (29" min).
CBC:	11B-306.3.1	
Other:	-	
Replace	or modify grab bars	\$300
Notes:	Toilet paper dispenser is located 4" above th grab bar).	e grab bar (12" min clear space above
CBC:	11B-609.3	
0.1	ADA 609.3	

Building 1		
	ple User Restroom	Category: 2
	position dispenser	\$125
	nt of soap dispenser is 41.5" AFF	•
CBC: 11B-6		(+0 1104).
Other: -		
	oosition fixtures	\$1,250
		rom the side wall (17" min to 18" max).
CBC: 11B-6		······································
Other: ADA		
Provide or rep	lace compartment door hardw	/are \$175
closin		ndle on inside of the door and is not self- e U-shaped handles both inside and outside of
CBC: 11B-6	04.8.1.2	
Other: ADA	604.8.1.2	
Replace or mo	odify grab bars	\$600
36.5" wall).	long and extends 50.25" from th	n long, centered 12" and 24"). Side grab bar is ne rear wall (42" long min and 54" from the rear ed 2.5 above the side grab bar (12" min clear
CBC: 11B-6	604.5.1, 11B-604.5.2, 11B-609.3	;
Other: ADA	604.5.1, ADA 604.5.2, ADA 609	.3
Reposition toi	let flush controls	\$750
	control is located on the narrow e open side of the fixture).	side of the water closet (flush control located
CBC: 11B-6	604.6	
Other: ADA	604.6	
25 - 1 Kitch	en	Category: 4
Provide knee	and toe clearance	\$1,500
Notes: Knee	space is not provided at sink an	d attached drinking fountain.
CBC: 11B-3	306.3.3	
Other: ADA	306.3, ADA 306.3.3	

25 - 2 Kitchen	Category: 2
Provide knee and toe clearance	\$1,500
Notes: Knee space is not provided under the	sink.
CBC: 11B-306.3.3	
Other: ADA 306.3, ADA 306.3.3	
Replace or reposition dispenser	\$125
Notes: Soap dispenser is 42" high behind a 2 25" max obstruction when knee space	25" counter (44" max AFF allowed behind up to e is provided).
CBC: 11B-606.1	
Other: ADA 308, ADA 308.2.1, ADA 308.2.2	, ADA 308.3.1, ADA 308.3.2

Monta Vista- Child Care Building 22601 Voss Ave Cupertino, CA

Ν

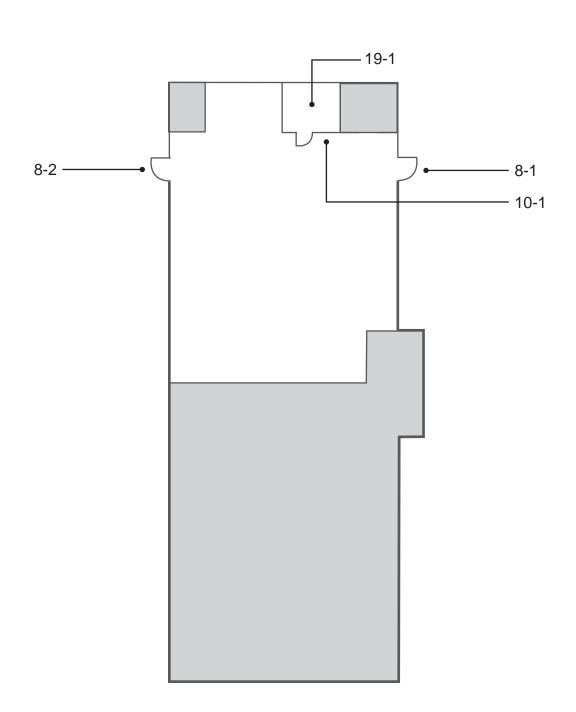


City of Cupertino Facilities Surveys

Building 2	
8 - 1 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Door opening force is 14 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not provide	d in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate surface located in the 10" space above the finished	•
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
8 - 2 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Door opening force is 22 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not provide	d in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate surfact located in the 10" space above the finished	•
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
10 - 1 Drinking Fountain	Category: 3
Adjust the water stream height or direction	\$125
Notes: The bubbler is attached to the sink and is 9" max).	back from the front of the counter (5"
CBC: 11B-602.6	
Other: ADA 602.6	

19 - 1 Multiple User Restroom	Category: 2
nstall restroom sign	\$250
Notes: Required state and federal signs not provided.	
CBC: 11B-216.8, 11B-703.7.2.6	
Other: ADA 216.8, ADA 703.7.2.1	
Replace or reposition fixtures	\$1,250
Notes: Children's Dimensions: Centerline of the water closet min to 18" max).	is 19.25" from side wall (12"
CBC: 11B-604.2	
Other: ADA 604.2	
Provide or replace compartment door hardware	\$175
Notes: Compartment door does not have handles on both sid door must have U-shaped handles both inside and ou	``
closing). CBC: 11B-604.8.1.2	
CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Reposition clothing hooks	\$125
CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2	\$125
CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Reposition clothing hooks	\$125
CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Reposition clothing hooks Notes: Height of coat hook is 50" (48" max).	\$125
CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Reposition clothing hooks Notes: Height of coat hook is 50" (48" max). CBC: 11B-603.4	\$125
CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Reposition clothing hooks Notes: Height of coat hook is 50" (48" max). CBC: 11B-603.4 Other: ADA 308	\$1,500
CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Reposition clothing hooks Notes: Height of coat hook is 50" (48" max). CBC: 11B-603.4 Other: ADA 308 Modify lavatory or counter clearances	\$1,500
CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Reposition clothing hooks Notes: Height of coat hook is 50" (48" max). CBC: 11B-603.4 Other: ADA 308 Modify lavatory or counter clearances Notes: Children's Dimensions: Knee space beneath the lavat	\$1,500
CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Reposition clothing hooks Notes: Height of coat hook is 50" (48" max). CBC: 11B-603.4 Other: ADA 308 Modify lavatory or counter clearances Notes: Children's Dimensions: Knee space beneath the lavat CBC: 11B-606.2	\$1,500
CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Reposition clothing hooks Notes: Height of coat hook is 50" (48" max). CBC: 11B-603.4 Other: ADA 308 Modify lavatory or counter clearances Notes: Children's Dimensions: Knee space beneath the lavat CBC: 11B-606.2 Other: ADA 606.2, ADA 606.2.5	\$1,500 tory is 18 1/8" AFF (24" min). \$125
CBC: 11B-604.8.1.2 Other: ADA 604.8.1.2 Reposition clothing hooks Notes: Height of coat hook is 50" (48" max). CBC: 11B-603.4 Other: ADA 308 Modify lavatory or counter clearances Notes: Children's Dimensions: Knee space beneath the lavat CBC: 11B-606.2 Other: ADA 606.2, ADA 606.2.5 Replace or reposition dispenser	\$1,500 tory is 18 1/8" AFF (24" min). \$125


Oak Valley Park 23625-23645 Oak Valley Road Cupertino, CA

 \mathcal{S}^{N}

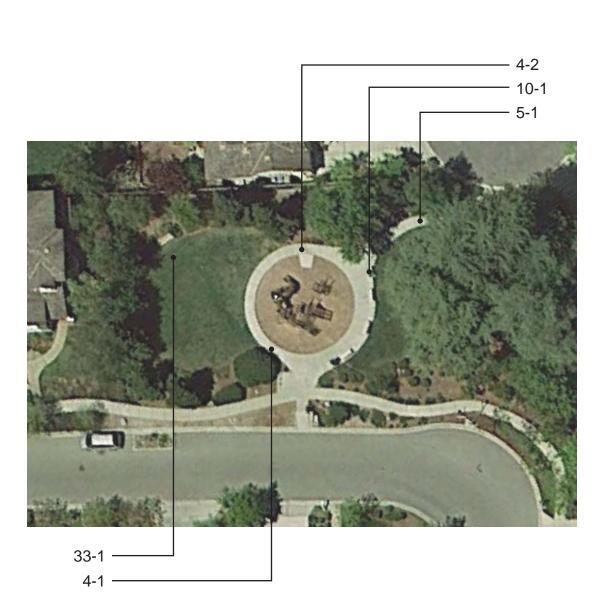

Oak Valley Park

4 - 1	Walk	Category: 2
-	surface	\$400
	Cross slope of concrete path is up to 2.8%	for 10 linear feet (2.0% max).
	11B-403.3	
	ADA 403.3	
4 - 2	Walk	Category: 2
-	surface	\$1,280
	Cross slope of concrete path is up to 3.3%	for 32 linear feet (2.0% max).
	11B-403.3	
Other	ADA 403.3	
5 - 1	Ramp	Category: 1
Regrade	or replace ramp	\$12,750
Notes:	Ramp has a running slope of 17.8% (8.33% (2.0% max) for 30 linear feet.	% max) and a cross slope is up to 5%
CBC:	11B-405.3	
Other	ADA 405.3	
10 - 1	Drinking Fountain	Category: 3
•	fountain	\$3,000
Notes: CBC:	The bubbler height is 36.5" AFF (accessibl floor; standing fountain 38"min to 43" max 11B-602.4, 11B-602.7	\$3,000 le fountain bubbler is 36" max. above
Notes: CBC: Other:	The bubbler height is 36.5" AFF (accessibl floor; standing fountain 38"min to 43" max 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7	\$3,000 le fountain bubbler is 36" max. above above floor).
Notes: CBC: Other: Provide	The bubbler height is 36.5" AFF (accessibl floor; standing fountain 38"min to 43" max 11B-602.4, 11B-602.7	\$3,000 le fountain bubbler is 36" max. above above floor). \$1,000 al support at 36.5" AFF (protrusion more
Notes: CBC: Other: Provide Notes:	The bubbler height is 36.5" AFF (accessibl floor; standing fountain 38"min to 43" max 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 wing walls Drinking fountain protrudes 32" from vertice	\$3,000 le fountain bubbler is 36" max. above above floor). \$1,000 al support at 36.5" AFF (protrusion more
Notes: CBC: Other: Provide Notes: CBC:	The bubbler height is 36.5" AFF (accessibl floor; standing fountain 38"min to 43" max 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 wing walls Drinking fountain protrudes 32" from vertice than 4" must be mounted below 27" or abo	\$3,000 le fountain bubbler is 36" max. above above floor). \$1,000 al support at 36.5" AFF (protrusion more
Notes: CBC: Other: Provide Notes: CBC:	The bubbler height is 36.5" AFF (accessibl floor; standing fountain 38"min to 43" max 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 wing walls Drinking fountain protrudes 32" from vertice than 4" must be mounted below 27" or about 11B-602.8, 11B-602.9	\$3,000 le fountain bubbler is 36" max. above above floor). \$1,000 al support at 36.5" AFF (protrusion more
Notes: CBC: Other: Provide Notes: CBC: Other: 33 - 1	The bubbler height is 36.5" AFF (accessibl floor; standing fountain 38"min to 43" max 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 wing walls Drinking fountain protrudes 32" from vertice than 4" must be mounted below 27" or about 11B-602.8, 11B-602.9 ADA 307	\$3,000 le fountain bubbler is 36" max. above above floor). \$1,000 al support at 36.5" AFF (protrusion more ove 80").
Notes: CBC: Other: Provide Notes: CBC: Other: 33 - 1 Provide	The bubbler height is 36.5" AFF (accessibl floor; standing fountain 38"min to 43" max 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 wing walls Drinking fountain protrudes 32" from vertice than 4" must be mounted below 27" or abc 11B-602.8, 11B-602.9 ADA 307 Outdoor Constructed Features	\$3,000 le fountain bubbler is 36" max. above above floor). \$1,000 al support at 36.5" AFF (protrusion more ove 80"). Category: 4 \$1,440
Notes: CBC: Other: Provide Notes: CBC: Other: 33 - 1 Provide	The bubbler height is 36.5" AFF (accessibl floor; standing fountain 38"min to 43" max 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 wing walls Drinking fountain protrudes 32" from vertic than 4" must be mounted below 27" or abc 11B-602.8, 11B-602.9 ADA 307 Outdoor Constructed Features an accessible path of travel An accessible route to the fixed bench is n grass to 2 benches.	\$3,000 le fountain bubbler is 36" max. above above floor). \$1,000 al support at 36.5" AFF (protrusion more ove 80"). Category: 4 \$1,440
Notes: CBC: Other: Provide Notes: CBC: 33 - 1 Provide Notes: CBC:	The bubbler height is 36.5" AFF (accessibl floor; standing fountain 38"min to 43" max 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 wing walls Drinking fountain protrudes 32" from vertic than 4" must be mounted below 27" or abc 11B-602.8, 11B-602.9 ADA 307 Outdoor Constructed Features an accessible path of travel An accessible route to the fixed bench is n grass to 2 benches.	\$3,000 le fountain bubbler is 36" max. above above floor). \$1,000 al support at 36.5" AFF (protrusion more ove 80"). Category: 4 \$1,440
Notes: CBC: Other: Provide Notes: CBC: Other: 33 - 1 Provide Notes: CBC: CBC: CBC:	The bubbler height is 36.5" AFF (accessibl floor; standing fountain 38"min to 43" max 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 wing walls Drinking fountain protrudes 32" from vertice than 4" must be mounted below 27" or abc 11B-602.8, 11B-602.9 ADA 307 Outdoor Constructed Features an accessible path of travel An accessible route to the fixed bench is n grass to 2 benches.	\$3,000 le fountain bubbler is 36" max. above above floor). \$1,000 al support at 36.5" AFF (protrusion more ove 80"). Category: 4 \$1,440
Notes: CBC: Other: Provide Notes: CBC: Other: 33 - 1 Provide Notes: CBC: Other: Increase Notes:	The bubbler height is 36.5" AFF (accessibl floor; standing fountain 38"min to 43" max 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 wing walls Drinking fountain protrudes 32" from vertice than 4" must be mounted below 27" or abo 11B-602.8, 11B-602.9 ADA 307 Outdoor Constructed Features an accessible path of travel An accessible route to the fixed bench is n grass to 2 benches. - AGODA 1011.2.1 e or provide clear floor area A clear floor space is not provided adjacen	\$3,000 le fountain bubbler is 36" max. above above floor). \$1,000 al support at 36.5" AFF (protrusion more ove 80"). Category: 4 \$1,440 ot provided. Route is 36 linear feet over \$1,400

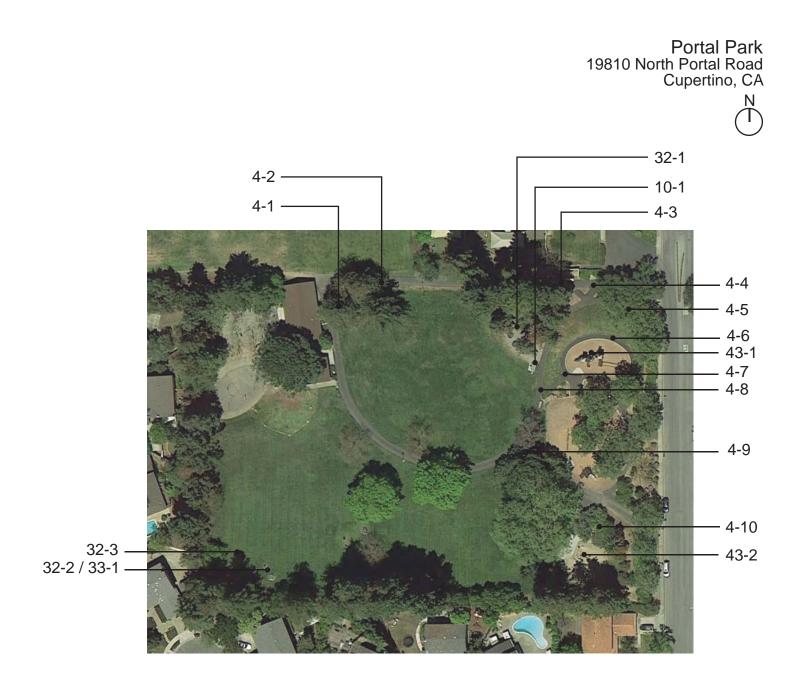

4 - 1	Walk	Category: 2	
	surface		\$240
		up to 3.5% for 12 linear feet (2.0% max).	
	11B-403.3		
Other:	ADA 403.3		
4 - 2	Walk	Category: 2	
Regrade	surface		\$1,000
Notes:	Cross slope of asphalt path is slope (2.0% max).	up to 4% for 50 linear feet, with one section	of 7.4%
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 3	Walk	Category: 2	
Regrade	surface		\$940
Notes:	Cross slope of asphalt path is	up to 6.6% for 47 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 4	Walk	Category: 2	
Regrade	surface		\$400
		is up to 15% for 20 linear feet (5.0% max).	
	11B-403.3	······································	
	ADA 403.3		
4 - 5	Walk	Category: 1	
	surface		\$600
		up to 2.4% for 30 linear feet, and a running κ).	•
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 6	Walk	Category: 2	
	surface		\$5,080
		around play area is up to 5.3% for 127 linear	
CBC	11B-403.3		
	ADA 403.3		
4 - 7	Walk	Category: 2	
		Category.2	\$460
	surface	up to 5% for 23 linear feet (2.0% max).	ψ+00
		up to 5 /0 101 25 intear teet (2.0 /0 that).	
	11B-403.3		
	ADA 403.3		
12/19/20	14	Portal Park	Page '


4 - 8 Walk	Category: 2	
Regrade surface		\$1,700
Notes: Cross slope of as	sphalt path is up to 6.3% for 85 linear feet (2.0% max).	
CBC: 11B-403.3		
Other: ADA 403.3		
4 - 9 Walk	Category: 2	
Regrade surface		\$680
Notes: Cross slope of as	sphalt path is up to 4% for 34 linear feet (2.0% max).	
CBC: 11B-403.3		
Other: ADA 403.3		
4 - 10 Walk	Category: 1	
Regrade surface		\$100
Notes: Running slope of	f concrete path is up to 7.5% for 5 linear feet (5.0% max)	•
CBC: 11B-403.3		
Other: ADA 403.3		
10 - 1 Drinking Founta	ain Category: 3	
Replace fountain		\$3,000
	37" AFF (accessible fountain bubbler is 36" max. above fountain 38" min to 43" max).	floor;
CBC: 11B-602.4, 11B-	602.7	
Other: ADA 602.4, ADA	602.7	
Increase or provide man	euvering or clear floor area	\$1,000
Notes: Slope of clear sp	ace in front of the water fountain is 4.6% (2.0% max).	
CBC: 11B-305, 11B-30	06, 11B-602.2	
,		
•	05.3, ADA 305.5, ADA 306	
•		\$3,000
Other: ADA 305, ADA 3 Install an additional high		
Other: ADA 305, ADA 3 Install an additional high Notes: A wheelchair acc	or low fountain	

32 - 1 Picnic Area	Category: 2
Provide an accessible path of travel	\$600
Notes: An accessible route to the picnic area is no gravel.	ot provided. Route is 15 linear feet over
CBC: 11B-403	
Other: AGODA F245.4	
Provide an accessible picnic unit	\$6,400
Notes: An accessible table is not provided in a pic	cnic area many tables. (2 required).
CBC: 11B-246.5	
Other: -	
Replace or reposition picnic grill	\$750
Notes: Grill operating mechanism is 36" AFF (15" the grill.	min to 34" max). No knee space beneath
CBC: -	
Other: AGODA 1011.5.2	
32 - 2 Picnic Area	Category: 2
Provide an accessible path of travel	\$1,840
Notes: An accessible route to the picnic area is no grass.	ot provided. Route is 92 linear feet over
CBC: 11B-403	
Other: AGODA F245.4	
Provide an accessible picnic unit	\$3,200
Notes: An accessible table is not provided.	
CBC: 11B-246.5	
Other: -	
	•
Increase or provide clear floor area	\$700
Increase or provide clear floor area Notes: Clear floor space around the picnic table is	

32 - 3	Picnic Area	Category: 2	
Provide	an accessible path of travel		\$1,600
Notes:	An accessible route to the picnic area is not provided. grass.	Route is 80 linear fee	et over
CBC:	11B-403		
Other:	AGODA F245.4		
Provide	an accessible picnic unit		\$3,200
Notes:	An accessible table is not provided.		
CBC:	11B-246.5		
Other:	-		
Increase	e or provide clear floor area		\$700
Notes:	Clear floor space around the picnic table is 7" (36" mir provided by the grill.). No clear floor spac	ce
CBC:	-		
Other:	AGODA 1011.2.1		
33 - 1	Outdoor Constructed Features	Category: 3	
Drovido	an accessible path of travel		\$560
Flovide	an accessible path of travel		\$500
	An accessible route is not provided by the grill and fixe linear feet over grass.	ed trash/recycling. Rc	•
	An accessible route is not provided by the grill and fixe linear feet over grass.	ed trash/recycling. Ro	•
Notes: CBC:	An accessible route is not provided by the grill and fixe linear feet over grass.	ed trash/recycling. Rc	•
Notes: CBC:	An accessible route is not provided by the grill and fixe linear feet over grass.	ed trash/recycling. Ro Category: 2	•
Notes: CBC: Other: 43 - 1	An accessible route is not provided by the grill and fixe linear feet over grass. - AGODA 1011.2.1		•
Notes: CBC: Other: 43 - 1 Provide	An accessible route is not provided by the grill and fixe linear feet over grass. - AGODA 1011.2.1 Play Equipment Area	Category: 2	st,000
Notes: CBC: Other: 43 - 1 Provide Notes:	An accessible route is not provided by the grill and fixe linear feet over grass. - AGODA 1011.2.1 Play Equipment Area play components Play area has 5 elevated play components and 1 grou	Category: 2	st,000
Notes: CBC: Other: 43 - 1 Provide Notes: CBC:	An accessible route is not provided by the grill and fixe linear feet over grass. - AGODA 1011.2.1 Play Equipment Area play components Play area has 5 elevated play components and 1 grou components of differing types).	Category: 2	\$5,000
Notes: CBC: Other: 43 - 1 Provide Notes: CBC: Other:	An accessible route is not provided by the grill and fixe linear feet over grass. AGODA 1011.2.1 Play Equipment Area play components Play area has 5 elevated play components and 1 grou components of differing types). 11B-240.2.1.2	Category: 2	st,000
Notes: CBC: Other: 43 - 1 Provide Notes: CBC: Other: Regrade	An accessible route is not provided by the grill and fixe linear feet over grass. - AGODA 1011.2.1 Play Equipment Area play components Play area has 5 elevated play components and 1 grou components of differing types). 11B-240.2.1.2 ADA 240.2.1.2	Category: 2 nd component (2 mir	\$5,000 ground
Notes: CBC: Other: 43 - 1 Provide Notes: CBC: Other: Regrade Notes:	An accessible route is not provided by the grill and fixe linear feet over grass. AGODA 1011.2.1 Play Equipment Area play components Play area has 5 elevated play components and 1 grou components of differing types). 11B-240.2.1.2 ADA 240.2.1.2 or replace ramp	Category: 2 nd component (2 mir	\$5,000 ground
Notes: CBC: Other: 43 - 1 Provide Notes: CBC: CBC: CBC:	An accessible route is not provided by the grill and fixe linear feet over grass. AGODA 1011.2.1 Play Equipment Area play components Play area has 5 elevated play components and 1 grou components of differing types). 11B-240.2.1.2 ADA 240.2.1.2 or replace ramp Ramp to the play area has a slope of 8.1% (6.25% ma	Category: 2 nd component (2 mir	\$5,000 ground
Notes: CBC: Other: 43 - 1 Provide Notes: CBC: CBC: CBC:	An accessible route is not provided by the grill and fixe linear feet over grass. AGODA 1011.2.1 Play Equipment Area play components Play area has 5 elevated play components and 1 grou components of differing types). 11B-240.2.1.2 ADA 240.2.1.2 or replace ramp Ramp to the play area has a slope of 8.1% (6.25% ma 11B-1008.2.5.1	Category: 2 nd component (2 mir	\$5,000 ground
Notes: CBC: Other: 43 - 1 Provide Notes: CBC: Other: Regrade Notes: CBC: Other: 43 - 2	An accessible route is not provided by the grill and fixe linear feet over grass. AGODA 1011.2.1 Play Equipment Area play components Play area has 5 elevated play components and 1 grou components of differing types). 11B-240.2.1.2 ADA 240.2.1.2 or replace ramp Ramp to the play area has a slope of 8.1% (6.25% ma 11B-1008.2.5.1 ADA 1008.2.5.1	Category: 2 nd component (2 mir	\$5,000 ground
Notes: CBC: Other: 43 - 1 Provide Notes: CBC: Other: Regrade Notes: CBC: Other: 43 - 2 Raise or	An accessible route is not provided by the grill and fixe linear feet over grass. AGODA 1011.2.1 Play Equipment Area play components Play area has 5 elevated play components and 1 grou components of differing types). 11B-240.2.1.2 ADA 240.2.1.2 or replace ramp Ramp to the play area has a slope of 8.1% (6.25% ma 11B-1008.2.5.1 ADA 1008.2.5.1 Play Equipment Area	Category: 2 nd component (2 mir x). Category: 2	st,000 \$5,000 ground \$2,460
Notes: CBC: Other: 43 - 1 Provide Notes: CBC: Other: Regrade Notes: CBC: Other: 43 - 2 Raise or Notes:	An accessible route is not provided by the grill and fixe linear feet over grass. AGODA 1011.2.1 Play Equipment Area play components Play area has 5 elevated play components and 1 grou components of differing types). 11B-240.2.1.2 ADA 240.2.1.2 or replace ramp Ramp to the play area has a slope of 8.1% (6.25% ma 11B-1008.2.5.1 ADA 1008.2.5.1 Play Equipment Area lower ramp handrail	Category: 2 nd component (2 mir x). Category: 2	\$5,000 strong ground \$2,460

Portal Park Community Building 19810 N Portal Ave. Cupertino, CA



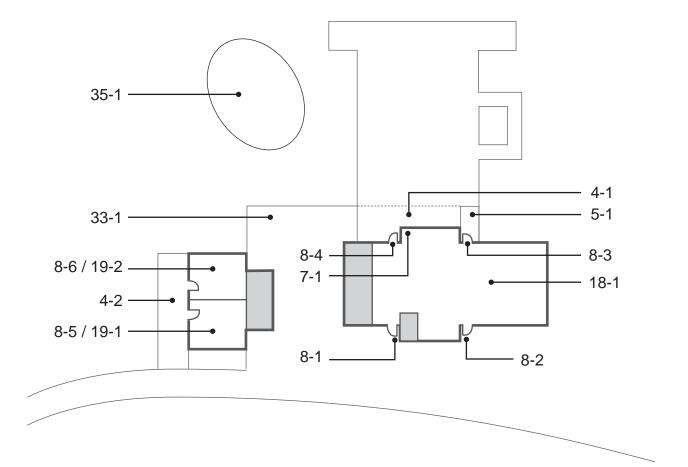

Building 4 - 1 Walk	Category: 2
Grind or patch vertical change of grade	\$250
Notes: 2" change in level at brick paving in two	spaces (1/4" max, up to 1/2" with a bevel).
CBC: 11B-303.2	
Other: ADA 303.2, ADA 303.3	
Regrade surface	\$1,120
Notes: Cross slope of path is up to 4.7% for 28	3 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 2 Walk	Category: 2
Regrade surface	\$480
Notes: Running slope of concrete path to restruction cross slope up to 4.6% (2.0% max) for	
CBC: 11B-403.3	
Other: ADA 403.3	
5 - 1 Ramp	Category: 1
Install a handrail	\$2,500
Notes: Handrails are not provided on either sid gripping surfaces are provided on both	• •
CBC: 11B-505.2	
Other: ADA 405.8	
Provide a level landing	\$150
Notes: Slope of bottom landing is 3.3% (2.0%	max).
CBC: 11B-405.7.1	
CBC: 11B-405.7.1	Category: 2
CBC: 11B-405.7.1 Other: ADA 302, ADA 405.7.1	Category: 2 \$0
CBC: 11B-405.7.1 Other: ADA 302, ADA 405.7.1 7 - 1 Hazard	\$0 t 48.75" AFF (protrusion more than 4" must
CBC: 11B-405.7.1 Other: ADA 302, ADA 405.7.1 7 - 1 Hazard Remove overhanging or protruding objects Notes: First aid kit protrudes 5" from the wall a	\$0 t 48.75" AFF (protrusion more than 4" must

Building	
8 - 1 Door/Gate	Category: 1
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate in the 10" space above the finished flo	
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Replace or modify door threshold	\$125
Notes: Threshold has a vertical change of 8"	(1/4" max, up to 1/2" with a bevel).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
Regrade surface	\$2,500
Notes: Slope on the swing side of the door is	3.4% (2.0% max).
CBC: 11B-404.2.4.4	
Other: ADA 404.2.4.4	
8 - 2 Door/Gate	Category: 1
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not p	rovided in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate in the 10" space above the finished flo	•
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Regrade surface	\$2,500
Notes: Slope on the swing side of the door is	11.7% (2.0% max).
CBC: 11B-404.2.4.4	
Other: ADA 404.2.4.4	
8 - 3 Door/Gate	Category: 1
Regrade surface	\$2,500
Notes: Slope on the swing side of the door is	7.3% (2.0% max).
CBC: 11B-404.2.4.4	
Other: ADA 404.2.4.4	


Buildir 8 - 4	Door/Gate	Category: 1	
		S2:	50
	r modify sign		50
		ovided in passageway for emergency exit.	
	1011		
	ADA 216.4.1, ADA 703.4.1		_
	or modify door threshold	\$12	25
Notes	Threshold has a vertical change of 6" (1/4" max, up to 1/2" with a bevel).	
CBC	11B-404.2.5		
Other	ADA 404.2.5		
8 - 5	Door/Gate	Category: 2	
Provide	or modify door kickplate	\$2	25
Notes	A smooth and uninterrupted kick plate	surface is not provided.	
CBC	11B-404.2.10		
Other	ADA 404.2.10		
8 - 6	Door/Gate	Category: 2	
Provide	or modify door kickplate	\$2	25
Notes	Kick plate is 9.5" above the finish floor	(10" min).	
CBC	11B-404.2.10		
Other	ADA 404.2.10		
18 - 1	Room	Category: 2	
Reposition controls and outlets		\$2	00
-	The light switch is located 56" AFF (15	' min to 48" max).	
CBC	11B-308.2		
Othor	ADA 308.2, ADA 308.2.1		

Building	
19 - 1 Multiple User Restroom	Category: 2
Provide or replace compartment door hardware	\$175
Notes: Compartment door is not self closing (com handles both inside and outside of the doc	• •
CBC: 11B-604.8.1.2	
Other: ADA 604.8.1.2	
Replace or reposition dispenser	\$250
Notes: Height of soap dispenser is 41" AFF and th max).	ne paper towel dispenser is 44" AFF (40"
CBC: 11B-603.5	
Other: -	
Modify lavatory or counter clearances	\$1,500
Notes: Knee space measured at 8" deep from the min). Clear space beneath the lavatory ap	
CBC: 11B-306.3.3	
Other: ADA 306.3, ADA 306.3.3	
Install restroom sign	\$250
Notes: Federal sign not provided.	
CBC: -	
Other: ADA 703	
Modify stall partitions	\$500
Notes: Water closet compartment is 59.5" wide (6	60" min).
CBC: 11B-604.8.1.1	
Other: ADA 604.3.1	
Replace or modify grab bars	\$300
Notes: Toilet seat cover dispenser is 10" above th grab bar).	e grab bar (12" min clear space above
CBC: 11B-609.3	

Building	
19 - 2 Multiple User Restroom	Category: 2
Reposition toilet flush controls	\$750
Notes: Flush control is not located on the wide side on the open side of the fixture).	of the water closet (flush control located
CBC: 11B-604.6	
Other: ADA 604.6	
Provide or replace compartment door hardware	\$175
Notes: Compartment door is not self closing (compa handles both inside and outside of the door	
CBC: 11B-604.8.1.2	
Other: ADA 604.8.1.2	
Replace or reposition dispenser	\$375
Notes: Height of soap dispenser is 43.5" AFF (40" r 44" AFF (40" max). Toilet paper is located 4 11" in front of the water closet (7" min to 9" r	8" AFF (40" max) and the centerline is
CBC: 11B-603.5, 11B-604.7	
Other: ADA 604.7	
Modify lavatory or counter clearances	\$1,500
Notes: Knee space measured at 8" deep from the c (27" min). Clear space beneath the lavatory	-
CBC: 11B-306.3.3	
Other: ADA 306.3, ADA 306.3.3	
Install restroom sign	\$250
Notes: Federal required sign is not provided.	
CBC: -	
Other: ADA 703	
Remove overhanging or protruding objects	\$125
Notes: Paper towel dispenser protrudes 9.25" from protrude no more than 4" where the lower e	
CBC: 11B-307.2	
Other: ADA 307.2	
Replace or modify grab bars	\$300
Notes: Toilet seat cover dispenser is located 7.5" a	bove the grab bar (12" min clear space
above grab bar).	
above grab bar). CBC: 11B-609.3	

Building	
33 - 1 Outdoor Constructed Features	Category: 2
Increase or provide clear floor area	\$700
Notes: A clear floor space is not provided adjacen	t to the bench (36" by 48" min).
CBC: -	
Other: AGODA 1011.2.1	
Provide an accessible path of travel	\$360
Notes: An accessible route to the fixed bench is n sand.	ot provided. Route is 9 linear feet over
CBC: -	
Other: AGODA 1011.2.1	
35 - 1 Other	Category: 2
Provide an accessible path of travel	\$40
Notes: An accessible route is not provided to sunk (5.0 max).	ken plaza due to 4" of 31% running slope
CBC: 11B-206.2	
Other: ADA 206.2	

Quinlan Community Center Building 10350 Torre Ave Cupertino, CA

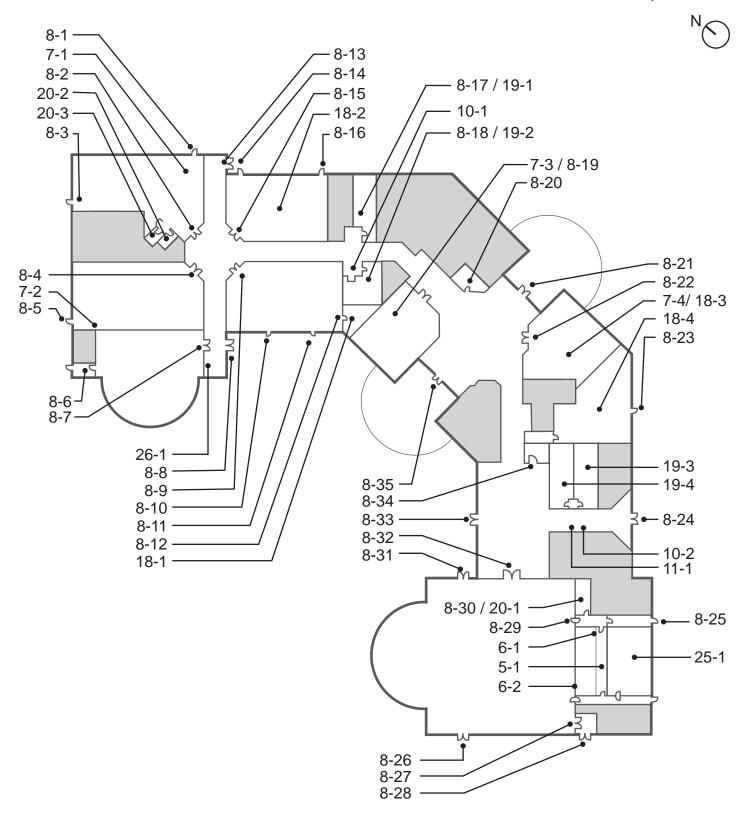

Quinlan Community Center

Building	
5 - 1 Ramp	Category: 2
Provide a level landing	\$0
Notes: Top landing is 43.75" wide (60" m clear floor space of the door (72"	in). The bottom landing is 40" and overlaps the min).
CBC: 11B-405.7	
Other: ADA 405.7	
6 - 1 Stairway	Category: 4
Install tread striping	\$30
Notes: No tread striping provided on two	risers.
CBC: 11B-504.4.1	
Other: -	
Install a handrail	\$125
Notes: A sloped extension of 20" is provi min sloped and an additional 12"	ded at the bottom of the handrail (one tread-width parallel).
CBC: 11B-505.10.3	
Other: ADA 505.10.3	
Repair stair nosing	\$250
Notes: Tread nosing overhangs riser hori depth of .5" (rounded with a radius	izontally at 90 degrees (30 degrees max) at a s of 1/2" max).
CBC: 11B-504.5	
Other: ADA 504.5	
Raise or lower existing handrail	\$100
Notes: Handrail top surface is mounted 3 max).	30.5"-33.25" above the stair nosing (34" min to 38"
CBC: 11B-505.4	
Other: ADA 505.4	

Quinlan Community Center

Building	
6 - 2 Stairway	Category: 4
Install tread striping	\$30
Notes: No tread striping provided on two rise	rs.
CBC: 11B-504.4.1	
Other: -	
Install a handrail	\$125
Notes: A parallel extension is not provided at extension fans out to the side and doe	
CBC: 11B-505.10.2, 11B-505.10.3	
Other: ADA 505.10.2, ADA 505.10.3	
Raise or lower existing handrail	\$100
Notes: Handrail top surface is mounted 30.5" max).	-33" above the stair nosing (34" min to 38"
CBC: 11B-505.4	
Other: ADA 505.4	
Repair stair nosing	\$125
Notes: Tread nosing overhangs riser horizon depth of .5" (rounded with a radius of	
CBC: 11B-504.5	
Other: ADA 504.5	
7 - 1 Hazard	Category: 2
Remove overhanging or protruding objects	\$0
Notes: Clothes line is mounted between walls	s at 65" AFF (80" min).
CBC: 11B-307.4	
Other: ADA 307.4	
7 - 2 Hazard	Category: 2
Remove overhanging or protruding objects	\$125
Notes: Stereo protrudes 16" from wall at 32.7 mounted below 27" or above 80").	5" AFF (protrusion more than 4" must be
CBC: 11B-307.2	
Other: ADA 307.2	
7 - 3 Hazard	Category: 2
Remove overhanging or protruding objects	\$125
	t 35.75" AFF (protrusion more than 4" must be
mounted below 27" or above 80").	
mounted below 27" or above 80"). CBC: 11B-307.2	

Building	
7 - 4 Hazard	Category: 3
Remove overhanging or protruding objects	\$125
Notes: Street sign display protrudes 7" from the sup (protrusion more than 4" must be mounted b	•
CBC: 11B-307.4	
Other: ADA 307.4	
8 - 1 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: The door opening force is 10 lbs (5 lbs max)	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not provide	d in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
8 - 2 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Double door opening force is 15 lbs and 8 lb	os (5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate surfa- located in the 10" space above the finished	
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Install or modify sign	\$250
Notes: A tactile and Braille permanent room sign is	not provided.
CBC: 11B-216.2	
Other: ADA 216.2	
8 - 3 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: The door opening force is 7 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not provide	d in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
12/19/2014 Building	Page 3
Quinlan Community	Center

Building	
8 - 4 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: The door opening force is 13 lbs (5 lbs m	ax).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille permanent room sign	i is not provided.
CBC: 11B-216.2	
Other: ADA 216.2	
8 - 5 Door/Gate	Category: 1
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate su	rface is not provided.
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
8 - 6 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Double door opening force is 7 lbs and 7	lbs (5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille permanent room sign	i is not provided.
CBC: 11B-216.2	
Other: ADA 216.2	
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate su located in the 10" space above the finisher	
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Replace or modify door threshold	\$125
Notes: 1" square hole, 1" deep in the door thresh	10ld (1/2" max).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	

Building	
8 - 7 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Doors in sequence. The outside door openir	ng force is 7 lbs (5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not provide	d in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Provide strike edge clearance	\$0
movable trash cans (18" min). Front approach of the inside door is 9" due to movable podit edge clearance on the push side of the door min). CBC: 11B-404.2.4.1	um (18" min). Front approach strike-
Other: ADA 404.2.4.1	
8 - 8 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Double door opening force is 11 lbs and 16	lbs (5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not provide	d in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Increase maneuvering space	\$1,000
Notes: The clear floor space on the swing side of th CBC: 11B-404.2.4.1 Other: ADA 404.2.4.2	ne door has a slope of 3.7% (2% max).

8 - 9 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Double door opening force is 7 lbs and 7	7 lbs (5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate so located in the 10" space above the finish	•
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Replace or modify door threshold	\$125
Notes: 1" square hole, 1" deep in the door three	shold (1/2" max).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
Install or modify sign	\$500
Notes: A tactile and Braille permanent room sig sign is not provided for emergency exit.	n is not provided. A tactile and Braille EXIT
CBC: 1011, 11B-216.2	
Other: ADA 216.2, ADA 216.4.1, ADA 703.4.1	
8 - 10 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: The door opening force is 13 lbs (5 lbs n	nax).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Replace or modify door threshold	\$125
Notes: Threshold has a vertical change of 3/4"	(1/4" max, up to 1/2" with a bevel).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	

Building	
8 - 11 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: The door opening force 8 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not provid	ded in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Replace or modify door threshold	\$125
Notes: Threshold has a vertical change of 3/4" (1,	/4" max, up to 1/2" with a bevel).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
8 - 12 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: The door opening force is 11 lbs (5 lbs ma	ax).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Replace or modify door threshold	\$125
Notes: Bevel threshold has a vertical change of 1	" (1/4" max, up to 1/2" with a bevel).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
8 - 13 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Double door opening force is 11 lbs and 1	0 lbs (5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not provid	ded in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Increase maneuvering space	\$1,000
Notes: The clear floor space on the swing side of	the door has a slope of 3.5% (2% max).
CBC: 11B-404.2.4.1	

8 - 14 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: The door opening force is 10 lbs (5 lbs	s max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Increase maneuvering space	\$1,000
Notes: The clear floor space on the swing sid	le of the door has a slope of 3.6% (2% max).
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.2	
8 - 15 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Double door opening force is 7 lbs an	d 7 lbs (5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille permanent room s	sign is not provided.
CBC: 11B-216.2	
Other: ADA 216.2	
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate located in the 10" space above the fin	
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Replace or modify door threshold	\$125
Notes: 1" square hole, 1" deep in the door the	reshold (1/2" max).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	

Building	
8 - 16 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: The door opening force is 7 lbs (5 lb	s max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not	provided in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Increase maneuvering space	\$1,000
Notes: The clear floor space on the swing s	ide of the door has a slope of 3.5% (2% max).
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.2	
8 - 17 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: The door opening force is 9 lbs (5 lb	s max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Provide strike edge clearance	\$2,500
Notes: Front approach strike-edge clearanc	e on the pull side of the door is 5.5" (18" min).
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.1	
8 - 18 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: The door opening force is 12 lbs (5 l	bs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
8 - 19 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Double door opening force is 7 lbs o lbs max).	on one side the second side does not open (5
CBC: 11B-404.2.9	
Other: ADA 404.2.9	

Building 8 - 20 Door/Gate	Category: 2
Adjust door closer	\$0
•	max). (The door can be opened automatically
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille permanent room	
CBC: 11B-216.2	
Other: ADA 216.2	
8 - 21 Door/Gate	Category: 1
Increase maneuvering space	\$1,000
Notes: The clear floor space on the swing sid	
CBC: 11B-404.2.4.1	······
Other: ADA 404.2.4.2	
8 - 22 Door/Gate	Category: 2
Install or modify sign	\$250
Notes: A tactile and Braille permanent room	sign is not provided.
CBC: 1011, 11B-216.2	······
Other: ADA 216.2, ADA 216.4.1, ADA 703.4	.1
Provide or modify door kickplate	\$0
Notes: A smooth and uninterrupted kick plate	e surface is not provided. Door stop is located oor. Door remains open during business hours.
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
8 - 23 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: The door opening force is 10 lbs (5 lb	s max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Increase maneuvering space	\$1,000
Notes: The clear floor space on the swing side	de of the door has a slope of 2.4% (2% max).
CBC: 11B-404.2.4.1	

Buildi	ng	
8 - 24	Door/Gate	Category: 1
Adjust	door closer	\$125
Notes	: Double door opening force is 10 lbs and 11 lbs (5 lbs max).
CBC	C: 11B-404.2.9	
Othe	r: ADA 404.2.9	
Install o	or modify sign	\$250
Notes	s: A tactile and Braille EXIT sign is not provided in p	passageway for emergency exit.
CBC	2: 1011	
Othe	r: ADA 216.4.1, ADA 703.4.1	
Increas	e maneuvering space	\$1,000
Notes	s: The clear floor space on the swing side of the do	oor has a slope of 2.4% (2% max).
CBC	C: 11B-404.2.4.1	
Othe	r: ADA 404.2.4.2	
Replac	e or modify door threshold	\$125
Notes	s: Bevel threshold has a vertical change of 3/4" (1/2	4" max, up to 1/2" with a bevel).
CBC	C: 11B-404.2.5	
Othe	r: ADA 404.2.5	

Building	
8 - 25 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: The door opening force is 6 lbs (5 lbs m	ax).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not pro	vided in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate s in the 10" space above the finished floo	•
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Provide strike edge clearance	\$2,500
Notes: Front approach strike-edge clearance o offset (18" min).	n the pull side of the door is 17.5" with an 8"
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.1	
Increase maneuvering space	\$1,000
Notes: Slope on clear floor space at the pull side	de of the door is 4.1% (2% max).
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.2	
8 - 26 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Double door opening force is 15 lbs and	d 12 lbs (5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not pro	vided in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Increase maneuvering space	\$1,000
Notes: The clear floor space on the swing side	of the door has a slope of 2.7% (2% max).
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.2	

Building	
8 - 27 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Double door opening force is 1	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
	is not provided in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Provide or modify door kickplate	\$225
	ck plate surface is not provided. Panic hardware is
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
8 - 28 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Double door opening force is 1	0 lbs and 12 lbs (5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign i	s not provided in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Replace or modify door threshold	\$125
Notes: 1" square hole, 1" deep in the c	Joor threshold (1/2" max).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
8 - 29 Door/Gate	Category: 2
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kin in the 10" space above the finis	ck plate surface is not provided. Door stop is located shed floor.
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
8 - 30 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: The door opening force is 12 lb	s (5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
12/19/2014	Building Page 13
Quinla	n Community Center

Building 8 - 31 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Double door opening force is 17 lbs	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
	ot provided in passageway for emergency exit.
CBC: 1011	r provided in passageway for emergency exit.
Other: ADA 216.4.1, ADA 703.4.1	
Increase maneuvering space	\$1,000
· ·	side of the door has a slope of 2.6% (2% max).
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.2	
8 - 32 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Double door opening force is 8 lbs	· · · · · · · · · · · · · · · · · · ·
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
nstall or modify sign	\$250
	ot provided in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Install or modify sign	\$250
Notes: A tactile and Braille permanent roo	m sign is not provided.
CBC: 11B-216.2	
Other: ADA 216.2	
8 - 33 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Double door opening force is 7 lbs	and 12 lbs (5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is no	ot provided in passageway for emergency exit.
Notes. A lactile and Draille LATT sign is no	· · · · · · · · · · · · · · · · · · ·
CBC: 1011	······································

Notes: The door opening force is 10lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 Install or modify sign \$250 Notes: A tactile and Braille permanent room sign is not provided. CBC: 11B-216.2 Other: ADA 216.2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. Door stop is located in the 10" space above the finished floor. CBC: 11B-404.2.10 Other: ADA 404.2.10 Provide strike edge clearance \$2,500 Notes: Front approach strike-edge clearance on the pull side of the door has a slope of 10.5" (18" min). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.1 8 - 35 Door/Gate Category: 1 Adjust door closer \$125 Notes: Double door opening force is 12 lbs and 11 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 Increase maneuvering space \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Category: 3	Building	
Notes: The door opening force is 10lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 Install or modify sign \$250 Notes: A tactile and Braille permanent room sign is not provided. CBC: 11B-216.2 Other: ADA 216.2 \$225 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. Door stop is located in the 10" space above the finished floor. CBC: 11B-404.2.10 Other: ADA 404.2.10 Other: ADA 404.2.10 Provide strike edge clearance \$2,500 Notes: Front approach strike-edge clearance on the pull side of the door has a slope of 10.5" (18" min). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.1 Other: ADA 404.2.4.1 Tate and the addition of the door opening force is 12 lbs and 11 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 \$125 Notes: Double door opening force is 12 lbs and 11 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.1 Other: ADA 404.2.4.2 The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.2 <td< th=""><th>8 - 34 Door/Gate</th><th>Category: 2</th></td<>	8 - 34 Door/Gate	Category: 2
CBC: 11B-404.2.9 Other: ADA 404.2.9 Install or modify sign \$250 Notes: A tactile and Braille permanent room sign is not provided. CBC: 11B-216.2 Other: ADA 216.2 Provide or modify door kickplate in the 10" space above the finished floor. CBC: 11B-404.2.10 Other: ADA 404.2.10 Provide strike edge clearance \$2,500 Notes: Front approach strike-edge clearance on the pull side of the door has a slope of 10.5" (18" min). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.1 8 - 35 Door/Gate Category: 1 Adjust door closer \$12 lbs and 11 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 Increase maneuvering space \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 0 ther: ADA 404.2.4.2 10 -1 Drinking Fountain Category: 3 Install an additional high or low fountain is not provided. CBC: 11B-211.2	Adjust door closer	\$125
Other: ADA 404.2.9 \$250 Install or modify sign \$250 Notes: A tactile and Braille permanent room sign is not provided. CBC: 11B-216.2 Other: ADA 216.2 \$225 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. Door stop is located in the 10" space above the finished floor. CBC: 11B-404.2.10 Other: ADA 404.2.10 Other: ADA 404.2.10 Provide strike edge clearance \$2,500 Notes: Front approach strike-edge clearance on the pull side of the door has a slope of 10.5" (18" min). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.1 Category: 1 Adjust door closer \$125 Notes: Double door opening force is 12 lbs and 11 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.2 Category: 3 Increase maneuvering space \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.2 IO - 1 Drinking Fountain Category: 3 Install an additional high or low fountain \$3,000	Notes: The door opening force is 10lbs (5 lbs	max).
Install or modify sign \$250 Notes: A tactile and Braille permanent room sign is not provided. CBC: 11B-216.2 Other: ADA 216.2 \$225 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. Door stop is located in the 10" space above the finished floor. CBC: 11B-404.2.10 Other: ADA 404.2.10 Other: ADA 404.2.10 Provide strike edge clearance \$2,500 Notes: Front approach strike-edge clearance on the pull side of the door has a slope of 10.5" (18" min). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.1 Other: ADA 404.2.4.1 8 - 35 Door/Gate Category: 1 Adjust door closer \$125 Notes: Double door opening force is 12 lbs and 11 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.2 10 - 1 Drinking Fountain Category: 3 Install an additional high or low fountain \$3,000 Notes: A standing person drinking fountain is not provided. CBC: 11B-211.2	CBC: 11B-404.2.9	
Notes: A tactile and Braille permanent room sign is not provided. CBC: 11B-216.2 Other: ADA 216.2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. Door stop is located in the 10" space above the finished floor. CBC: 11B-404.2.10 Other: ADA 404.2.10 Other: ADA 404.2.10 Provide strike edge clearance \$2,500 Notes: Front approach strike-edge clearance on the pull side of the door has a slope of 10.5" (18" min). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.1 Other: ADA 404.2.4.1 8 - 35 Door/Gate Category: 1 Adjust door closer \$125 Notes: Double door opening force is 12 lbs and 11 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.9 \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.2 Category: 3 \$3,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.2 Category: 3 \$3,00	Other: ADA 404.2.9	
CBC: 11B-216.2 Other: ADA 216.2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. Door stop is located in the 10" space above the finished floor. CBC: 11B-404.2.10 Other: ADA 404.2.10 Provide strike edge clearance \$2,500 Notes: Front approach strike-edge clearance on the pull side of the door has a slope of 10.5" (18" min). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.1 8 - 35 Door/Gate Category: 1 Adjust door closer \$12 lbs and 11 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 Other: ADA 404.2.9 Increase maneuvering space \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.1 Other: ADA 404.2.9 Increase maneuvering space \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.2 10 - 1 Drinking Fountain Category: 3 Install an additional high or low fountain is not provided. CBC: 11B-211.2	Install or modify sign	\$250
Other: ADA 216.2 \$225 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. Door stop is located in the 10" space above the finished floor. CBC: 11B-404.2.10 Other: ADA 404.2.10 Other: ADA 404.2.10 Provide strike edge clearance \$2,500 Notes: Front approach strike-edge clearance on the pull side of the door has a slope of 10.5" (18" min). CBC: 11B-404.2.4.1 8 - 35 Door/Gate Category: 1 Adjust door closer \$125 Notes: Double door opening force is 12 lbs and 11 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.9 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.1 Other: ADA 404.2.4.1 The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.2 The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.2 The clear floor space on the swing s	Notes: A tactile and Braille permanent room s	ign is not provided.
Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. Door stop is located in the 10" space above the finished floor. CBC: 11B-404.2.10 Other: ADA 404.2.10 Other: ADA 404.2.10 Provide strike edge clearance \$2,500 Notes: Front approach strike-edge clearance on the pull side of the door has a slope of 10.5" (18" min). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.1 Other: ADA 404.2.4.1 8 - 35 Door/Gate Category: 1 Adjust door closer \$125 Notes: Double door opening force is 12 lbs and 11 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 Other: ADA 404.2.9 Increase maneuvering space \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.9 Category: 3 Increase maneuvering space \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.2 The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.2 IO - 1 Drinking Fountain Category: 3 Install an additional high or low fountain is not provided. </td <td>CBC: 11B-216.2</td> <td></td>	CBC: 11B-216.2	
Notes: A smooth and uninterrupted kick plate surface is not provided. Door stop is located in the 10" space above the finished floor. CBC: 11B-404.2.10 Other: ADA 404.2.10 Provide strike edge clearance \$2,500 Notes: Front approach strike-edge clearance on the pull side of the door has a slope of 10.5" (18" min). \$2,500 CBC: 11B-404.2.4.1 Category: 1 Adjust door closer \$125 Notes: Double door opening force is 12 lbs and 11 lbs (5 lbs max). \$125 CBC: 11B-404.2.9 \$1,000 Other: ADA 404.2.4.1 \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.2 Category: 3 \$3,000 Notes: A standing person drinking fountain is not provided. \$3,000 Notes: A standing person drinking fountain is not provided. CBC: 11B-211.2	Other: ADA 216.2	
in the 10" space above the finished floor. CBC: 11B-404.2.10 Provide strike edge clearance \$2,500 Notes: Front approach strike-edge clearance on the pull side of the door has a slope of 10.5" (18" min). CBC: 11B-404.2.4.1 0ther: ADA 404.2.4.1 8 - 35 Door/Gate Category: 1 Adjust door closer \$12 lbs and 11 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 Other: ADA 404.2.9 Increase maneuvering space \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.2 10 - 1 Drinking Fountain Category: 3 Install an additional high or low fountain is not provided. CBC: 11B-211.2	Provide or modify door kickplate	\$225
Other: ADA 404.2.10 \$2,500 Provide strike edge clearance \$2,500 Notes: Front approach strike-edge clearance on the pull side of the door has a slope of 10.5" (18" min). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.1 Category: 1 Adjust door closer \$125 Notes: Double door opening force is 12 lbs and 11 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.2 Category: 3 Increase maneuvering space \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.2 Category: 3 Install an additional high or low fountain \$3,000 Notes: A standing person drinking fountain is not provided. CBC: 11B-211.2		
Provide strike edge clearance \$2,500 Notes: Front approach strike-edge clearance on the pull side of the door has a slope of 10.5" (18" min). CBC: 11B-404.2.4.1 CBC: 11B-404.2.4.1 Other: ADA 404.2.4.1 8 - 35 Door/Gate Category: 1 Adjust door closer \$125 Notes: Double door opening force is 12 lbs and 11 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.1 Category: 3 Increase maneuvering space \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.2 Category: 3 Install an additional high or low fountain \$3,000 Notes: A standing person drinking fountain is not provided. CBC: 11B-211.2	CBC: 11B-404.2.10	
Notes: Front approach strike-edge clearance on the pull side of the door has a slope of 10.5" (18" min). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.1 8 - 35 Door/Gate Adjust door closer \$125 Notes: Double door opening force is 12 lbs and 11 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 Increase maneuvering space \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.1 Other: ADA 404.2.4.1 Other: ADA 404.2.4.2 10 - 1 Drinking Fountain Category: 3 \$3,000 Notes: A standing person drinking fountain is not provided. CBC: 11B-211.2	Other: ADA 404.2.10	
10.5" (18" min).CBC: 11B-404.2.4.1Other: ADA 404.2.4.18 - 35 Door/GateAdjust door closerAdjust door closer\$125Notes: Double door opening force is 12 lbs and 11 lbs (5 lbs max).CBC: 11B-404.2.9Other: ADA 404.2.9Increase maneuvering space\$1,000Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max).CBC: 11B-404.2.4.1Other: ADA 404.2.4.210 - 1 Drinking FountainCategory: 3Install an additional high or low fountain is not provided.CBC: 11B-211.2	Provide strike edge clearance	\$2,500
Other: ADA 404.2.4.18 - 35Door/GateAdjust door closer\$125Notes: Double door opening force is 12 lbs and 11 lbs (5 lbs max).CBC: 11B-404.2.9Other: ADA 404.2.9Other: ADA 404.2.9Increase maneuvering space\$1,000Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max).CBC: 11B-404.2.4.1Other: ADA 404.2.4.210 - 1Drinking FountainCategory: 3Install an additional high or low fountain\$3,000Notes: A standing person drinking fountain is not provided.CBC: 11B-211.2		on the pull side of the door has a slope of
8 - 35Door/GateCategory: 1Adjust door closer\$125Notes: Double door opening force is 12 lbs and 11 lbs (5 lbs max).CBC: 11B-404.2.9Other: ADA 404.2.90ther: ADA 404.2.9Increase maneuvering space\$1,000Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max).CBC: 11B-404.2.4.10ther: ADA 404.2.4.2Other: ADA 404.2.4.2Category: 3Install an additional high or low fountain\$3,000Notes: A standing person drinking fountain is not provided.CBC: 11B-211.2	CBC: 11B-404.2.4.1	
Adjust door closer\$125Notes: Double door opening force is 12 lbs and 11 lbs (5 lbs max).CBC: 11B-404.2.9Other: ADA 404.2.90Increase maneuvering space\$1,000Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max).CBC: 11B-404.2.4.1Other: ADA 404.2.4.210 - 1Drinking FountainCategory: 3Install an additional high or low fountain\$3,000Notes: A standing person drinking fountain is not provided.CBC: 11B-211.2	Other: ADA 404.2.4.1	
Notes: Double door opening force is 12 lbs and 11 lbs (5 lbs max).CBC: 11B-404.2.9Other: ADA 404.2.9Increase maneuvering space\$1,000Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max).CBC: 11B-404.2.4.1Other: ADA 404.2.4.210 - 1Drinking FountainCategory: 3Install an additional high or low fountain is not provided.CBC: 11B-211.2	8 - 35 Door/Gate	Category: 1
CBC: 11B-404.2.9 Other: ADA 404.2.9 Increase maneuvering space \$1,000 Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max). CBC: 11B-404.2.4.1 Other: ADA 404.2.4.2 10 - 1 Drinking Fountain Category: 3 Install an additional high or low fountain \$3,000 Notes: A standing person drinking fountain is not provided. CBC: 11B-211.2	Adjust door closer	\$125
Other: ADA 404.2.9\$1,000Increase maneuvering space\$1,000Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max).CBC: 11B-404.2.4.1Other: ADA 404.2.4.210 - 1Drinking FountainCategory: 3Install an additional high or low fountain\$3,000Notes: A standing person drinking fountain is not provided.CBC: 11B-211.2	Notes: Double door opening force is 12 lbs ar	nd 11 lbs (5 lbs max).
Increase maneuvering space\$1,000Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max).CBC: 11B-404.2.4.1Other: ADA 404.2.4.210 - 1Drinking FountainCategory: 3Install an additional high or low fountain\$3,000Notes: A standing person drinking fountain is not provided.CBC: 11B-211.2	CBC: 11B-404.2.9	
Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max).CBC: 11B-404.2.4.1CBC: ADA 404.2.4.2Other: ADA 404.2.4.2Install an additional high or low fountainCategory: 3Notes: A standing person drinking fountain is not provided.CBC: 11B-211.2	Other: ADA 404.2.9	
Notes: The clear floor space on the swing side of the door has a slope of 3% (2% max).CBC: 11B-404.2.4.1CBC: ADA 404.2.4.2Other: ADA 404.2.4.2To inking FountainCategory: 3Install an additional high or low fountain\$3,000Notes: A standing person drinking fountain is not provided.CBC: 11B-211.2	Increase maneuvering space	\$1,000
Other: ADA 404.2.4.2 Category: 3 10 - 1 Drinking Fountain Category: 3 Install an additional high or low fountain \$3,000 Notes: A standing person drinking fountain is not provided. CBC: 11B-211.2		e of the door has a slope of 3% (2% max).
10 - 1Drinking FountainCategory: 3Install an additional high or low fountain\$3,000Notes: A standing person drinking fountain is not provided.CBC: 11B-211.2	CBC: 11B-404.2.4.1	
Install an additional high or low fountain\$3,000Notes: A standing person drinking fountain is not provided.CBC: 11B-211.2	Other: ADA 404.2.4.2	
Install an additional high or low fountain\$3,000Notes: A standing person drinking fountain is not provided.CBC: 11B-211.2	10 - 1 Drinking Fountain	Category: 3
Notes: A standing person drinking fountain is not provided. CBC: 11B-211.2		\$3,000
CBC: 11B-211.2		· ·

Building		
10 - 2 Drinking Fountain	Category: 3	
Install an additional high or low fountain		\$3,000
Notes: Bubbler height is 34" AFF. A standing perso to 43" max).	on water fountain is not provi	
CBC: 11B-211.2		
Other: ADA 211.2		
11 - 1 Telephone	Category: 3	
Provide TTY phone		\$1,500
Notes: Text telephone is not provided.		
CBC: 11B-704.4		
Other: ADA 704.4		
Provide new phone equipment		\$0
Notes: Volume control are not provided.		
CBC: 11B-217.3, 11B-704.3		
Other: ADA 217.3		
Reposition phone equipment		\$500
Notes: Coin slot is 54" AFF (48" max).		
CBC: 11B-308.3		
Other: ADA 308.3, ADA 308.3.1, ADA 308.3.2		
18 - 1 Room	Category: 4	
Provide clear floor or turning space		\$0
Notes: A turning area of 60" is not provided. Turnin	g space is blocked by mats.	
CBC: 11B-304.3		
Other: ADA 304.3, ADA 304.3.2, ADA 306.3		
18 - 2 Room	Category: 2	
Provide accessible sink		\$3,000
Notes: Sink is 8.5" deep (6.5" max depth).		
CBC: 11B-606.7		
Other: -		
18 - 3 Room	Category: 2	
Provide an accessible room element		\$250
Notes: The doll house exhibit is located 57" AFF (4	8" max).	
CBC: 11B-308.2		
Other: ADA 308.2, ADA 308.2.1		

Building		
18 - 4	Room	Category: 2
Adjust s	shelving, storage, or work space	\$125
Notes	: The locked storage unit is located !	56.25" AFF (15" min to 48" max).
CBC	: 11B-308.3	
Other	: ADA 308.3, ADA 308.3.1, ADA 308	3.3.2

Building	
19 - 1 Multiple User Restroom	Category: 2
Install restroom sign	\$250
Notes: Federal sign is not provided on the men' 65" AFF (60" AFF)	s restroom. The state sign is centered at
CBC: 11B-216.8, 11B-703.7.2.6	
Other: ADA 703	
Replace urinal	\$3,000
Notes: Height of the urinal rim is 18" AFF (17" n	nax).
CBC: 11B-605.2	
Other: ADA 605.2	
Provide or replace compartment door hardwar	r e \$175
Notes: Compartment door does not have handle (compartment door must have U-shaped door and be self-closing).	5
CBC: 11B-604.8.1.2	
Other: ADA 604.8.1.2	
Reposition clothing hooks	\$125
Notes: Height of coat hook is 53.5" (48" max).	
CBC: 11B-308	
Other: ADA 308	
Modify stall partitions	\$500
Notes: The water closet compartment is 58.25"	wide (60" min).
CBC: 11B-604.8.1.1	
Other: ADA 604.3.1	
Replace or reposition fixtures	\$1,250
Notes: Centerline of water closet is 19" from sid	le wall (17" min to 18" max).
CBC: 11B-604.2	
Other: ADA 604.2	
Replace or modify grab bars	\$300
Notes: Side grab bar extends 52.5" from the rea	ar wall (54" min).
CBC: 11B-604.5.1	
Other: ADA 604.5.1	

19 - 1 Multiple User Restroom	Category: 2
Replace or reposition dispenser	\$375
Notes: Toilet seat cover dispenser is located 41" is located 14" in front of the water closet (mechanism of baby changing station is 48 surface is 35" AFF (28" min to 34" max).	7" min to 9" max). Height to operating
CBC: 11B-603.5	
Other: -	
19 - 2 Multiple User Restroom	Category: 2
nstall restroom sign	\$250
Notes: Federal sign is not provided on the womer AFF (60" AFF)	n's restroom. State sign is centered at 66
CBC: 11B-216.8, 11B-703.7.2.6 Other: ADA 703	
Provide or replace compartment door hardware	\$175
Notes: Compartment door does not have handle (compartment door must have U-shaped h door and be self-closing).	0
CBC: 11B-604.8.1.2	
Other: ADA 604.8.1.2	
Reposition clothing hooks	\$125
Notes: Height of coat hook is 50" (48" max).	
CBC: 11B-308	
Other: ADA 308	
Replace or reposition fixtures	\$1,250
Notes: Centerline of water closet is 18.5 from side	e wall (17"min to 18" max).
CBC: 11B-604.2	
Other: ADA 604.2	
Replace or modify grab bars	\$300
Notes: Side grab bar extends 53.75" from the rea	ar wall (54" min).
CBC: 11B-604.5.1	
Other: ADA 604.5.1	
Replace or reposition dispenser	\$375
Notes: Toilet seat cover dispenser is located 42" located 51" AFF (40" max). The baby char max).	
CBC: 11B-603.5	
Other: -	

Building		
19 - 3 Multiple User Restroom	Category: 2	
nstall restroom sign		\$250
Notes: Federal sign is not provided.	State sign is centered at 65.5" AFF (60" AFF	-)
CBC: 11B-216.8, 11B-703.7.2.6		
Other: ADA 703		
Replace or reposition dispenser		\$250
•	located 42" AFF (40" max). Centerline of to vater closet (7" min to 9" max).	ilet paper
CBC: 11B-603.5, 11B-604.7		
Other: ADA 604.7		
Nodify lavatory or counter clearance	\$S	\$1,500
Notes: Height of the lavatory apron is	s 25-5/8" AFF (29" min).	
CBC: 11B-306.3.1		
Other: -		
Provide or replace compartment doo	or hardware	\$175
•	have handle in side the door and is not self- e U-shaped handles both inside and outside	-
CBC: 11B-604.8.1.2		
Other: ADA 604.8.1.2		
Modify stall partitions		\$500
Notes: The water closet compartment	nt is 58" wide (60" min).	
CBC: 11B-604.8.1.1		
Other: ADA 604.3.1		
Replace or modify grab bars		\$600
Notes: Side grab bar extends 53.75" provided (36" min long, cente	from the rear wall (54" min). Rear grab bar i r at 12" and 24").	is not
CBC: 11B-604.5.1		
Other: ADA 604.5.1		
Provide clear floor or turning space		\$3,000
Notes: Clear space in front of the urin 48" deep min).	nal is 28.5" wide with a 25" privacy shield (30	0" wide by
CBC: 11B-305		
Other: ADA 305.5		
Replace urinal		\$3,000
Notes: Height of the urinal rim is 17.5	5" AFF (17" max).	
CBC: 11B-605.2		
Other: ADA 605.2		
12/19/2014	Building	Page 2
<u>∧</u>	an Community Contar	

Building	
19 - 3 Multiple User Restroom	Category: 2
Provide or modify urinal shields	\$1,000
Notes: Urinal shields are 28.5" apart and extend they extend 24 inches past the front of the	
CBC: 11B-305.7.1, 11B-605.3	
Other: ADA 305.3, ADA 305.7.1, ADA 605.3	

19 - 4 Multiple User Restroom	Category: 2
nstall restroom sign	\$250
Notes: Federal sign is not provided. State sign is o	entered at 66" AFF (60" AFF)
CBC: 11B-216.8, 11B-703.7.2.6	
Other: ADA 703	
Provide or replace compartment door hardware	\$175
Notes: Compartment door does not have handles (compartment door must have U-shaped h door and be self-closing).	
CBC: 11B-604.8.1.2	
Other: ADA 604.8.1.2	
Reposition clothing hooks	\$125
Notes: Height of coat hook is 51.5" (48" max).	
CBC: 11B-308	
Other: ADA 308	
Modify stall partitions	\$500
Notes: The water closet compartment is 58.75" wi	de (60" min).
CBC: 11B-604.8.1.1	
Other: ADA 604.3.1	
Replace or modify grab bars	\$600
Notes: Side grab bar extends 53.75" from the real provided (36" min long, centered at 12" and	
CBC: 11B-604.5.1	
Other: ADA 604.5.1	
Replace or reposition dispenser	\$250
Notes: Toilet seat cover dispenser is located 42" A is located 3" in front of the water closet (7"	
CBC: 11B-603.5	
Other: -	
Provide an accessible lavatory	\$3,000
Notes: Centerline of lavatory to side wall is 12.5" (18" min).
CBC: 11B-606.6	
Other: -	
Modify lavatory or counter clearances	\$1,500
Notes: Height of the lavatory apron is 28.75" AFF	(29" min).
CBC: 11B-306.3.1	
Other: -	

Building		
19 - 4	Multiple User Restroom	Category: 2
Provide a	n additional front transfer stall	\$2,500
Notes:	An ambulatory compartment is not provi	ded in a restroom with 6 compartments.
	11B-213.3.1	
Other:	ADA 213.3.1, ADA 604.8.1, ADA 604.8.2	2
	Single User Restroom	Category: 2
-	stroom sign	\$500
Notes:		s not a triangle shape and is centered 65.5"
CBC:	11B-216.8, 703.7.2.6	
	ADA 703	
Replace of	or reposition mirror	\$150
	Bottom of the mirror's reflecting surface	•
	11B-603.3	
Other:	ADA 603.3	
Replace of	or reposition fixtures	\$1,250
•	Centerline of water closet is 18.5" from s	
	11B-604.2	
	ADA 604.2	
Replace of	or modify grab bars	\$600
	Side grab bar extends 52" from the rear (36" long min, centered at 12" and 24").	wall (54" min). Rear grab bar is 25.25" long
CBC:	11B-604.5.1	
Other:	ADA 604.5.1	
Modify la	vatory or counter clearances	\$1,500
	Height of the lavatory rim is 34.5" AFF (3	34" max).
CBC:	11B-606.3	
Other:	ADA 606.3	
Provide a	n accessible lavatory	\$3,000
	Centerline of lavatory to side wall is 13	(18" min).
CBC:	11B-606.2	·
Other:	-	
Replace of	or reposition dispenser	\$375
Notes:	Soap dispenser is located 49" AFF (40"	-
CBC:	11B-603.5	
Other:		
12/19/201	4 Buildin	g Page 2

Building	
20 - 2 Single User Restroom	Category: 2
Replace or modify grab bars	\$300
Notes: Rear grab bar is not provided (36" long min, exte	ends 12" and 24" min from
centerline of water closet).	
CBC: 11B-604.5.2	
Other: ADA 604.5.2	
Modify stall partitions	\$500
Notes: Clear width of water closet compartment is 59.2	5" (60" min).
CBC: 11B-604.8.1.1	
Other: ADA 604.3.1, ADA 604.8.1	
Replace or reposition dispenser	\$250
Notes: Toilet seat cover dispenser is 50" AFF (40" AFF	max). Centerline of toilet paper is
flush with the water closet (7" min to 9" max).	
CBC: 11B-603.5, 11B-604.7	
Other: ADA 604.7	
Replace or adjust water controls	\$500
Notes: Flush control is not located on the wide side of t	he water closet.
CBC: 11B-606.4	
Other: ADA 309.4, ADA 606.4	
Replace or reposition fixtures	\$1,250
Notes: Centerline of water closet is 19" from side wall (17" min to 18" max).
CBC: 11B-604.2	
Other: ADA 604.2	
Install restroom sign	\$500
Notes: Required federal and state signs not provided.	
CBC: 11B-216.8, 703.7.2.6	
Other: ADA 703	
	\$0
Notes:	
CBC: -	
Other: -	

Building	
20 - 3 Single User Restroom	Category: 2
Modify grab bars	\$200
Notes: Side grab bar extends 53.5" from the re-	ar wall (54" min).
CBC: 11B-604.9	
Other: ADA 604.9, ADA 609.4	
Modify stall partitions	\$500
Notes: Clear width over water closet compartm	ent is 58" (60" min).
CBC: 11B-604.8.1.1	
Other: ADA 604.3.1, ADA 604.8.1	
Replace or reposition dispenser	\$125
Notes: Toilet seat cover dispenser is 50" AFF (water closet (7" min to 9" max).	40" AFF max). Toilet paper is 23.5" from the
CBC: 11B-603.5	
Other: -	
Replace or adjust water controls	\$500
Notes: Flush control is not located on the wide	side of the water closet.
CBC: 11B-606.4	
Other: ADA 309.4, ADA 606.4	
Replace or reposition fixtures	\$1,250
Notes: Center line of water closet is 19" from si	ide wall (17" min to 18" max).
CBC: 11B-604.2	
Other: ADA 604.2	
Provide clear floor or turning space	\$3,000
Notes: A 60" min diameter turning space unobs is not provided.	structed from the floor to a height of 27" min
CBC: 11B-305.5	
Other: ADA 305.3, ADA 305.5	
Install restroom sign	\$500
Notes: Required federal and state signs not pro	ovided.
CBC: 11B-216.8, 703.7.2.6	
Other: ADA 703	


Quinlan Community Center

25 - 1	Kitchen	Category: 2
Repair s	surface	\$2
Notes:	: 0.75" grate openings oriented in the perpendicular to the path of travel).	direction of the path of travel (1/2" max open
CBC:	: 11B-804.3.3	
Other:	: ADA 804.3.3	
Modify c	counter height	\$1,5
Notes:	: Height of kitchen work surface is 36-	-3/4" AFF (28" AFF min to 34" AFF max).
CBC:	: 11B-804.3.2	
Other:	: ADA 804.3.2	
26 - 1	Eating Area	Category: 3
Replace	or modify vending machine	
Notes:		achine is located 53.5" AFF (15" min to 48" vending machine is located 49.5" AFF (15" m
		cold drink vending machine is located 53" AF ney insert slot on the cold drink vending nin to 48" max).
	48" max). The coin return push butto	soda machine is located 54.5" AFF (15" min t on on the soda machine is located 52.5" AFF e in the Soda vending machine is 62.5" AFF
	· · · · · · · · · · · · · · · · · · ·	
CBC:	: 11B-308	

Other: ADA 308.2.1, ADA 308.3, ADA 308.3.1

Quinlan Community Center 10350 Torre Ave Cupertino, CA

N T

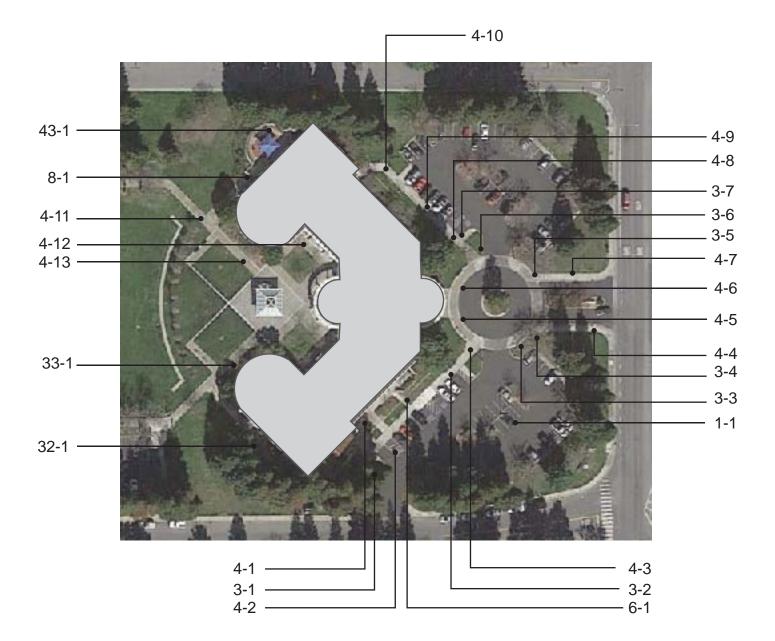


Exterior	
1 - 1 Parking Area	Category: 1
Provide adequate striping	\$100
Notes: Accessible parking space is 16' long (18' mir	ו).
CBC: 11B-502.2	
Other: ADA 502.2	
Regrade accessible parking space or access aisle	\$1,600
Notes: Slopes of parking spaces and access aisles	are 3.4% to 3.2% (2.0% max).
CBC: 11B-502.4	
Other: ADA 502.4	
3 - 1 Curb Ramp	Category: 1
Provide a level landing	\$90
Notes: The turning space at the bottom of the paral max). Top landing has a slope of 2.6% (2% CBC: 11B-406.3.2	• • •
Other: -	
3 - 2 Curb Ramp	Category: 1
Provide a level landing	\$90
Notes: Top landing has a slope of 2.8% (2% max).	
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Install, replace or modify curb ramp	\$2,460
Notes: Last 16" of the curb ramp have a slope of 13	8.4% (8.33% max).
CBC: 11B-405.2, 11B-406	···········
Other: ADA 405.2, ADA 406.1	
3 - 3 Curb Ramp	Category: 1
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 10.3% (8.33% max	x).
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Provide a level landing	\$90
Notes: Top landing has a slope of 4% (2% max).	
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	

3 - 4 Curb Ramp	Category: 1
Provide detectable warnings	\$0
Notes: Detectable warnings not provided on	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Install, replace or modify curb ramp	\$2,460
Notes: Bottom 3" of the curb ramp have a sl	
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	
3 - 5 Curb Ramp	Category: 1
Install, replace or modify curb ramp	\$2,460
Notes: Bottom 3" of the curb ramp have a sl	
CBC: 11B-405.2, 11B-406	/
Other: ADA 405.2, ADA 406.1	
Provide detectable warnings	\$0
Notes: Detectable warnings not provided on	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
3 - 6 Curb Ramp	Category: 1
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 11.7% and	up to 19.8 at curb (8.33% max).
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	
3 - 7 Curb Ramp	Category: 1
Provide a level landing	\$90
	max). The turning space at the bottom of the
CBC: 11B-406.3.2, 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 10.3% and a slope of 20.2% (8.33% max).	the last 3" at the bottom of the curb ramp have
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
12/19/2014 Ext	erior Page 2
	munity Contor

Exterior	
4 - 1 Walk	Category: 1
Regrade surface	\$2,600
Notes: Cross slope of concrete path is up	to 3.3% for 65 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 2 Walk	Category: 1
Regrade surface	\$2,600
Notes: Cross slope of concrete path is up	to 4.5% for 65 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 3 Walk	Category: 1
Regrade surface	\$1,840
Notes: Cross slope of concrete path is up	o to 4% for 46 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 4 Walk	Category: 1
Regrade surface	\$1,240
Notes: Cross slope of concrete path is up	to 3.1% for 31 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 5 Walk	Category: 1
Grind or patch vertical change of grade	\$250
Notes: 1" change in level at concrete join	t (1/4" max, up to 1/2" with a bevel).
CBC: 11B-303.2	
Other: ADA 303.2, ADA 303.3	
4 - 6 Walk	Category: 1
Regrade surface	\$400
Notes: Cross slope of concrete path is up	o to 2.5% for 10 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 7 Walk	Category: 1
Regrade surface	\$2,240
Notes: Cross slope of concrete path is up	to 3.4% for 56 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	

Exterior		
4 - 8 Walk	Category: 1	
Regrade surface		\$400
Notes: Cross slope of concrete path is up to 2.6%	6 for 10 linear feet (2.0% max).	
CBC: 11B-403.3		
Other: ADA 403.3		
4 - 9 Walk	Category: 1	
Regrade surface		\$960
Notes: Cross slope of concrete path is up to 3%	for 24 linear feet (2.0% max).	
CBC: 11B-403.3		
Other: ADA 403.3		
4 - 10 Walk	Category: 1	
Regrade surface		\$600
Notes: Cross slope of concrete path is up to 2.7%	6 for 15 linear feet (2.0% max).	
CBC: 11B-403.3		
Other: ADA 403.3		
4 - 11 Walk	Category: 2	
Grind or patch vertical change of grade		\$250
Notes: .5" marked change of level at concrete joi	nt (1/4" max, up to 1/2" with a be	vel).
CBC: 11B-303.2		
Other: ADA 303.2, ADA 303.3		
4 - 12 Walk	Category: 2	
Regrade surface		\$1,200
Notes: Cross slope of concrete path is up to 2.9%	6 for 30 linear feet (2.0% max).	
CBC: 11B-403.3		
Other: ADA 403.3		
4 - 13 Walk	Category: 2	
Regrade surface		\$400
Notes: Cross slope of concrete path is up to 2.5%	6 for 10 linear feet (2.0% max).	
CBC: 11B-403.3		

Exterior 6 - 1 Stairway	Category: 1
Install a handrail	\$1,250
Notes: Handrails are not provided on either side of both sides req).	
CBC: 11B-505.2	
Other: ADA 505.2	
Replace stairs	\$1,200
Notes: Slope of the treads is 7.2% (2% max). 1.25 bottom of the stairs (uniform heights require	
CBC: 11B-504.2, 11B-504.4	
Other: ADA 504.2, ADA 504.4	
32 - 1 Picnic Area	Category: 2
Provide an accessible picnic unit	\$6,400
Notes: An accessible table is not provided in a picn	ic area with 4 tables. (2 required).
CBC: 11B-246.5	
Other: -	
33 - 1 Outdoor Constructed Features	Category: 4
Increase or provide clear floor area	\$700
Notes: Clear floor space adjacent to the bench has	a slope of 2.6% (2.0% max).
CBC: -	
Other: AGODA 1011.2.1	
43 - 1 Play Equipment Area	Category: 2
Install or modify transfer system	\$15,000
Notes: Transfer step heights range from 7.5"-8.25"	(8" max).
CBC: 11B-1008.3.2.1, 11B-1008.3.2.2	
Other: ADA 1008.3.2.1, ADA 1008.3.2.2	
Provide an accessible path of travel	\$40
Notes: Drain grate with 1"x.75" openings adjacent t	to play area (.5" max opening).
CBC: 11B-206.2.17	
Other: ADA 206.2.17	

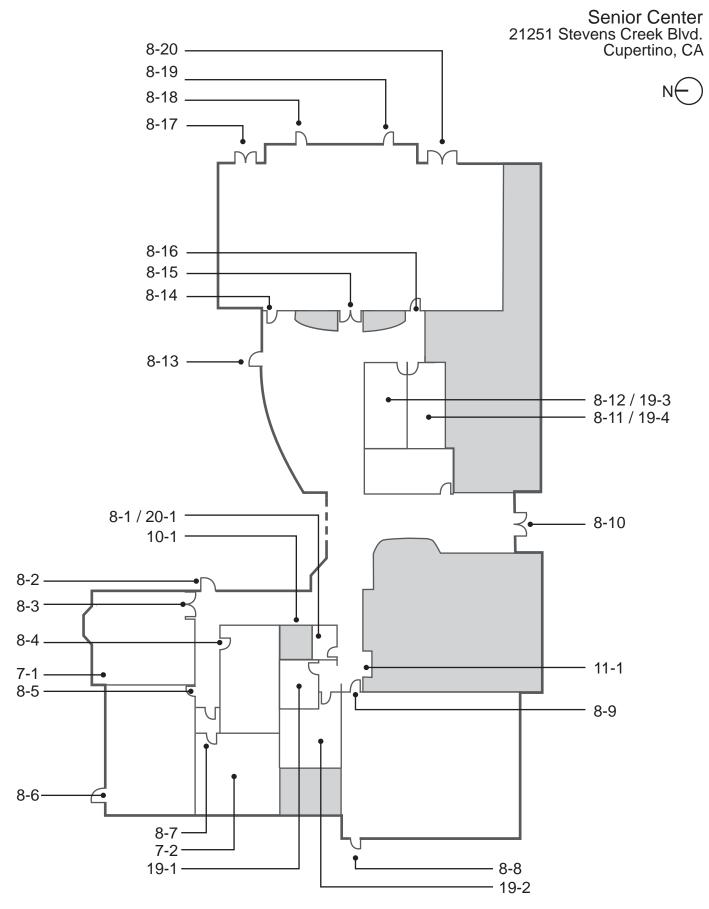

Building	
7 - 1 Hazard	Category: 4
Remove overhanging or protruding objects	\$125
Notes: VCR protrudes 20" from wall at 76.5" AFF mounted below 27" or above 80").	(protrusion more than 4" must be
CBC: 11B-307.2	
Other: ADA 307.2	
7 - 2 Hazard	Category: 4
Remove overhanging or protruding objects	\$0
Notes: VCR protrudes 20" from wall at 79.5" AFF mounted below 27" or above 80"). Coat ra	
CBC: 11B-307.2	
Other: ADA 307.2	
8 - 1 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Door opening force is 12 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
8 - 2 Door/Gate	Category: 1
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not provi	ded in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Adjust door closer	\$125
Notes: Door opening force is 14 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
8 - 3 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Double door opening force is 10 lbs on or	ne door and 9 lbs on the other (5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	

Building	
8 - 4 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Door opening force is 11 lbs (5 lbs ma	ax).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: The bottom of the top row of tactile le	ttering is located 61" AFF (60" max).
CBC: 11B-703.4.1	
Other: ADA 703.4.1	
Relocate existing sign	\$125
Notes: The room sign is located on the hinge	e side of the door (latch-side).
CBC: 11B-703.4.2	
Other: ADA 703.4.2	
8 - 5 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Door opening force is 12 lbs (5 lbs ma	ax).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
8 - 6 Door/Gate	Category: 1
Locked or Alarmed Door - Not Surveyed	\$0
Notes: Door not surveyed.	
CBC: -	
Other: -	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not p	provided in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Relocate existing sign	\$125
Notes: The door sign is on the hinge side of	the door (latch-side).
CBC: 11B-703.4.2	
Other: ADA 703.4.2	

Building	
8 - 7 Door/Gate	Category: 2
Install or modify sign	\$250
Notes: Bottom line of tactile lettering on perm	anent room sign is 61.25" AFF (60" max).
CBC: 11B-703.4.1	
Other: ADA 703.4.1	
Adjust door closer	\$125
Notes: Door opening force is 12 lbs (5 lbs ma	x).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Provide strike edge clearance	\$0
Notes: Front approach strike-edge clearance movable trash can and furniture (18" n	•
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.1	
8 - 8 Door/Gate	Category: 1
Locked or Alarmed Door - Not Surveyed	\$0
Notes: Door not surveyed.	
CBC: -	
Other: -	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not p	rovided in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
8 - 9 Door/Gate	Category: 2
Install or modify sign	\$250
Notes: The bottom of the top row of tactile let	tering is located 61.5" AFF (60"max).
CBC: 11B-703.4.1	
Other: ADA 703.4.1	
Adjust door closer	\$125
Notes: Door opening force is 9 lbs (5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Provide strike edge clearance	\$0
Notes: Front approach strike-edge clearance	on the push side of the door is 2" due to
movable table (18" min).	•
	•

Building	
8 - 10 Door/Gate	Category: 1
Regrade surface	\$2,500
Notes: There is a 3/4" wide 1-1/2" deep gap at	
max opening).	· · · · · · · · · · · · · · · · · · ·
CBC: 11B-404.2.4.4	
Other: ADA 404.2.4.4	
Adjust door closer	\$125
Notes: Double doors, one door is automatic and	d the other door opening force is 12 lbs (5
lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
8 - 11 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Door opening force is 7 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: Bottom of top row of tactile lettering is 6	2" AFF (60" max).
CBC: 11B-703.4.1	
Other: ADA 703.4.1	
8 - 12 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Door opening force is 7 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: Bottom of top row of tactile lettering is 6	2" AFF (60" max).
CBC: 11B-703.4.1	
Other: ADA 703.4.1	
8 - 13 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Door opening force is 14 lbs (5 lbs max)	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not pro	
CBC: 1011	· · · · · · · · · · · · · · · · · · ·
Other: ADA 216.4.1, ADA 703.4.1	
12/19/2014 Buildir	ng Page 4
Senior C	•

Building	
8 - 14 Door/Gate	Category: 2
Install or modify sign	\$250
Notes: The clear floor space at the tactile sign i lettering is 61" AFF (48" AFF min to 60"	
CBC: 11B-703.4.2	
Other: ADA 703.4.2	
Provide strike edge clearance	\$2,500
Notes: Front approach strike-edge clearance of	n the pull side of the door is 16" (18" min).
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.1	
8 - 15 Door/Gate	Category: 2
Install or modify sign	\$250
Notes: A tactile and Braille permanent room sig	ın is not provided.
CBC: 11B-216.2	
Other: ADA 216.2	
Adjust door closer	\$125
Notes: Double door opening force is 13 lbs on o	one side and 11 lbs on the other(5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
8 - 16 Door/Gate	
	Category: 2
Adjust door closer	Category: 2 \$125
Adjust door closer Notes: Door opening force is 7 lbs (5 lbs max).	
-	
Notes: Door opening force is 7 lbs (5 lbs max).	
Notes: Door opening force is 7 lbs (5 lbs max). CBC: 11B-404.2.9	
Notes: Door opening force is 7 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9	\$125
Notes: Door opening force is 7 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 8 - 17 Door/Gate	\$125 Category: 1 \$125
Notes: Door opening force is 7 lbs (5 lbs max). CBC: 11B-404.2.9 Other: ADA 404.2.9 8 - 17 Door/Gate Adjust door closer	\$125 Category: 1 \$125
Notes: Door opening force is 7 lbs (5 lbs max).CBC: 11B-404.2.9Other: ADA 404.2.98 - 17Door/GateAdjust door closerNotes: Double door opening force is 15 lbs and	\$125 Category: 1 \$125
Notes: Door opening force is 7 lbs (5 lbs max).CBC: 11B-404.2.9Other: ADA 404.2.98 - 17Door/GateAdjust door closerNotes: Double door opening force is 15 lbs and CBC: 11B-404.2.9	\$125 Category: 1 \$125
Notes: Door opening force is 7 lbs (5 lbs max).CBC: 11B-404.2.9Other: ADA 404.2.98 - 17Door/GateAdjust door closerNotes: Double door opening force is 15 lbs and CBC: 11B-404.2.9Other: ADA 404.2.9	\$125 Category: 1 \$125 I 12 (5 lbs max). \$250
Notes: Door opening force is 7 lbs (5 lbs max).CBC: 11B-404.2.9Other: ADA 404.2.98 - 17 Door/GateAdjust door closerNotes: Double door opening force is 15 lbs and CBC: 11B-404.2.9Other: ADA 404.2.9Install or modify sign	\$125 Category: 1 \$125 I 12 (5 lbs max). \$250

Building	
	egory: 1
Adjust door closer	\$125
Notes: Door opening force is 11 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not provided in passagewa	ay for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
8 - 19 Door/Gate Cate	egory: 1
Adjust door closer	\$125
Notes: Door opening force is 16 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not provided in passagewa	ay for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
8 - 20 Door/Gate Cate	egory: 1
Adjust door closer	\$125
Notes: Double door opening force is 16 lbs and 16 lbs (5 lbs max)	•
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
10 - 1Drinking FountainCate	egory: 3
Raise or lower fountain	\$1,500
Notes: Space between floor/ground and bottom of fountain is 26-3	3/8" (27" min).
CBC: 11B-306.3	
Other: ADA 306.3, ADA 306.3.1	

Building	
11 - 1TelephoneC	Category: 3
Provide TTY phone	\$1,500
Notes: TTY is not provided on the public phone	
CBC: 11B-704.4	
Other: ADA 704.4	
Reposition phone equipment	\$500
Notes: Coin slot is 54.5" AFF (48" max).	
CBC: 11B-308.3	
Other: ADA 308.3, ADA 308.3.1, ADA 308.3.2	
Provide clear floor space	\$1,000
Notes: Clear floor space under the public phone is 25.25" due to phone (30" by 48").	o counter beneath the
CBC: 11B-704.2.1	
Other: ADA 305.3, ADA 704.2.1	

Building	
19 - 1 Multiple User Restroom	Category: 2
Install restroom sign	\$250
Notes: Bottom of top row of tactile lettering is 62"	AFF (60" max).
CBC: -	
Other: ADA 703	
Replace or reposition mirror	\$150
Notes: Bottom of the mirror's reflecting surface is	41" AFF (40" max).
CBC: 11B-603.3	
Other: ADA 603.3	
Reposition toilet flush controls	\$750
Notes: Water closet flush control is located 48" A	FF (44" max).
CBC: 11B-604.6	
Other: ADA 604.6	
Provide or replace compartment door hardware	\$175
closing (compartment door must have U-s the door and be self-closing). CBC: 11B-604.8.1.2	haped handles both inside and outside of
Other: ADA 604.8.1.2	
Reposition clothing hooks	\$125
Notes: Height of coat hook is 49" (48" max).	
CBC: 11B-603.4	
Other: ADA 308	
Replace or modify grab bars	\$300
Notes: Side grab bar extends 51" from the rear w	all (54" min).
CBC: 11B-604.5.1	
Other: ADA 604.5.1	
Replace or reposition dispenser	\$125
Notes: Toilet seat cover dispenser height is 42" A	FF (40" max).
CBC: 11B-603.5	
Other: -	
Provide an accessible lavatory	\$3,000
Notes: The centerline of the lavatory is 17.5" betw fixture (18" min).	veen the side wall and the center of the
CBC: 11B-606.6	
Other: -	

Building	
19 - 2 Multiple User Restroom	Category: 2
Install restroom sign	\$250
Notes: Bottom of top row of tactile lettering is 62"	AFF (60" max).
CBC: -	
Other: ADA 703	
Replace or reposition mirror	\$150
Notes: Bottom of the mirror's reflecting surface is	41.5" AFF (40" max).
CBC: 11B-603.3	
Other: ADA 603.3	
Provide or replace compartment door hardware	\$175
Notes: Compartment door is not self-closing (com handles both inside and outside of the door	
CBC: 11B-604.8.1.2	
Other: ADA 604.8.1.2	
Reposition clothing hooks	\$125
Notes: Height of coat hook is 48.5" (48" max).	
CBC: 11B-603.4	
Other: ADA 308	
Replace or modify grab bars	\$600
Notes: Side grab bar extends 53" from the rear wa 22.25" from on side of the water closet (36	
CBC: 11B-604.5.1	
Other: ADA 604.5.1	
Replace or reposition dispenser	\$375
Notes: Paper towel dispenser is located 48.5" AFI 42" AFF (40" max). Centerline of toilet pap min to 9" max).	
CBC: 11B-603.5, 11B-604.7	
Other: ADA 604.7	

Building	
19 - 3 Multiple User Restroom	Category: 2
Replace or reposition mirror	\$150
Notes: Bottom of the mirror's reflecting surface is 4	10.5" AFF (40" max).
CBC: 11B-603.3	
Other: ADA 603.3	
Provide or replace compartment door hardware	\$175
Notes: Compartment door is not self-closing (comp handles both inside and outside of the door	
CBC: 11B-604.8.1.2	
Other: ADA 604.8.1.2	
Reposition clothing hooks	\$125
Notes: Height of coat hook is 49" (48" max).	
CBC: 11B-603.4	
Other: ADA 308	
Replace or modify grab bars	\$300
Notes: Side grab bar extends 52" from the rear wa	ll (54" min).
CBC: 11B-604.5.1	
Other: ADA 604.5.1	
Replace or reposition dispenser	\$125
Notes: Seat cover dispenser is located 41.5" AFF	(40" max).
CBC: 11B-603.5	
Other: -	
Reposition toilet flush controls	\$750
Notes: Urinal flush control is 48.5" AFF (44" max).	
CBC: 11B-605.4	
Other: -	

Building	
19 - 4 Multiple User Restroom	Category: 2
Replace or reposition mirror	\$150
Notes: Bottom of the mirror's reflecting surface is	s 40.5" AFF (40" max).
CBC: 11B-603.3	
Other: ADA 603.3	
Reposition clothing hooks	\$125
Notes: Height of coat hook is 49" (48" max).	
CBC: 11B-603.4	
Other: ADA 308	
Replace or reposition dispenser	\$250
Notes: Toilet seat cover dispenser height is 42.5 is flush with front of the water closet (7" n	· · · · · · · ·
CBC: 11B-603.5, 11B-604.7	
Other: ADA 604.7	
Replace or modify grab bars	\$600
Notes: Rear grab bar is 22" from on side of the v 24" min from centerline of water closet). S wall (54" min).	vater closet (36" long min, extends 12" and Side grab bar extends 51.5" from the rear
CBC: 11B-604.5.2	
Other: ADA 604.5.2	
Replace or reposition fixtures	\$1,250
Notes: Centerline of water closet is 18.5" to the s	side wall (17" min to 18" max).
CBC: 11B-604.2	
Other: ADA 604.2	

Building	
20 - 1 Single User Restroom	Category: 2
Install restroom sign	\$250
Notes: Bottom of top row of tactile lettering is 6	60" max).
CBC: -	
Other: ADA 703	
Replace or reposition mirror	\$150
Notes: Bottom of the mirror's reflecting surface	e is 40.5" AFF (40" max).
CBC: 11B-603.3	
Other: ADA 603.3	
Replace or reposition dispenser	\$500
Notes: Soap dispenser is 40.5" AFF and toilet max). Diaper changing surface is 36" A mechanism of baby changing station is	FF (34" max). Height to operating
CBC: 11B-603.5	
Other: -	
Replace or modify grab bars	\$600
Notes: Side grab bar extends 51.5" from the re to the centerline of fixture (36" long min water closet).	ear wall (54" min). Rear grab bar extends 21" , extends 12" and 24" min from centerline of
CBC: 11B-604.5.1, 11B-604.5.2	
Other: ADA 604.5.1, ADA 604.5.2	
Reposition clothing hooks	\$125
Notes: Height of coat hook is 54" AFF (48" mail	x).
CBC: 11B-603.4	
Other: ADA 308	
Reposition controls and outlets	\$200
Notes: Light switch is located 48.5" AFF (48" m	nax).
CBC: 11B-308.2	
Other: ADA 308.2, ADA 308.2.1	

Senior Center 21251 Stevens Creek Blvd. Cupertino, CA






Exterior	
1 - 1 Parking Area Categor	ry: 1
Install reserved parking sign	\$375
Notes: No additional sign or additional language is provided stating "M	linimum Fine \$250"
CBC: 11B-502.6.2	
Other: -	
Regrade accessible parking space or access aisle	\$14,400
Notes: Slope of 6 parking spaces and 3 access aisle is up to 3.8% (29)	% max).
CBC: 11B-502.4	
Other: ADA 502.4	
Provide or modify accessible spaces	\$2,945
Notes: No designated van accessible parking space provided.	
CBC: 1011, 11B-208.2	
Other: ADA 208.2.4	
1 - 2Parking AreaCategory	ry: 1
Provide detectable warnings	\$500
Notes: No detectable warning provided at ramp from accessible parking	ng space to walkway.
CBC: 11B-705.1.2	
Other: -	
Provide an accessible path of travel	\$1,600
Notes: There is no accessible route from parking area to the senior ce behind parked cars.	enter without going
CBC: 11B-502.7.1	
Other: ADA 502.3	
Provide or modify accessible spaces	\$0
Notes: 1 designated accessible space is provided for 27 spaces for se min). When aggregated with accessible spaces from parking lo Senior Center building, sufficient accessible spaces are provid	ot closest to the
CBC: 1011, 11B-208.2	
Other: ADA 208.2.4	

Exterior	
3 - 1 Curb Ramp	Category: 1
Provide surface texture	\$0
Notes: Grooved border is 11" wide (12" min).	
CBC: 11B-406.5.11	
Other: -	
Grind or patch vertical change of grade	\$0
Notes: 1/2" change in level at the bottom of the cu	urb ramp (0" allowed).
CBC: 11B-303.2.3, 11B-405.4	
Other: ADA 405.4	
Install, replace or modify curb ramp	\$2,460
Notes: Slope of one flared side is 11.2% (10.0% r	max)
CBC: 11B-406.2.2	
Other: ADA 406.3	
4 - 1 Walk	Category: 1
Regrade surface	\$480
Notes: Cross slope of concrete path is up to 2.9%	o for 12 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 2 Walk	Category: 4
Regrade surface	\$1,040
Notes: Cross slope of concrete path is up to 4.3%	o for 26 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
Grind or patch vertical change of grade	\$250
Notes: 1/2" change in level at concrete joint (1/4"	max, up to 1/2" with a bevel).
CBC: 11B-303.2	
Other: ADA 303.2, ADA 303.3	

Exterior	
10 - 1 Drinking Fountain	Category: 3
Replace fountain	\$3,000
Notes: Bubbler height is 37.5" AFF (accessible founta standing fountain bubbler 38" min to 43" max	
CBC: 11B-602.4, 11B-602.7	
Other: ADA 602.4, ADA 602.7	
Provide wing walls	\$1,000
Notes: Drinking fountain protrudes 17.5" from vertica more than 4" must be mounted below 27" or a	
CBC: 11B-602.8, 11B-602.9	
Other: ADA 307	
Install an additional high or low fountain	\$3,000
Notes: A wheelchair accessible fountain and a highe provided.	r standing person fountain are not
CBC: 11B-211.2	
Other: ADA 211.2	
11 - 1 Telephone	Category: 3
Provide clear floor space	\$1,000
Notes: Clear floor space adjacent to the phone has a	slope of 2.3% (2% max).
CBC: 11B-704.2.1	
Other: ADA 305.3, ADA 704.2.1	
Provide new phone equipment	\$0
Notes: Phone cord length is 28.5" (29" min).	
CBC: 11B-704.2.4	
Other: ADA 704.2.4	
Reposition phone equipment	\$500
Notes: Coin slot is 53.5" AFF (48" max).	
CBC: 11B-308.3	
Other: ADA 308.3, ADA 308.3.1, ADA 308.3.2	
33 - 1 Outdoor Constructed Features	Category: 4
Increase or provide clear floor area	\$700
Notes: A clear floor space is not provided adjacent to (36" by 48" min).	two benches due to trash container
CBC: -	
Other: AGODA 1011.2.1	

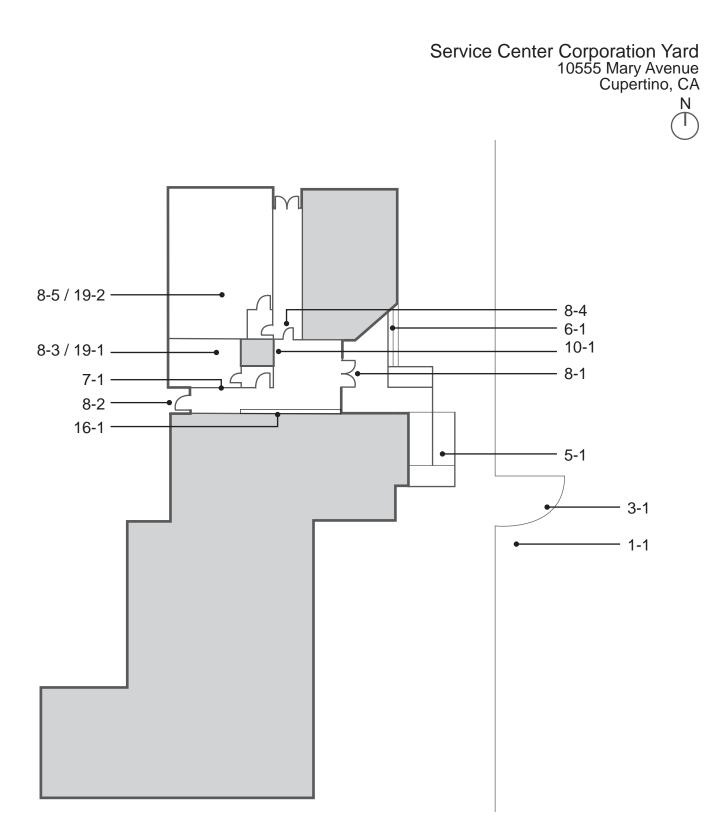

Building	
1 - 1 Parking Area	Category: 1
Provide or modify accessible spaces	\$2,945
Notes: No van accessible parking space prov for 48 spaces (2 spaces min).	vided. 1 designated accessible space provided
CBC: 1011, 11B-208.2	
Other: ADA 208.2.4	
Provide adequate striping	\$100
Notes: Accessible parking space is 16.5' long painted in the access aisle.	g (18' min). The words "No Parking" are not
CBC: 11B-502.2	
Other: ADA 502.2	
Provide or modify accessible access aisles	\$210
Notes: Access aisle width is 82.5" (96" min).	Access aisle does not have a blue border.
CBC: 11B-502.2, 11B-502.3.1	
Other: ADA 502.3.1	
Regrade accessible parking space or access	s aisle \$3,200
Notes: Slopes of parking space and access a	aisle are 2.4% to 2.7% (2.0% max).
CBC: 11B-502.4	
Other: ADA 502.4	
Install van accessible sign	\$375
Notes: A "Van Accessible" sign is not provide posted at stalls striped and designate	
CBC: 11B-502.6	
Other: ADA 208.2.4	

Building	
3 - 1 Curb Ramp	Category: 1
Provide a level landing	\$0
Notes: The turning space at the bottom of the max). Top landing has a slope of 2.3%	
CBC: 11B-406.3.2	
Other: -	
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Provide surface texture	\$0
Notes: No grooved border provided.	
CBC: 11B-406.5.11	
Other: -	
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 13.8% (8.33%	ဖ max).
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	
5 - 1 Ramp	Category: 1
Grind or patch vertical change of grade	\$250
Notes: 3/4" change in level at the top of the rar slope and cross slope on the ramp or la	
CBC: 11B-405.4	
Other: ADA 405.4	ф
Raise or lower existing handrail	\$70
Notes: Handrail top surface is mounted 25" ab on the other (34" min to 38" max).	ove the ramp surface at one side and 21.5"
CBC: 11B-505.4	
Other: ADA 505.4	
Provide a level landing	\$5,000
Notes: Intermediate landing is 48" deep (60" m	ıin).
CBC: 11B-405.7	
Other: ADA 405.7.4	

Building	
6 - 1 Stairway	Category: 1
Install a handrail	\$625
Notes: No parallel extension provid	ed on the handrail (12" min). Handrails are provided only (handrails on both sides req).
CBC: 11B-505.10.2, 11B-505.2	
Other: ADA 505.10.2, ADA 505.2	
Install tread striping	\$45
Notes: No tread striping provided.	ψ+3
CBC: 11B-504.4.1	
Other: -	
	Catagon <i>y:</i> A
	Category: 4 s125
be mounted below 27" or ab CBC: 11B-307.4	m the wall at 46.25" AFF (protrusion more than 4" must
Other: ADA 307.4	
8 - 1 Door/Gate	Category: 1
Replace or modify door threshold	\$125
Notes: Bevel threshold has a vertic	al change of 3/4" (1/4" max, up to 1/2" with a bevel).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
Increase maneuvering space	\$0
Notes: Clear floor space at the pus	h button of the door is obstructed by a movable chair.
CBC: 11B-404.2.4	
Other: ADA 404.2.4.1	
8 - 2 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Door opening force is 12 lbs	s (5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sig	gn is not provided in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Replace or modify door threshold	\$125
Notes: Threshold has a vertical cha	ange of 1" (1/4" max, up to 1/2" with a bevel).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
12/19/2014	Building Page 3 Service Center

Building	
8 - 3 Door/Gate	Category: 2
Adjust door closer	\$125
	y of the survey. Stopping force and open time
of the door not evaluated.	
CBC: 11B-404.3	
Other: ADA 404.3	-
8 - 4 Door/Gate	Category: 2
Modify door window or side light	\$500
Notes: Bottom of the door's glazing window i	s 55.75" AFF (43" max).
CBC: 11B-404.2.11	
Other: ADA 404.2.11	
8 - 5 Door/Gate	Category: 2
Provide strike edge clearance	\$2,500
Notes: Front approach strike-edge clearance	on the pull side of the door is 3" (18" min).
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.1	
Replace or modify door threshold	\$125
Notes: Threshold has a vertical change of 1.	5" at tile (1/4" max, up to 1/2" with a bevel).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
Reverse the door swing	\$450
Notes: Doors in sequence- the clear floor spa side of the other door (48" min plus th	
CBC: 11B-404.2.6	
Other: ADA 404.2.6	
10 - 1 Drinking Fountain	Category: 3
Replace fountain	\$3,000
Notes: The bubbler height is 40.5" AFF (36"	max).
CBC: 11B-602.4	
Other: ADA 602.4	
Replace or adjust water controls	\$125
Notes: Operating effort of control is 6 lbs (5 l	bs max).
CBC: 11B-309	
Other: ADA 309	

Buildi	ng	
16 - 1	Built-in Elements	Category: 2
Provide	e an accessible counter	\$1,500
Notes	: Accessible counter is 43-7/8" AFF (34" m	ax).
CBC	: 11B-904.4	
Othe	r: ADA 904.4.1	


Building 19 - 1 Multiple User Restroom	Category: 2
Modify stall partitions	\$500
Notes: Water closet compartment is 39.5" wide (60)	•
CBC: 11B-604.8.1.1	
Other: ADA 604.3.1	
Replace or reposition fixtures	\$1,250
Notes: Centerline of water closet is 19.5" from the s	
CBC: 11B-604.2	······································
Other: ADA 604.2	
Replace or modify grab bars	\$600
Notes: Side grab bar extends 52.25" from the rear v provided (36" long min, extends 12" and 24" Toilet paper dispenser is located 3.5" above above grab bar).	min from centerline of water closet).
CBC: 11B-604.5.1, 11B-609.3	
Other: ADA 604.5.1, ADA 609.3	
Replace or reposition dispenser	\$125
Notes: Height of soap dispenser is 44" AFF (40" ma	ax).
CBC: 11B-603.5, 11B-604.7	
Other: ADA 604.7	
Reposition clothing hooks	\$125
Notes: Height of coat hook is 65.5" (48" max).	
CBC: 11B-603.4	
Other: ADA 308	
Replace or reposition mirror	\$150
Notes: Bottom of the mirror's reflecting surface is 4	5" AFF (40" max).
CBC: 11B-603.3	
Other: ADA 603.3	
Provide clear floor or turning space	\$3,000
Notes: A level turning space of 60" min is not provid (2.0% max slope).	ded due to .5" change in level at tile floor
CBC: 11B-603.2.1	
Other: ADA 304.3, ADA 603.2.1	
Provide an accessible lavatory	\$3,000
Notes: The approach to the lavatory is 35.5" wide a	nd 49.5" deep (36" by 48").
CBC: 11B-606.2, 11B-606.6	
Other: ADA 606.2	

Buildin	9	
19 - 2	Multiple User Restroom	Category: 2
Provide	or replace compartment door hardware	\$175
Notes:	Compartment does not have an handle on the inside must have U-shaped handles both inside and outside closing).	· ·
CBC:	11B-604.8.1.2	
Other:	ADA 604.8.1.2	
Replace	or modify grab bars	\$600
Notes:	Rear grab bar is not provided (36" long min, extends centerline of water closet). Side grab bar extends 52"	
CBC:	11B-604.5.2	
Other:	ADA 604.5.2	
Modify s	tall partitions	\$500
Notes:	The water closet compartment is 37.75" wide (60" mi	n).
CBC:	11B-604.8.1.1	
Other:	ADA 604.3.1	
Modify la	ivatory or counter clearances	\$1,500
Notes:	Clear space beneath the lavatory apron is 28 7/8" (29)" min).
CBC:	11B-306.3.1	
Other:	-	
Replace	or reposition mirror	\$150
Notes:	Bottom of the mirror's reflecting surface is 46" AFF (4	0" max).
CBC:	11B-603.3	
Other:	ADA 603.3	
Replace	or reposition dispenser	\$250
Notes:	Height of soap dispenser is 45.5" AFF (40" max). Cer located 13" in front of the water closet (7" min to 9" m	
CBC:	11B-603.5, 11B-604.7	
Other:	ADA 604.7	
Replace	urinal	\$3,000
Notes:	Height of the urinal rim is 19" AFF and projects 12" from 13.5" min from the wall).	om the wall (17" AFF max and
CBC:	11B-605.2	
Other:	ADA 605.2	

Building	
19 - 2 Multiple User Restroom	Category: 2
Provide clear floor or turning space	\$3,000
Notes: Clear floor space in front of the urinal is wide min).	28.25" wide with 24" privacy screen (30"
CBC: 11B-305	
Other: ADA 305.5	

Somerset Park 10710 Stokes Avenue Cupertino, CA



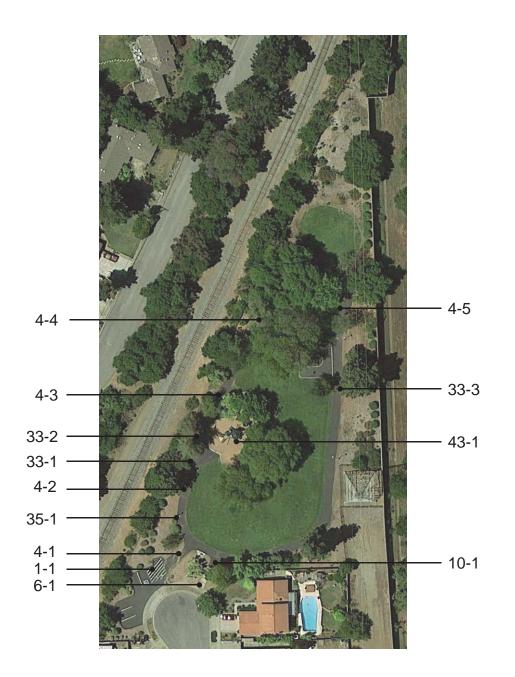

Somerset Park

1 - 1	Parking Area	Category: 1	
Provide	adequate striping		\$100
Notes:	Accessible parking and access aisle are 1	6' long (18' min).	
CBC:	11B-502.2		
Other:	ADA 502.2		
Install va	an accessible sign		\$375
Notes:	A "Van Accessible" sign is not provided. R posted at stalls striped and designated to		gn is
CBC:	11B-502.6		
Other:	ADA 208.2.4		
Regrade	accessible parking space or access ais	le	\$1,600
Notes:	Slope of accessible parking space is up to	3% (2% max).	
CBC:	11B-502.4		
Other:	ADA 502.4		
4 - 1	Walk	Category: 1	
Regrade	surface		\$580
Notes:	Cross slope of asphalt path is up to 3.6%	for 29 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 2	Walk	Category: 2	
Regrade	surface		\$1,320
Notes:	Cross slope of asphalt path is up to 3.6%	for 66 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 3	Walk	Category: 2	
Regrade	surface		\$680
Notes:	Cross slope of asphalt path is up to 3% fo	r 34 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 4	Walk	Category: 2	
Regrade	surface		\$820
Notes:	Cross slope of asphalt path is up to 3.4%	for 41 linear feet (2.0% max).	
CBC:	11B-403.3		


Somerset Park

4 - 5	Walk	Category: 2	
Regrade	surface		\$420
Notes:	Cross slope of asphalt path is up to 5% for 21 line	ear feet (2.0% max).
CBC:	11B-403.3		
Other:	ADA 403.3		
6 - 1	Stairway	Category: 1	
Install a	handrail		\$1,500
Notes:	Handrails are not provided on either side of the st req).	airway (handrails c	on both sides
CBC:	11B-505.2		
Other:	ADA 505.2		
Replace	stairs		\$1,200
Notes:	Riser heights range from 4" to 4.75" (uniform heig	hts req).	
CBC:	11B-504.2		
Other:	ADA 504.2		
Install tr	ead striping		\$60
	ead striping No tread striping provided on 4 risers.		\$60
Notes:			\$60
Notes:	No tread striping provided on 4 risers. 11B-504.4.1		\$60
Notes: CBC:	No tread striping provided on 4 risers. 11B-504.4.1	Category: 3	\$60
Notes: CBC: Other: 10 - 1 Replace	No tread striping provided on 4 risers. 11B-504.4.1 - Drinking Fountain fountain		\$3,000
Notes: CBC: Other: 10 - 1 Replace	No tread striping provided on 4 risers. 11B-504.4.1 - Drinking Fountain	oubbler is 36" max	\$3,000
Notes: CBC: Other: 10 - 1 Replace Notes:	No tread striping provided on 4 risers. 11B-504.4.1 - Drinking Fountain fountain Bubbler height is 36.5" AFF (accessible fountain b	oubbler is 36" max	\$3,000
Notes: CBC: Other: 10 - 1 Replace Notes: CBC:	No tread striping provided on 4 risers. 11B-504.4.1 - Drinking Fountain fountain Bubbler height is 36.5" AFF (accessible fountain k standing fountain 38" min to 43" max above floor)	oubbler is 36" max	\$3,000
Notes: CBC: Other: 10 - 1 Replace Notes: CBC: Other:	No tread striping provided on 4 risers. 11B-504.4.1 - Drinking Fountain fountain Bubbler height is 36.5" AFF (accessible fountain k standing fountain 38" min to 43" max above floor) 11B-602.4, 11B-602.7	oubbler is 36" max	\$3,000
Notes: CBC: Other: 10 - 1 Replace Notes: CBC: Other: Increase	No tread striping provided on 4 risers. 11B-504.4.1 - Drinking Fountain fountain Bubbler height is 36.5" AFF (accessible fountain k standing fountain 38" min to 43" max above floor) 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7	oubbler is 36" max.	\$3,000 . above floor; \$1,000
Notes: CBC: Other: 10 - 1 Replace Notes: CBC: Other: Increase Notes:	No tread striping provided on 4 risers. 11B-504.4.1 - Drinking Fountain fountain Bubbler height is 36.5" AFF (accessible fountain k standing fountain 38" min to 43" max above floor) 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 cor provide maneuvering or clear floor area Clear floor space is not provided in front of the four	oubbler is 36" max.	\$3,000 . above floor; \$1,000
Notes: CBC: Other: 10 - 1 Replace Notes: CBC: Other: Notes: CBC:	No tread striping provided on 4 risers. 11B-504.4.1 - Drinking Fountain fountain Bubbler height is 36.5" AFF (accessible fountain k standing fountain 38" min to 43" max above floor) 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 or provide maneuvering or clear floor area Clear floor space is not provided in front of the four fountain).	oubbler is 36" max.	\$3,000 . above floor; \$1,000
Notes: CBC: Other: 10 - 1 Replace Notes: CBC: Other: Increase Notes: CBC: CBC: Other:	No tread striping provided on 4 risers. 11B-504.4.1 - Drinking Fountain fountain Bubbler height is 36.5" AFF (accessible fountain k standing fountain 38" min to 43" max above floor) 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 or provide maneuvering or clear floor area Clear floor space is not provided in front of the four fountain). 11B-305, 11B-306, 11B-602.2	oubbler is 36" max.	\$3,000 . above floor; \$1,000
Notes: CBC: Other: 10 - 1 Replace Notes: CBC: Other: CBC: Other: Install ar	No tread striping provided on 4 risers. 11B-504.4.1 - Drinking Fountain fountain Bubbler height is 36.5" AFF (accessible fountain k standing fountain 38" min to 43" max above floor) 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 e or provide maneuvering or clear floor area Clear floor space is not provided in front of the four fountain). 11B-305, 11B-306, 11B-602.2 ADA 305, ADA 305.3, ADA 305.5, ADA 306	ubbler is 36" max.	\$3,000 . above floor; \$1,000 min). (re-orient \$3,000
Notes: CBC: Other: 10 - 1 Replace Notes: CBC: Other: Increase Notes: CBC: Other: Install a Notes:	No tread striping provided on 4 risers. 11B-504.4.1 - Drinking Fountain fountain Bubbler height is 36.5" AFF (accessible fountain k standing fountain 38" min to 43" max above floor) 11B-602.4, 11B-602.7 ADA 602.4, ADA 602.7 e or provide maneuvering or clear floor area Clear floor space is not provided in front of the four fountain). 11B-305, 11B-306, 11B-602.2 ADA 305, ADA 305.3, ADA 305.5, ADA 306 n additional high or low fountain A higher standing person fountain and a wheelcha	ubbler is 36" max.	\$3,000 . above floor; \$1,000 min). (re-orient \$3,000

Somerset Park

33 - 1 Outdoor	Constructed Features	Category: 4	
	de clear floor area		\$700
•	or space adjacent to the bench is 2	4" deep (36" by 48" min).	• • • •
CBC: -	-		
Other: AGODA	1011.2.1		
33 - 2 Outdoor	Constructed Features	Category: 2	
Increase or provi	de clear floor area		\$700
Notes: Clear floo	or space adjacent to the bench is 2	4" deep (36" by 48" min).	
CBC: -			
Other: AGODA	1011.2.1		
33 - 3 Outdoor	Constructed Features	Category: 2	
Increase or provi	de clear floor area		\$700
	or space adjacent to the bench is 2 ne clear floor space of the fixed ber		nange in
CBC: -			
CBC: -		Category: 3	
CBC: - Other: AGODA 35 - 1 Other		Category: 3	\$1,000
CBC: - Other: AGODA 35 - 1 Other Increase or provi	1011.2.1	Category: 3 ea	\$1,000
CBC: - Other: AGODA 35 - 1 Other Increase or provi	1011.2.1 de maneuvering or clear floor ar or space in front of the Mutt Mitt ha	Category: 3 ea	\$1,000
CBC: - Other: AGODA 35 - 1 Other Increase or provi Notes: Clear floo	1011.2.1 de maneuvering or clear floor ar or space in front of the Mutt Mitt ha .5	Category: 3 ea	\$1,000
CBC: - Other: AGODA 35 - 1 Other Increase or provi Notes: Clear floo CBC: 11B-305	1011.2.1 de maneuvering or clear floor ar or space in front of the Mutt Mitt ha .5 5.3, ADA 305.5	Category: 3 ea	\$1,000
CBC: - Other: AGODA 35 - 1 Other Increase or provi Notes: Clear floo CBC: 11B-305 Other: ADA 305 Reposition contro	1011.2.1 de maneuvering or clear floor ar or space in front of the Mutt Mitt ha .5 5.3, ADA 305.5	Category: 3 ea s a slope of 5.1% (2% max).	
CBC: - Other: AGODA 35 - 1 Other Increase or provie Notes: Clear floo CBC: 11B-305 Other: ADA 305 Reposition contro Notes: Mutt Mitt	1011.2.1 de maneuvering or clear floor ar or space in front of the Mutt Mitt ha .5 .3, ADA 305.5 bls	Category: 3 ea s a slope of 5.1% (2% max).	
CBC: - Other: AGODA 35 - 1 Other Increase or provise Notes: Clear floor CBC: 11B-305 Other: ADA 305 Reposition control Notes: Mutt Mitt CBC: 11B-308	1011.2.1 de maneuvering or clear floor are or space in front of the Mutt Mitt ha .5 .3, ADA 305.5 ols is located 49" AFF (15" min to 48"	Category: 3 ea s a slope of 5.1% (2% max). max).	
CBC: - Other: AGODA 35 - 1 Other Increase or provie Notes: Clear floo CBC: 11B-305 Other: ADA 305 Reposition contro Notes: Mutt Mitt CBC: 11B-308 Other: ADA 308	1011.2.1 de maneuvering or clear floor are or space in front of the Mutt Mitt ha .5 5.3, ADA 305.5 ols is located 49" AFF (15" min to 48" .2.1, 11B-308.3	Category: 3 ea s a slope of 5.1% (2% max). max).	
CBC: - Other: AGODA 35 - 1 Other Increase or provie Notes: Clear floo CBC: 11B-305 Other: ADA 305 Reposition contro Notes: Mutt Mitt CBC: 11B-308 Other: ADA 308	1011.2.1 de maneuvering or clear floor are or space in front of the Mutt Mitt ha .5 .3, ADA 305.5 ols is located 49" AFF (15" min to 48" .2.1, 11B-308.3 .2, ADA 308.2.1, ADA 308.3, ADA upment Area	Category: 3 ea s a slope of 5.1% (2% max). max). 308.3.1, ADA 308.3.2	
CBC: - Other: AGODA 35 - 1 Other Increase or provise Notes: Clear floor CBC: 11B-305 Other: ADA 305 Reposition contro Notes: Mutt Mitt CBC: 11B-308 Other: ADA 308 43 - 1 Play Equ Regrade or replace	1011.2.1 de maneuvering or clear floor are or space in front of the Mutt Mitt ha .5 .3, ADA 305.5 ols is located 49" AFF (15" min to 48" .2.1, 11B-308.3 .2, ADA 308.2.1, ADA 308.3, ADA upment Area ce ramp e in level at the bottom of the ramp	Category: 3 ea s a slope of 5.1% (2% max). max). 308.3.1, ADA 308.3.2 Category: 2	\$200
CBC: - Other: AGODA 35 - 1 Other Increase or provie Notes: Clear floo CBC: 11B-305 Other: ADA 305 Reposition contro Notes: Mutt Mitt CBC: 11B-308 Other: ADA 308 43 - 1 Play Equ Regrade or replace Notes: 2" chang	1011.2.1 de maneuvering or clear floor are or space in front of the Mutt Mitt ha .5 .3, ADA 305.5 ols is located 49" AFF (15" min to 48" .2.1, 11B-308.3 .2, ADA 308.2.1, ADA 308.3, ADA upment Area ce ramp e in level at the bottom of the ramp evel).	Category: 3 ea s a slope of 5.1% (2% max). max). 308.3.1, ADA 308.3.2 Category: 2	\$200

Sport Center 21111 Stevens Creek Blvd. Cupertino, CA

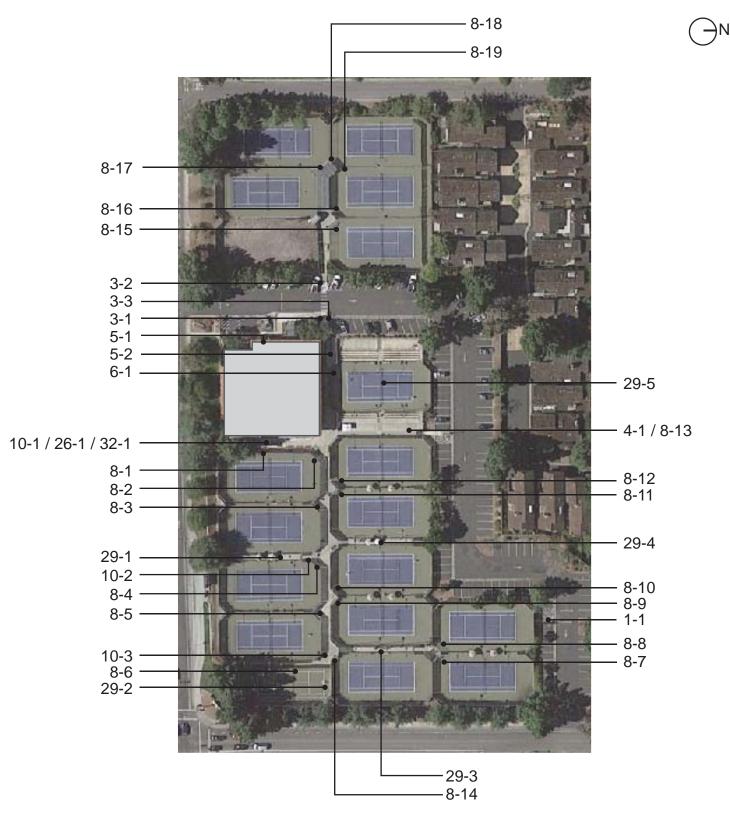

Exterior	
1 - 1 Parking Area	Category: 1
Provide or modify accessible spaces	\$2,945
Notes: No van accessible parking space provide	ed.
CBC: 1011, 11B-208.2	
Other: ADA 208.2.4	
Provide an accessible path of travel	\$40
Notes: Accessible route is not provided from the ramp is located in front of the parking space.	
CBC: 11B-502.7.1	
Other: ADA 502.3	
Provide adequate striping	\$100
Notes: Accessible parking space is 81" wide due	e to bollards in the parking space (108" min).
CBC: 11B-502.2	
Other: ADA 502.2	
Install van accessible sign	\$375
Notes: A "Van Accessible" sign is not provided. posted at stalls striped and designated to	
CBC: 11B-502.6	
Other: ADA 208.2.4	
3 - 1 Curb Ramp	Category: 1
Install, replace or modify curb ramp	\$2,460
Notes: Cross slope of the curb ramp is 2.6% (2.	0% max).
CBC: 11B-406	
Other: ADA 405.3, ADA 406.1	
Provide surface texture	\$0
Notes: Grooved border is 11.5" wide (12" min).	
CBC: 11B-406.5.11	
Other: -	
3 - 2 Curb Ramp	Category: 1
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 8.6% (8.33% n	nax).
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	
Provide surface texture	\$0
Notes: Grooved border is 11.5" wide (12" min).	• •
CBC: 11B-406.5.11	
Other: -	

Exterior	
3 - 3 Curb Ramp	Category: 1
Provide a level landing	\$90
Notes: The turning space at the bottom of th max). Top landing has a slope of 2.5	e parallel curb ramp has a slope of 2.8% (2% % (2% max).
CBC: 11B-406.3.2	
Other: -	
Provide surface texture	\$0
Notes: Grooved border is 11.5" wide (12" mi	n).
CBC: 11B-406.5.11	
Other: -	
4 - 1 Walk	Category: 2
Grind or patch vertical change of grade	\$250
Notes: 3/4" to 1/2" change of level along exp to 1/2" with a bevel).	pansion joints for 303 linear feet (1/4" max, up
CBC: 11B-303.2	
Other: ADA 303.2, ADA 303.3	
5 - 1 Ramp	Category: 1
Regrade or replace ramp	\$14,875
Notes: Ramp slope is 8.7% for 35 linear feet	t (8.33% max).
CBC: 11B-405.2	
Other: ADA 405.2	
Provide a level landing	\$150
Notes: Bottom landing is 60" long (72" min).	
CBC: 11B-405.7.3.1	
Other: ADA 405.7.3	

5 - 2 Ramp	Category: 1
Reduce or eliminate opening	\$250
Notes: Grate openings are 1" wide in th perpendicular to the path of trav	ne direction of path of travel (1/2" max opening and vel).
CBC: 11B-302.3	
Other: ADA 302.3	
Regrade or replace ramp	\$17,000
Notes: Ramp cross slope is 2.7% at dra 9.1% (8.33% max).	ain (2.0% max). Ramp slope is between 8.6% to
CBC: 11B-405.2, 11B-405.3	
Other: ADA 405.2, ADA 405.3	
Provide a level landing	\$150
Notes: Slope of bottom landing is 2.6%	(2.0% max).
CBC: 11B-405.7.1	
Other: ADA 302, ADA 405.7.1	
6 - 1 Stairway	Category: 1
Replace stairs	\$1,200
Notes: Riser heights range from 7.25" t	to 7.5" (4" min to 7" max, uniform heights).
CBC: 11B-504.2	
Other: ADA 504.2, ADA 504.3	
Install a handrail	\$250
Notes: Parallel handrail extensions are	not in line with path of travel.
CBC: 11B-505.2	
Other: ADA 505.2	

Exterior		
8 - 1 Door/Gat	category: 2	
Provide or modify	door kickplate	\$225
Notes: A smooth	and uninterrupted kick plate surface is not provided.	
CBC: 11B-404.	2.10	
Other: ADA 404	2.10	
Provide an access	sible path of travel	\$40
	sible path of travel to court gate is not provided due to 12" pavers wit veen them (smooth and continuous surface, 1/2" max openings).	h 1"
CBC: 11B-206.	2.4, 11B-404.2.7	
Other: ADA 206	2.4, ADA 404.1	
Provide strike edg	je clearance	\$500
	proach strike-edge clearance on the pull side of the door is 8.5" due to urface (18" min).	C
CBC: 11B-404.	2.4.1	
Other: ADA 404	2.4.1	
Raise or lower ex	sting hardware	\$125
Notes: Center of	door hardware is 48" AFF (34" min to 44" max).	
CBC: 11B-404.	2.7	
Other: ADA 404	2.7	
8 - 2 Door/Gat	category: 2	
Provide or modify	door kickplate	\$225
Notes: A smooth	and uninterrupted kick plate surface is not provided.	
CBC: 11B-404.	2.10	
Other: ADA 404	2.10	
Replace or modify	/ door threshold	\$125
Notes: Threshold	d has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel).	
CBC: 11B-404.		
Other: ADA 404	2.5	
8 - 3 Door/Gat	category: 2	
Provide or modify		\$225
	and uninterrupted kick plate surface is not provided.	, -
CBC: 11B-404.		
Other: ADA 404	-	
Replace or modify		\$125
	d has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel).	φ.20
CBC: 11B-404.		
Other: ADA 404	-	
	2.0	

Exterior	
8 - 4 Door/Gate	Category: 2
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate su	· · · · · ·
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Replace or modify door threshold	\$125
Notes: Threshold has a vertical change of 3.5" (1	/4" max, up to 1/2" with a bevel).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
8 - 5 Door/Gate	Category: 2
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate su	rface is not provided.
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Replace or modify door threshold	\$125
Notes: Threshold has a vertical change of 3.5" (1	/4" max, up to 1/2" with a bevel).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
8 - 6 Door/Gate	Category: 2
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate su	rface is not provided.
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Replace or modify door threshold	\$125
Notes: Threshold has a vertical change of 3.5" (1 a 48" long movable ramp with a slope of 2	
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
8 - 7 Door/Gate	Category: 2
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate su	rface is not provided.
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Replace or modify door threshold	\$125
Notes: Threshold has a vertical change of 3.5" (1	/4" max, up to 1/2" with a bevel).
CBC: 11B-404.2.5	

8 - 8 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Cther: ADA 404.2.10 \$125 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 8 - 9 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.10 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 Category: 2 Provide or modify door thickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 CBC: 11B-404.2.10 \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 \$125 Notes: Threshold has a vertic	Exterior		
Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 CBC: 11B-404.2.10 \$125 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 Other: ADA 404.2.5 \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 Samooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 CBC: 11B-404.2.10 S125 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.5 Solte: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.10 \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 \$225 Notes: Threshold has a vertical change of 3.5	8 - 8 Door/Gate	Category: 2	
CBC: 11B-404.2.10 State Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 Category:2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 State Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 State State: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 State State State: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 State State Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.10 State State State Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 State State: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2"	Provide or modify door kickplate		\$225
Other: ADA 404.2.10\$125Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel).CBC: 118-404.2.5CBC: 11B-404.2.5Category: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided.CBC: 118-404.2.10Other: ADA 404.2.10CBC: 11B-404.2.10Other: ADA 404.2.10\$125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5Category: 2Provide or modify door threshold\$125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5Category: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided.CBC: 11B-404.2.10CBC: 11B-404.2.10CBC: 11B-404.2.5Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5CBC: 11B-404.2.5S125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5S - 11 Door/GateCategory: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided.CBC: 11B-404.2.10CBC: 11B-404.2.10Category: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided.CBC: 11B-404.2.10CBC: 11B-404.2.10CAtegory: 2Replace or modify door thr	Notes: A smooth and uninterrupted kick plate surface	e is not provided.	
Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5CBC: 11B-404.2.5Category: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided.CBC: 11B-404.2.10CBC: 11B-404.2.10Category: 2Other: ADA 404.2.10\$125Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5\$1258 - 10Door/GateProvide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided.\$225CBC: 11B-404.2.5\$225Notes: A smooth and uninterrupted kick plate surface is not provided.\$225Notes: A smooth and uninterrupted kick plate surface is not provided.\$225Notes: A smooth and uninterrupted kick plate surface is not provided.\$125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel).\$125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel).\$225Notes: 11B-404.2.5\$225\$225Notes: A smooth and uninterrupted kick plate surface is not provided.\$225Notes: A smooth and uninterrupted kick plate surface is not provided.\$225Notes: A smooth and uninterrupted kick plate surface is not provided.\$225Notes: A smooth and uninterrupted kick plate surface is not provided.\$225Notes: A smooth and uninterrupted kick plate surface is	CBC: 11B-404.2.10		
Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 8 - 9 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 Other: ADA 404.2.10 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 Other: ADA 404.2.5 8 - 10 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.5 Other: ADA 404.2.10 Other: ADA 404.2.10 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.10 Other: ADA 404.2.5 Sector modify door kickplate \$225 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 Sector modify door kickplate \$225 Notes: A smooth and	Other: ADA 404.2.10		
CBC: 11B-404.2.5 Other: ADA 404.2.5 8 - 9 Door/Gate Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 (Hat a beta) Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 (Hat a beta) Øther: ADA 404.2.5 (Atta) 8 - 10 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 (Diter: ADA 404.2.10 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 (Diter: ADA 404.2.5) \$225 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.10 (Diter: ADA 404.2.10 \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 <	Replace or modify door threshold		\$125
Other: ADA 404.2.5 8 - 9 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 8125 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 Other: ADA 404.2.5 8 - 10 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 \$125 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.5 Other: ADA 404.2.5 \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10	Notes: Threshold has a vertical change of 3" (1/4" ma	ax, up to 1/2" with a bevel).	
8 - 9 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 \$125 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 0ther: ADA 404.2.5 8 - 10 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 Other: ADA 404.2.10 Other: ADA 404.2.10 \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 0ther: ADA 404.2.5 \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 0ther: ADA 404.2.5 2 8 - 11 Door/Gate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.5 8 - 11 Door/Gate \$225 Notes: A smooth and unininterrupted kick plate surface is not provided	CBC: 11B-404.2.5		
Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 \$125 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 Category: 2 Provide or modify door threshold \$125 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.5 Øther: ADA 404.2.10 \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 CBC: 11B-404.2.10 \$125 Notes: A smooth and uninterrupted kick plate surface is not p	Other: ADA 404.2.5		
Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 8 - 10 Door/Gate Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 CBC: 11B-404.2.10 Other: ADA 404.2.10 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.10 Other: ADA 404.2.5 8 - 11 Door/Gate Category: 2 Provide or modify door kickplate S - 11 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 Replace or modify door threshold \$125	8 - 9 Door/Gate	Category: 2	
CBC: 11B-404.2.10 \$125 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 Other: ADA 404.2.5 8 - 10 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 Other: ADA 404.2.10 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 S 8 - 11 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.5 8 - 11 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 Category: 2 Provide or modify door threshold \$125 Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel). CBC: 11B	Provide or modify door kickplate		\$225
Other: ADA 404.2.10Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5SOther: ADA 404.2.5Category: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10\$125Other: ADA 404.2.10\$125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5\$125Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.5\$125Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.5\$125Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.5\$225Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10\$225Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10\$125Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5\$125	Notes: A smooth and uninterrupted kick plate surface	e is not provided.	
Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5SOther: ADA 404.2.5Category: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10S125Other: ADA 404.2.10\$125Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5\$125Other: ADA 404.2.5Category: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.5\$125Other: ADA 404.2.10Category: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10\$125Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.10\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5\$125	CBC: 11B-404.2.10		
Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 8 - 10 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 Other: ADA 404.2.10 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 Category: 2 Provide or modify door kickplate \$225 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Ø-11 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 Category: 2 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.10 Cher: ADA 404.2.10 \$125 Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5	Other: ADA 404.2.10		
CBC: 11B-404.2.5 Other: ADA 404.2.5 8 - 10 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5 Other: ADA 404.2.5 8 - 11 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.10 CBC: 11B-404.2.10 CBC: 11B-404.2.10	Replace or modify door threshold		\$125
Other: ADA 404.2.58 - 10Door/GateCategory: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10\$125Other: ADA 404.2.10\$125Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5\$125Other: ADA 404.2.5Category: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10\$125Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10\$125Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5	Notes: Threshold has a vertical change of 3.5" (1/4" i	max, up to 1/2" with a bevel).	
8 - 10Door/GateCategory: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10\$125Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5\$125Other: ADA 404.2.5Category: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.5\$225Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10\$125Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5\$125	CBC: 11B-404.2.5		
Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided.CBC: 11B-404.2.10Other: ADA 404.2.10\$125Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5Other: ADA 404.2.5Category: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided.\$225CBC: 11B-404.2.10Category: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided.CBC: 11B-404.2.10Other: ADA 404.2.10\$125Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5\$125	Other: ADA 404.2.5		
Notes: A smooth and uninterrupted kick plate surface is not provided.CBC: 11B-404.2.10Other: ADA 404.2.10Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5Other: ADA 404.2.58 - 11 Door/GateCategory: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided.CBC: 11B-404.2.10Other: ADA 404.2.10Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5	8 - 10 Door/Gate	Category: 2	
CBC: 11B-404.2.10\$125 Replace or modify door threshold \$125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5CBC: 11B-404.2.5Category: 2 Provide or modify door kickplate \$225Notes: A smooth and uninterrupted kick plate surface is not provided.S225CBC: 11B-404.2.10Other: ADA 404.2.10 Replace or modify door threshold \$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.10CBC: 11B-404.2.5	Provide or modify door kickplate		\$225
Other: ADA 404.2.10\$125Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5CBC: 11B-404.2.5Category: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided.\$225CBC: 11B-404.2.10\$125Other: ADA 404.2.10\$125Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5	Notes: A smooth and uninterrupted kick plate surface	e is not provided.	
Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5Other: ADA 404.2.58 - 11 Door/GateCategory: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided.CBC: 11B-404.2.10Other: ADA 404.2.10Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5	CBC: 11B-404.2.10		
Notes: Threshold has a vertical change of 3.5" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5Other: ADA 404.2.58 - 11 Door/GateCategory: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided.CBC: 11B-404.2.10Other: ADA 404.2.10Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5	Other: ADA 404.2.10		
CBC: 11B-404.2.5 Other: ADA 404.2.5 8 - 11 Door/Gate Category: 2 Provide or modify door kickplate \$225 Notes: A smooth and uninterrupted kick plate surface is not provided. CBC: 11B-404.2.10 Other: ADA 404.2.10 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5	Replace or modify door threshold		\$125
Other: ADA 404.2.58 - 11Door/GateCategory: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided.\$225CBC: 11B-404.2.10CBC: 11B-404.2.10\$125Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel).\$125CBC: 11B-404.2.5CBC: 11B-404.2.5\$125	Notes: Threshold has a vertical change of 3.5" (1/4" i	max, up to 1/2" with a bevel).	
8 - 11Door/GateCategory: 2Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided.CBC: 11B-404.2.10Other: ADA 404.2.10Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5	CBC: 11B-404.2.5		
Provide or modify door kickplate\$225Notes: A smooth and uninterrupted kick plate surface is not provided.CBC: 11B-404.2.10Other: ADA 404.2.10\$125Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5	Other: ADA 404.2.5		
Notes: A smooth and uninterrupted kick plate surface is not provided.CBC: 11B-404.2.10Other: ADA 404.2.10Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5	8 - 11 Door/Gate	Category: 2	
CBC: 11B-404.2.10 Other: ADA 404.2.10 Replace or modify door threshold \$125 Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5	Provide or modify door kickplate		\$225
Other: ADA 404.2.10Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5	Notes: A smooth and uninterrupted kick plate surface	e is not provided.	
Replace or modify door threshold\$125Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel).CBC: 11B-404.2.5	CBC: 11B-404.2.10		
Notes: Threshold has a vertical change of 3" (1/4" max, up to 1/2" with a bevel). CBC: 11B-404.2.5	Other: ADA 404.2.10		
CBC: 11B-404.2.5	Replace or modify door threshold		\$125
	Notes: Threshold has a vertical change of 3" (1/4" ma	ax, up to 1/2" with a bevel).	
Other: ADA 404.2.5	CBC: 11B-404.2.5		
	-		

Exterior	
8 - 12 Door/Gate	Category: 2
Provide or modify door kickplate	\$22
Notes: A smooth and uninterrupted kick plate surface is	not provided.
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Replace or modify door threshold	\$12
Notes: Threshold has a vertical change of 3.5" (1/4" max	, up to 1/2" with a bevel).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
8 - 13 Door/Gate	Category: 2
Provide or modify door kickplate	\$22
Notes: A smooth and uninterrupted kick plate surface is	not provided.
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Replace or modify door threshold	\$12
Notes: Threshold has a vertical change of 1/2" (1/4" max	, up to 1/2" with a bevel).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
Locked or Alarmed Door - Not Surveyed	\$
Notes: Door not surveyed.	
CBC: -	
Other: -	
8 - 14 Door/Gate	Category: 2
Provide or modify door kickplate	\$22
Notes: A smooth and uninterrupted kick plate surface is	not provided.
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Replace or modify door threshold	\$12
Notes: Threshold has a vertical change of 1.75" (1/4" ma	ax, up to 1/2" with a bevel).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	

Exterior		
8 - 15 Door/Gate	Category: 2	
Provide or modify door kickplate		\$225
Notes: A smooth and uninterrupted kick plate surface	ace is not provided.	
CBC: 11B-404.2.10		
Other: ADA 404.2.10		
Replace or modify door threshold		\$125
Notes: Threshold has a vertical change of 3" (1/4"	max, up to 1/2" with a bevel).	
CBC: 11B-404.2.5		
Other: ADA 404.2.5		
8 - 16 Door/Gate	Category: 2	
Provide or modify door kickplate		\$225
Notes: A smooth and uninterrupted kick plate surf	ace is not provided.	
CBC: 11B-404.2.10		
Other: ADA 404.2.10		
Replace or modify door threshold		\$125
Notes: Threshold has a vertical change of 3" (1/4"	max, up to 1/2" with a bevel).	
CBC: 11B-404.2.5		
Other: ADA 404.2.5		
8 - 17 Door/Gate	Category: 2	
Provide or modify door kickplate		\$225
Notes: A smooth and uninterrupted kick plate surface	ace is not provided.	
CBC: 11B-404.2.10		
Other: ADA 404.2.10		
Replace or modify door threshold		\$125
Notes: Threshold has a vertical change of 3" (1/4"	max, up to 1/2" with a bevel).	
CBC: 11B-404.2.5		
Other: ADA 404.2.5		
8 - 18 Door/Gate	Category: 2	
Provide or modify door kickplate		\$225
Notes: A smooth and uninterrupted kick plate surface	ace is not provided.	
CBC: 11B-404.2.10		
Other: ADA 404.2.10		
Replace or modify door threshold		\$125
Notes: Threshold has a vertical change of 3" (1/4"	max, up to 1/2" with a bevel).	
CBC: 11B-404.2.5		
Other: ADA 404.2.5		


Exterior	
8 - 19 Door/Gate	Category: 2
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate surface	e is not provided.
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Replace or modify door threshold	\$125
Notes: Threshold has a vertical change of 3" (1/4" ma	ax, up to 1/2" with a bevel).
CBC: 11B-404.2.5	
Other: ADA 404.2.5	
10 - 1 Drinking Fountain	Category: 3
Provide an accessible path of travel	\$40
Notes: An accessible route to the drinking fountain is clear floor space (1/4" max, up to 1/2" with a l	•
CBC: 11B-206.2	
Other: ADA 206.2	
Raise or lower fountain	\$1,500
Notes: Space between floor/ground and bottom of fo	ountain is 26.25" (27" min).
CBC: 11B-306.3	
Other: ADA 306.3, ADA 306.3.1	
Adjust the water stream height or direction	\$125
Notes: The flow of the water is 2.5" high (4" high min).
CBC: 11B-602.6	
Other: ADA 602.6	
Install an additional high or low fountain	\$3,000
Notes: A higher standing person fountain is not provi	ided.
CBC: 11B-211.2	
Other: ADA 211.2	
10 - 2 Drinking Fountain	Category: 3
Install an additional high or low fountain	\$3,000
Notes: A standing person drinking fountain is not pro	vided.
CBC: 11B-211.2	
Other: ADA 211.2	
Provide wing walls	\$1,000
Notes: Drinking fountain protrudes 16" from vertical s than 4" must be mounted below 27" or above	
CBC: 11B-602.8, 11B-602.9	
Other: ADA 307	

Exterior	
10 - 3 Drinking Fountain	Category: 3
Provide wing walls	\$1,000
Notes: Drinking fountain protrudes 20.5" from ver	
more than 4" must be mounted below 27"	or above 80").
CBC: 11B-602.8, 11B-602.9	
Other: ADA 307	
Install an additional high or low fountain	\$3,000
Notes: A standing person drinking fountain is not not working.	provided. Accessible drinking fountain is
CBC: 11B-211.2	
Other: ADA 211.2	
26 - 1 Eating Area	Category: 3
Increase or provide maneuvering or clear floor a	rea \$1,000
Notes: Clear floor space adjacent to the ice mach	ine has a slope of 4% (2% max).
CBC: 11B-305	
Other: ADA 305.3	
29 - 1 Game and Sports Area	Category: 2
Provide an accessible path of travel	\$0
Notes: Accessible route is not provided to spectat 11 due to 3 risers in the path of travel. Rise	•
CBC: 11B-206.2.2	
Other: ADA 206.2.2	
29 - 2 Game and Sports Area	Category: 2
Provide an accessible path of travel	\$0
Notes: Accessible route to the tennis ball machine of travel. Up to 12% slope down to machin	•
CBC: 11B-206.2.2	
Other: ADA 206.2.2	
29 - 3 Game and Sports Area	Category: 2
Provide an accessible path of travel	\$0
Notes: Accessible route is not provided to spectat due to 2 risers in the path of travel. Risers	•
CBC: 11B-206.2.2	
Other: ADA 206.2.2	

Exterior	
29 - 4 Game and Sports Area	Category: 2
Provide an accessible path of travel	\$0
Notes: Accessible route is not provided to specta risers in the path of travel. Risers do not l	•
CBC: 11B-206.2.2	
Other: ADA 206.2.2	
29 - 5 Game and Sports Area	Category: 2
Provide an accessible path of travel	\$0
Notes: Accessible route is not provided to specta stairs with 4 risers each have no handrail	
CBC: 11B-206.2.2	
Other: ADA 206.2.2	
Modify wheelchair seating	\$0
Notes: No integrated accessible spectator seating	ng provided.
CBC: 11B-221.2.2	
Other: ADA 221.2.2	
32 - 1 Picnic Area	Category: 2
Provide an accessible table	\$0
Notes: Knee space is 6.5" deep (8" min).	
CBC: 11B-306.3	
Other: -	
Provide an accessible picnic unit	\$6,400
Notes: An accessible table is not provided in a p	icnic area with 5 tables. (2 required).
CBC: 11B-246.5	
Other: -	

Sport Center - Floor 1 21111 Stevens Creek Blvd. Cupertino, CA



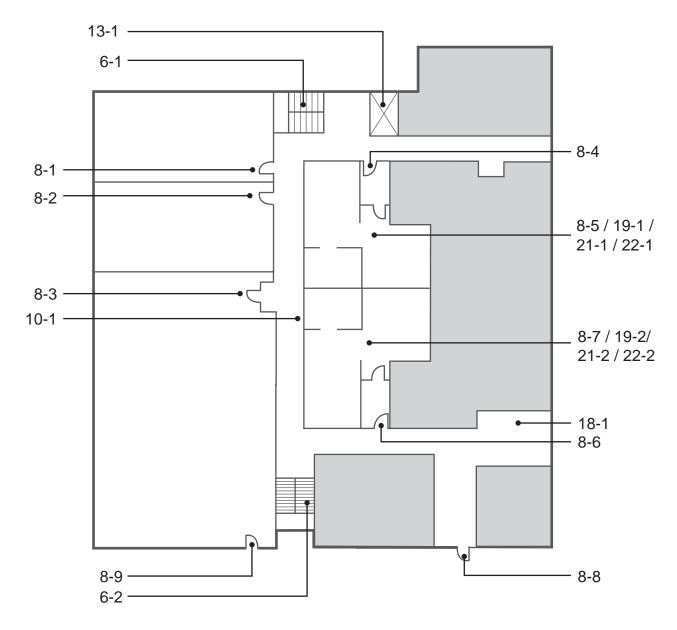

Floor 1	
6 - 1 Stairway	Category: 2
Replace stairs	\$4,800
Notes: Stairway with 16 risers. Riser heigh	ts are 7.5" (4" min to 7" max).
CBC: 11B-504.2	
Other: ADA 504.2, ADA 504.3	
Raise or lower existing handrail	\$500
Notes: Handrail top surface is mounted 42	" above the stair nosing (34" min to 38" max).
CBC: 11B-505.4	
Other: ADA 505.4	
Install a handrail	\$500
	ded at the top of the handrail before turning 90 extension is not provided on one bottom
CBC: 11B-505.10.2, 11B-505.10.3	
Other: ADA 505.10.2, ADA 505.10.3	
6 - 2 Stairway	Category: 2
Install a handrail	\$500
10". Parallel extension in the bottor	handrail extends 5" before turning 90 degrees for n of the handrail is 9" (12" min). Parallel Irail on the lower flight of stairs is 4.5" (12" min).
CBC: 11B-505.10.2, 11B-505.10.3	
Other: ADA 505.10.2, ADA 505.10.3	
Repair stair nosing	\$1,625
Notes: Tread nosing overhangs riser horized depth of 1", 13 risers (rounded with	ontally at 90 degrees (30 degrees max) at a a a radius of 1/2" max).
CBC: 11B-504.5	
Other: ADA 504.5	
Raise or lower existing handrail	\$500
Notes: Handrail top surface is mounted 39 above the stair tread at the lower fli	" above the stair tread at the upper flight and 40" ght (34" min to 38" max).
CBC: 11B-505.4	
Other: ADA 505.4	

Floor 1	
8 - 1 Door/Gate	Category: 2
Modify door window or side light	\$500
Notes: Bottom of the door's window glazing is 55.7	75" AFF (43" max).
CBC: 11B-404.2.11	
Other: ADA 404.2.11	
Replace door hardware	\$425
Notes: Inside door handle requires grasping and tw	wisting to operate.
CBC: 11B-309.4, 11B-404.2.7	
Other: ADA 309.4	
8 - 2 Door/Gate	Category: 2
Modify door window or side light	\$500
Notes: Bottom of the door's window glazing is 55.7	75" AFF (43" max).
CBC: 11B-404.2.11	
Other: ADA 404.2.11	
Replace door hardware	\$425
Notes: Inside door handle requires grasping and tw	wisting to operate.
CBC: 11B-309.4, 11B-404.2.7	
Other: ADA 309.4	
8 - 3 Door/Gate	Category: 2
Provide strike edge clearance	\$C
Notes: Front approach strike-edge clearance on th movable trash can (18" min).	ne pull side of the door is 4" due to
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.1	
Modify door window or side light	\$500
Notes: Bottom of the door's window glazing is 55.2	25" AFF (43" max).
CBC: 11B-404.2.11	
Other: ADA 404.2.11	
Adjust door closer	\$125
Notes: Door opening force is 7 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
8 - 4 Door/Gate	Category: 2
Adjust door closer	\$125
	tick (5 lbs max).
Notes: Door opening force is 19 lbs due to initial s	· · · · · · · · · · · · · · · · · · ·
Notes: Door opening force is 19 lbs due to initial st CBC: 11B-404.2.9	

Floor 1	
8 - 5 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Door opening force is 9 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Provide strike edge clearance	\$0
Notes: Front approach strike-edge clearance on movable scale (18" min).	swing side of the door is 12" due to
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.1	
8 - 6 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Door opening force is 12 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
8 - 7 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Door opening force is 13 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Provide strike edge clearance	\$0
Notes: Front approach strike-edge clearance on movable scale (18" min).	the swing side of the door is 11" due to
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.1	
8 - 8 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Door opening force is 10 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	

Floor 1	
8 - 9 Door/Gate	Category: 1
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not provide	
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Locked or Alarmed Door - Not Surveyed	\$0
Notes: Door not surveyed.	
CBC: -	
Other: -	
10 - 1 Drinking Fountain	Category: 3
Raise or lower fountain	\$1,500
Notes: Space between floor and bottom of fountain	is 26-5/8" (27" min).
CBC: 11B-306.3	
Other: ADA 306.3, ADA 306.3.1	
Increase or provide maneuvering or clear floor are	ea \$1,000
Notes: Drinking fountain alcove is 21.75" wide (30"	min).
CBC: 11B-305, 11B-306, 11B-602.2	
Other: ADA 305, ADA 305.3, ADA 305.5, ADA 306	
13 - 1 Elevator	Category: 1
Adjust elevator controls and labeling	\$790
Notes: The first floor of the building is marked as th buttons inside the elevator. Out side the ele- main floor.	• •
CBC: -	
Other: ADA 407.4.7.1.3	
Adjust or provide elevator signals and indicators	\$2,000
Notes: An audible signal sound is provided only on	the second floor.
CBC: 11B-407.2.2.3	
Other: ADA 407.2.2.3	
18 - 1 Room	Category: 2
Reposition controls and outlets	\$200
Notes: Coat hooks are located 52" AFF (15" min to	48" max).
CBC: 11B-308.2	
Other: ADA 308.2, ADA 308.2.1	
Provide accessible sink	\$3,000
Notes: Sink is 8" deep (6.5" max depth).	
CBC: 11B-606.7	
Other: -	
12/19/2014 Floor 1	Page 15
Sport Center	


19 - 1	Multiple User Restroom Category:	2
Install res	stroom sign	\$250
	Bottom of tactile lettering on the top line of text on federal sign is min).	62.5" AFF (60"
CBC:	-	
Other:	ADA 703	
Modify la	vatory or counter clearances	\$1,500
	Knee space measured at 8" deep from the centerline of the lavatemin).	ory is 22" AFF (27
CBC:	11B-306.3.3	
Other:	ADA 306.3, ADA 306.3.3	
Provide c	r replace compartment door hardware	\$175
	Compartment door is not self closing (compartment door must han nandles both inside and outside of the door and be self-closing).	ave U-shaped
CBC:	11B-604.8.1.2	
Other:	ADA 604.8.1.2	
Replace of	or modify grab bars	\$300
Notes:	Side grab bar extends 52.5" from the rear wall (54" min).	
CBC:	11B-604.5.1	
Other:	ADA 604.5.1	
Replace of	or reposition fixtures	\$1,250
Notes:	Centerline of the water closet is 18.5" from side wall (17" min to 1	18" max).
CBC:	11B-604.2	
Other:	ADA 604.2	
Replace of	or reposition dispenser	\$250
	Hair dryer is 60" AFF (40" max). Centerline of toilet paper is flush water closet (7" min to 9" max).	with front of the
CBC:	11B-603.5	
Other:	-	

Floor 1	
19 - 2 Multiple User Restroom	Category: 2
Provide or replace compartment door hardwa	ire \$175
Notes: Compartment door is not self closing (c handles both inside and outside of the CBC: 11B-604.8.1.2	• •
Other: ADA 604.8.1.2	
Replace or modify grab bars	\$600
Notes: Side grab bar extends 52.25" from the	
CBC: 11B-604.5.1, 11B-604.5.2	
Other: ADA 604.5.1, ADA 604.5.2	
Reposition clothing hooks	\$125
Notes: Height of coat hooks is 56" (48" max).	
CBC: 11B-603.4	
Other: ADA 308	
Replace or reposition dispenser	\$250
Notes: Hair dryer is 61" AFF (40" max). Cente water closet (7" min to 9" max).	rline of toilet paper is flush with front of the
CBC: 11B-603.5	
Other: -	
Install restroom sign	\$250
Notes: Bottom of the top line of tactile lettering	on federal sign is 62.5" AFF (60" min).
CBC: -	
Other: ADA 703	
21 - 1 Locker Room	Category: 2
Provide accessible fixed bench	\$2,000
Notes: Back support in the fixed benches is no 36" long and 9.5" deep (48" long by 20	
CBC: 11B-903.3, 11B-903.4	
Other: ADA 903.3, ADA 903.4	
Replace or reposition mirror	\$150
Notes: Full-length mirror is 11.5" wide by 47.5' wide and 54" high min, 20" max AFF).	long, and the bottom edge is 22.5" AFF (18
CBC: 11B-803.6	
Other: -	

Floor 1	
21 - 2 Locker Room	Category: 2
Provide accessible fixed bench	\$2,000
Notes: Back support in the fixed benches is not pr 36" long and 9.5" deep (48" long by 20" to	
CBC: 11B-903.3, 11B-903.4	
Other: ADA 903.3, ADA 903.4	
Replace or reposition mirror	\$150
Notes: Full-length mirror is 11.5" wide by 47.5" lor wide and 54" high min, 20" max AFF).	ng, and the bottom edge is 22.5" AFF (18"
CBC: 11B-803.6	
Other: -	
22 - 1 Bathing Facility	Category: 2
Provide an accessible shower	\$10,000
Notes: Shower seat does not stay folded.	
CBC: 11B-610.3	
Other: ADA 610.3	
22 - 2 Bathing Facility	Category: 2
Modify an accessible shower seat	\$125
Notes: Seat is mounted 2.5" from the side wall (1.	.5" max).
CBC: 11B-610.3	
Other: ADA 610.3	

Sport Center - Floor 2 21111 Stevens Creek Blvd. Cupertino, CA

)N

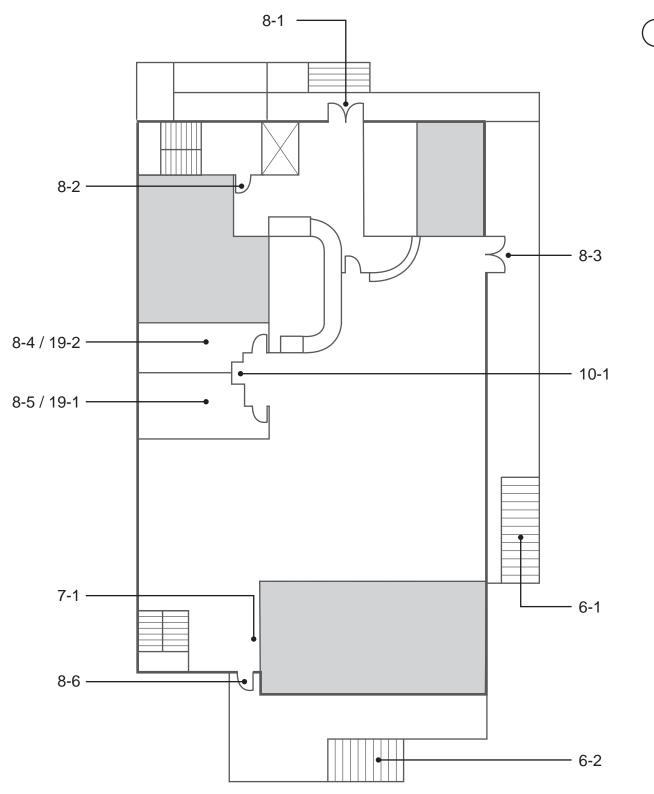


Floor 2	Cotogory 1
6 - 1 Stairway	Category: 1
Replace stairs	\$3,600
	25" (4" min to 7" max, uniform height required).
CBC: 11B-504.2	
Other: ADA 504.2, ADA 504.3	
6 - 2 Stairway	Category: 1
Replace stairs	\$3,600
Notes: Riser heights range from 7" to 8" (4 change in level in a few risers due to	· · · · · · · · · · · · · · · · · · ·
CBC: 11B-504.2	
Other: ADA 504.2, ADA 504.3	
Install a handrail	\$125
Notes: A parallel extension of 8" is provide	d at the top of the handrail (12" min).
CBC: 11B-505.10.2	
Other: ADA 505.10.2	
7 - 1 Hazard	Category: 2
Remove overhanging or protruding object	s \$125
Notes: Fire alarm protrudes 6.5" from the w	vall at 32" AFF (80" min).
CBC: 11B-307.4	
Other: ADA 307.4	
8 - 1 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Double door opening force is 14 lbs	and 10 lbs (5 lbs max).
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not	t provided in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	

	A -1 A	
8 - 2 Door/Gate	Category: 1	
Install or modify sign		\$250
Notes: A tactile and Braille EXIT sign is not provi	ded in passageway for emergency	/ exit.
CBC: 1011		
Other: ADA 216.4.1, ADA 703.4.1		
Adjust door closer		\$125
Notes: Door opening force is 12 lbs (5 lbs max).		
CBC: 11B-404.2.9		
Other: ADA 404.2.9		
8 - 3 Door/Gate	Category: 2	
Adjust door closer		\$125
Notes: Double door opening force is 14 lbs and 1	2 lbs (5 lbs).	
CBC: 11B-404.2.9		
Other: ADA 404.2.9		
8 - 4 Door/Gate	Category: 2	
Adjust door closer		\$125
Notes: Door opening force is 9 lbs (5 lbs max).		
CBC: 11B-404.2.9		
Other: ADA 404.2.9		
8 - 5 Door/Gate	Category: 2	
Adjust door closer		\$125
Notes: Door opening force is 10 lbs (5 lbs max).		
CBC: 11B-404.2.9		
Other: ADA 404.2.9		
8 - 6 Door/Gate	Category: 2	
Replace or modify door threshold		\$125
Notes: Beveled threshold has a vertical change of	of 1" (1/4" max, up to 1/2" with a b	evel).
CBC: 11B-404.2.5		
Other: ADA 404.2.5		
Install or modify sign		\$250
Notes: A tactile and Braille EXIT sign is not provi	ded in passageway for emergency	/ exit.
CBC: 1011		
Other: ADA 216.4.1, ADA 703.4.1		
Adjust door closer		\$125
Notes: Door opening force is 13 lbs due to initial	stick (5 lbs max).	
CBC: 11B-404.2.9	· · · · ·	

Floor 2 10 - 1		Cotocoru: 2	
	Drinking Fountain	Category: 3	¢1 БОО
	Iower fountain	2/01 (071 min)	\$1,500
	Space between floor and bottom of fountain is 25	-3/8 (27 min).	
	11B-306.3		
	ADA 306.3, ADA 306.3.1		<u> </u>
	n additional high or low fountain		\$3,000
	A higher standing person fountain is not provided.	•	
	11B-211.2		
	ADA 211.2		
19 - 1	Multiple User Restroom	Category: 2	• • • • •
	on clothing hooks		\$125
	Height of coat hook is 56.25" (48" max).		
	11B-603.4		
	ADA 308		• • •
-	or reposition mirror		\$150
	Bottom of the mirror's reflecting surface is 41.25"	AFF (40" max).	
	11B-603.3		
Other:	ADA 603.3		
	or replace compartment door hardware		\$175
Notes:	Compartment door is not self closing (compartme handles both inside and outside of the door and b		shaped
CBC:	11B-604.8.1.2		
Other:	ADA 604.8.1.2		
Replace	or modify grab bars		\$300
Notes:	Side grab bar extends 53.25" from the rear wall (5	54" min).	
CBC:	11B-604.5.1		
Other:	ADA 604.5.1		
Replace	or reposition dispenser		\$125
Notes:	Centerline of toilet paper is 12" in front of the wate	er closet (7" min to 9"	max).
CBC:	11B-604.7		
Other:	ADA 604.7		
Install re	estroom sign		\$250
Notes:	Bottom of top row of tactile lettering on federal sig space in front of the tactile and Braille sign is 16"		<). Clear floo
CBC:	-		
Other [.]	ADA 703		

Floor 2	
19 - 2 Multiple User Restroom	Category: 2
Reposition clothing hooks	\$125
Notes: Height of coat hook is 57" (48" max).	
CBC: 11B-603.4	
Other: ADA 308	
Replace or reposition mirror	\$150
Notes: Bottom of the mirror's reflecting surface is	41.5" AFF (40" max).
CBC: 11B-603.3	
Other: ADA 603.3	
Provide or replace compartment door hardware	\$175
Notes: Compartment door is not self closing (com handles both inside and outside of the doo	
CBC: 11B-604.8.1.2	
Other: ADA 604.8.1.2	
Replace or reposition dispenser	\$250
Notes: Centerline of toilet paper is 12" in front of t towel dispenser is located 41" AFF (40" ma	
CBC: 11B-604.7	
Other: ADA 604.7	
Provide clear floor or turning space	\$3,000
Notes: Clear floor space in front of the tactile and	Braille sign is 16" (18" min).
CBC: 11B-305.5	
Other: ADA 305.3, ADA 305.5	
Install restroom sign	\$250
Notes: Bottom of top row of tactile lettering on fed	eral sign is 62.5" AFF (60" max).
CBC: -	
Other: ADA 703	

Sterling/Barnhart Park 10486 Sterling Boulevard Cupertino, CA

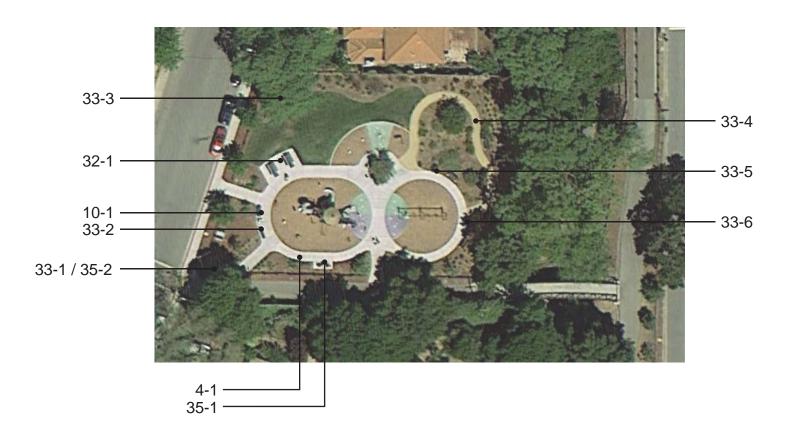

Sterling/Barnhart Park

4 - 1	Walk	Category: 2
	e surface	\$400
	Cross slope of concrete path is up to 2.9% for 1	
	11B-403.3	
	ADA 403.3	
10 - 1	Drinking Fountain	Category: 3
	e or provide maneuvering or clear floor area	\$1,000
	Clear floor space of the drinking fountain overla	
	11B-305, 11B-306, 11B-602.2	
	ADA 305, ADA 305.3, ADA 305.5, ADA 306	
	wing walls	\$1,000
	Drinking fountain protrudes 18.5" from vertical s than 4" must be mounted below 27" or above 80	upport at 27" AFF (protrusion more
CBC	11B-602.8, 11B-602.9	
Other	ADA 307	
Replace	or adjust water controls	\$125
CBC	Operating effort of control on the accessible drir Operating effort of control in standing person dr 11B-309	
Oth or		
	ADA 309	Category: 4
32 - 1	Picnic Area	Category: 4
32 - 1 Increase		\$700
32 - 1 Increase	Picnic Area e or provide clear floor area : Clear floor space around two picnic tables is 34. (36" min).	\$700
32 - 1 Increase Notes CBC	Picnic Area e or provide clear floor area : Clear floor space around two picnic tables is 34. (36" min).	\$700
32 - 1 Increase Notes CBC	Picnic Area e or provide clear floor area : Clear floor space around two picnic tables is 34 (36" min).	\$700
32 - 1 Increase Notes CBC Other 33 - 1	Picnic Area e or provide clear floor area : Clear floor space around two picnic tables is 34. (36" min). : - : AGODA 1011.2.1	\$700 5" on one side and 15" on the other.
32 - 1 Increase Notes CBC Other 33 - 1 Provide	Picnic Area e or provide clear floor area : Clear floor space around two picnic tables is 34. (36" min). : - : AGODA 1011.2.1 Outdoor Constructed Features	\$700 .5" on one side and 15" on the other Category: 3 \$0
32 - 1 Increase Notes CBC Other 33 - 1 Provide	Picnic Area or provide clear floor area Clear floor space around two picnic tables is 34 (36" min). - AGODA 1011.2.1 Outdoor Constructed Features an accessible path of travel Characteristic contained by the fixed recycling	\$700 .5" on one side and 15" on the other Category: 3 \$0
32 - 1 Increase Notes CBC Other 33 - 1 Provide Notes	Picnic Area or provide clear floor area Clear floor space around two picnic tables is 34 (36" min). - AGODA 1011.2.1 Outdoor Constructed Features an accessible path of travel Characteristic contained by the fixed recycling	\$700 .5" on one side and 15" on the other Category: 3 \$0
32 - 1 Increase Notes CBC Other 33 - 1 Provide Notes	Picnic Area or provide clear floor area Clear floor space around two picnic tables is 34. (36" min). - AGODA 1011.2.1 Outdoor Constructed Features an accessible path of travel An accessible route to the fixed recycling contai blocking recycling can.	\$700 .5" on one side and 15" on the other Category: 3 \$0
32 - 1 Increase Notes CBC Other 33 - 1 Provide Notes CBC Other 33 - 2	Picnic Area or provide clear floor area Clear floor space around two picnic tables is 34. (36" min). - AGODA 1011.2.1 Outdoor Constructed Features an accessible path of travel An accessible route to the fixed recycling contai blocking recycling can. - AGODA 1011.2.1	\$700 .5" on one side and 15" on the other Category: 3 \$0 ner is not provided. Trash can is
32 - 1 Increase Notes CBC Other 33 - 1 Provide Notes CBC Other 33 - 2 Increase	 Picnic Area or provide clear floor area Clear floor space around two picnic tables is 34. (36" min). - AGODA 1011.2.1 Outdoor Constructed Features an accessible path of travel An accessible route to the fixed recycling contai blocking recycling can. - AGODA 1011.2.1 Outdoor Constructed Features 	\$700 .5" on one side and 15" on the other Category: 3 \$0 ner is not provided. Trash can is Category: 4 \$700
32 - 1 Increase Notes CBC Other 33 - 1 Provide Notes CBC Notes SCBC	 Picnic Area or provide clear floor area Clear floor space around two picnic tables is 34. (36" min). - AGODA 1011.2.1 Outdoor Constructed Features an accessible path of travel An accessible route to the fixed recycling contai blocking recycling can. - AGODA 1011.2.1 Outdoor Constructed Features a clear floor area A clear floor space is not provided adjacent to the (36" by 48" min). 	\$700 .5" on one side and 15" on the other Category: 3 \$0 ner is not provided. Trash can is Category: 4 \$700

Sterling/Barnhart Park

33 - 3 Outdoor Constructed Features	Category: 4	
Provide an accessible path of travel		\$1,200
Notes: An accessible route to two fixed benches i over grass.	is not provided. Route is 30 linea	r feet
CBC: -		
Other: AGODA 1011.2.1		
Increase or provide clear floor area		\$700
Notes: A clear floor space is not provided adjacer	nt to the bench (36" by 48" min).	
CBC: 11B-305		
Other: AGODA 1011.2.1, ADA 305		
33 - 4 Outdoor Constructed Features	Category: 2	
ncrease or provide clear floor area		\$700
Notes: A clear floor space is not provided adjacer	nt to the bench (36" by 48" min).	
CBC: -		
Other: AGODA 1011.2.1		
33 - 5 Outdoor Constructed Features	Category: 2	
Increase or provide clear floor area		\$700
Notes: A clear floor space is not provided adjacer	nt to the bench (36" by 48" min).	
CBC: -		
Other: AGODA 1011.2.1		
33 - 6 Outdoor Constructed Features	Category: 4	
Increase or provide clear floor area		\$700
Notes: A clear floor space is not provided adjacer	nt to the bench (36" by 48" min).	
CBC: -		
Other: AGODA 1011.2.1		
35 - 1 Other	Category: 2	
Increase or provide maneuvering or clear floor a	Irea	\$1,000
Notes: Clear floor space is not provided at chess overlaps with path of travel.	table (36" by 48"). Clear floor spa	ace
CBC: 11B-305.5		
Other: ADA 305.3, ADA 305.5		
35 - 2 Other	Category: 3	
Reposition controls	~ .	\$200
Notes: Mutt Mitt is 51.5" AFF (15" min to 48" max	r).	
CBC: 11B-308.2.1, 11B-308.3		
,		

Stevens Creek Trail 21975 San Fernando Avenue Cupertino, CA

N T



Stevens Creek Trail


4 - 1	Walk	Category: 2
Regrade	e surface	\$3,840
Notes	Cross slope of path is up to 4.2% for 96	6 linear feet (2.0% max).
CBC:	: 11B-403.3	
Other	: ADA 403.3	
4 - 2	Walk	Category: 2
Regrade	e surface	\$7,240
Notes	Cross slope of path is up to 3% for 181	linear feet (2.0% max).
CBC	: 11B-403.3	
Other	: ADA 403.3	
4 - 3	Walk	Category: 2
Regrade	surface	\$840
Notes:	Cross slope of path is up to 3.6% for 2	linear feet (2.0% max).
CBC	: 11B-403.3	
Other	: ADA 403.3	
19 - 1	Multiple User Restroom	Category: 2
Renovat	te restroom	\$75,000
Notes:	The restrooms are not accessible and v	vill require a complete renovation.
CBC	: 11B-213, 11B-604	
Other	: ADA 213.3, ADA 604.8	
29 - 1	Game and Sports Area	Category: 2
Provide	an accessible path of travel	\$500
Notes:	An accessible route to the Bocce ball c	ourt is not provided. There is a 9" curb
	leading to the court (1/4" max, up to 1/2	2" with a bevel).
CBC:	: 11B-206.2.2	
Other	ADA 206.2.2	
32 - 1	Picnic Area	Category: 2
Provide	an accessible path of travel	\$800
Notes:	: An accessible route to three picnic table	es by the volleyball court is not provided, due
	to natural surface.	
CBC:	: 11B-403	
Other	AGODA F245.4	
32 - 2	Picnic Area	Category: 2
Provide	an accessible path of travel	\$800
Notes	An accessible route to six picnic tables	is not provided, due to natural surface.
CBC	: 11B-403	
000.		

Stevens Creek Trail

33 - 1 Outdoor Construc	ted Features	Category: 4	
Increase or provide clear fl	oor area		\$700
Notes: A clear floor space	is not provided adjacen	t to two benches (36" by 48" mi	n).
CBC: -			
Other: AGODA 1011.2.1			
33 - 2 Outdoor Construct	ted Features	Category: 2	
Provide an accessible path	of travel		\$800
Notes: An accessible route	e to six fixed bench is no	ot provided, due to natural surfa	ce.
CBC: -			
Other: AGODA 1011.2.1			
35 - 1 Other		Category: 3	
Provide an accessible path	of travel		\$240
Notes: An accessible route surface.	e to the Mutt Mitt is not p	provided. Route is 6 linear feet o	ver sandy
CBC: 11B-206.2			
Other: ADA 206.2			

Teen Center 21111 Stevens Creek Blvd. Cupertino, CA



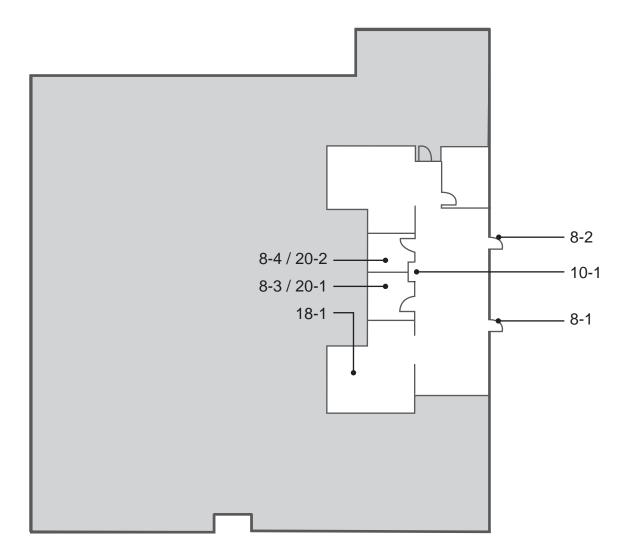

Teen Center

8 - 1 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Door opening force is 10 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Regrade surface	\$2,500
Notes: Slope on the swing side of the door is 2.7%	(2.0% max).
CBC: 11B-404.2.4.4	
Other: ADA 404.2.4.4	
8 - 2 Door/Gate	Category: 1
Adjust door closer	\$125
Notes: Door opening force is 10 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
8 - 3 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Door opening force is 13 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
Provide strike edge clearance	\$0
Notes: Front approach strike-edge clearance on the movable trash can (18" min).	e swing side of the door is 9.5" due to
CBC: 11B-404.2.4.1	
Other: ADA 404.2.4.1	
8 - 4 Door/Gate	Category: 2
Adjust door closer	\$125
Notes: Door opening force is 15 lbs (5 lbs max).	
CBC: 11B-404.2.9	
Other: ADA 404.2.9	
10 - 1 Drinking Fountain	Category: 3
Raise or lower fountain	\$1,500
Notes: Space between floor and bottom of fountain	
CBC: 11B-306.3	

Teen Center

20 1	Single Hear Bestreem	Catagory: 2
20 - 1 Install r	Single User Restroom estroom sign	Category: 2 \$250
	Bottom of top row of tactile lettering on federal sign is	
CBC		
	ADA 703	
	or modify grab bars	\$300
•	Side grab bar ends 52.5" from the rear wall (54" min).	4000
	11B-604.5.1	
	ADA 604.5.1	
	or reposition dispenser	\$250
-	Height of soap dispenser is 41.5" AFF (40" max). Cent dispenser is flush with the front edge of the water close	terline of toilet paper
CBC	11B-603.5	
Other	-	
20 - 2	Single User Restroom	Category: 2
Install re	estroom sign	\$250
Notes	Bottom of the top row of tactile lettering on federal sign	n is 62.5" AFF (60" max).
CBC	-	
Other	ADA 703	
Replace	or modify grab bars	\$600
Notes	Side grab bar extends 52" from the rear wall (54" min) from the centerline of the water closet (36" long min, e from centerline of water closet)	•
CBC	11B-604.5.1, 11B-604.5.2	

Three Oaks Park Candlelight Way near Rainbow Cupertino, CA



— 1-1 / 3-1


1 - 1 Parking Area	Category: 1
Regrade accessible parking space or access ais	le \$1,600
Notes: Slopes of accessible parking is 4% and up	to 4.9% at asphalt patch to ramp (2%
max).	
CBC: 11B-502.4	
Other: ADA 502.4	
Install van accessible sign	\$375
Notes: A "Van Accessible" sign is not provided. R posted at stalls striped and designated to l	•
CBC: 11B-502.6	
Other: ADA 208.2.4	
Provide or modify accessible access aisles	\$210
Notes: Van access aisle width is 94" (96" min).	
CBC: 11B-502.2, 11B-502.3.1	
Other: ADA 502.3.1	
3 - 1 Curb Ramp	Category: 1
Provide detectable warnings	\$1,000
Notes: Truncated domes are 2.5" apart (2.35" ma	x).
CBC: 11B-406.5.12	
Other: ADA 705.1	
Grind or patch vertical change of grade	\$250
Notes: 1/2" change in level at top of the curb ram changes).	p (curb ramp must be free of level
CBC: 11B-303.2.3, 11B-405.4	
Other: ADA 405.4	
4 - 1 Walk	Category: 1
Regrade surface	\$800
Notes: Cross slope of asphalt path is up to 4.4%	for 40 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 2 Walk	Category: 1
Regrade surface	\$260
Notes: Running slope of asphalt path is up to 15%	6 for 13 linear feet (5.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	

4 - 3	Walk	Category: 1
Regrade	surface	\$240
Notes:	Running slope of asphalt path is up to 79	% for 12 linear feet (5.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
10 - 1	Drinking Fountain	Category: 3
Increase	or provide maneuvering or clear floor	area \$1,000
Notes:	Slope of clear space in front of the water	r fountain is 3.4% (2.0% max).
CBC:	11B-305, 11B-306, 11B-602.2	
Other:	ADA 305, ADA 305.3, ADA 305.5, ADA 3	306
Replace	fountain	\$3,000
Notes:	Bubbler height is 36.5" AFF (36" max for	an accessible fountain).
CBC:	11B-602.4	
Other:	ADA 602.4	
Install a	n additional high or low fountain	\$3,000
Notes:	A higher standing person fountain is not	provided.
CBC:	11B-211.2	
Other:	ADA 211.2	
32 - 1	Picnic Area	Category: 4
Provide	an accessible path of travel	\$4,920
Notes:	An accessible route to the picnic area is muddy natural surface. Surface is compa granite but firm and stable. Observed to	•
CBC:	11B-403	
Other:	AGODA F245.4	
Provide	an accessible table	\$500
Notes:	Knee clearance is 25.75"measured at 8 tabletop (27" min).	" horizontally from the front face of the
CBC:	11B-306.3	
Other:	-	
Increase	or provide clear floor area	\$700
Notes:	A 36" min clear space around the picnic	table is not provided.
CBC:		
Other:	AGODA 1011.2.1	

32 - 2 Picnic Area	Category: 4
Provide an accessible path of travel	\$1,000
	a is not provided. Route is 25 linear feet over
CBC: 11B-403	
Other: AGODA F245.4	
Provide an accessible table	\$500
Notes: Knee clearance is 26.5" measured at tabletop (27" min).	t 8" horizontally from the front face of the
CBC: 11B-306.3	
Other: -	
Increase or provide clear floor area	\$700
Notes: A 36" min clear space around the pic	nic table is not provided.
CBC: -	
Other: AGODA 1011.2.1	
35 - 1 Other	Category: 3
Reposition controls	\$200
Notes: Mutt Mitt dispenser is 50" AFF (15" m	nin to 48" max).
CBC: 11B-308.2.1, 11B-308.3	
Other: ADA 308.2, ADA 308.2.1, ADA 308.3	3, ADA 308.3.1, ADA 308.3.2
35 - 2 Other	Category: 3
Reposition controls	\$200
Notes: Mutt Mitt dispenser is 51.5" AFF (15"	min to 48" max).
CBC: 11B-308.2.1, 11B-308.3	
Other: ADA 308.2, ADA 308.2.1, ADA 308.3	3, ADA 308.3.1, ADA 308.3.2
43 - 1 Play Equipment Area	Category: 2
Regrade or replace ramp	\$4,250
Notes: Ramp connecting the surface ground max).	I and the play area has a slope of 8.3% (6.25%
CBC: 11B-1008.2.5.1	
Other: ADA 1008.2.5.1	

43 - 2 P	ay Equipment Area	Category: 2
Provide an	accessible path of travel	\$900
to	n accessible route to the swing area is not pro 1/2" with a bevel). No accessible route to pla et over sand and has 2" change in level from	ay area is provided. Route is 16 linear
CBC: 1	IB-206.2.17	
Other: A	DA 206.2.17	
	r replace ramp	\$4.250
Regrade o		+ ,
•	amp from surface to play area has a slope of	12.6% (6.25% max).
Notes: R	· ·	12.6% (6.25% max).

Varian Park Ainsworth Drive Cupertino, CA

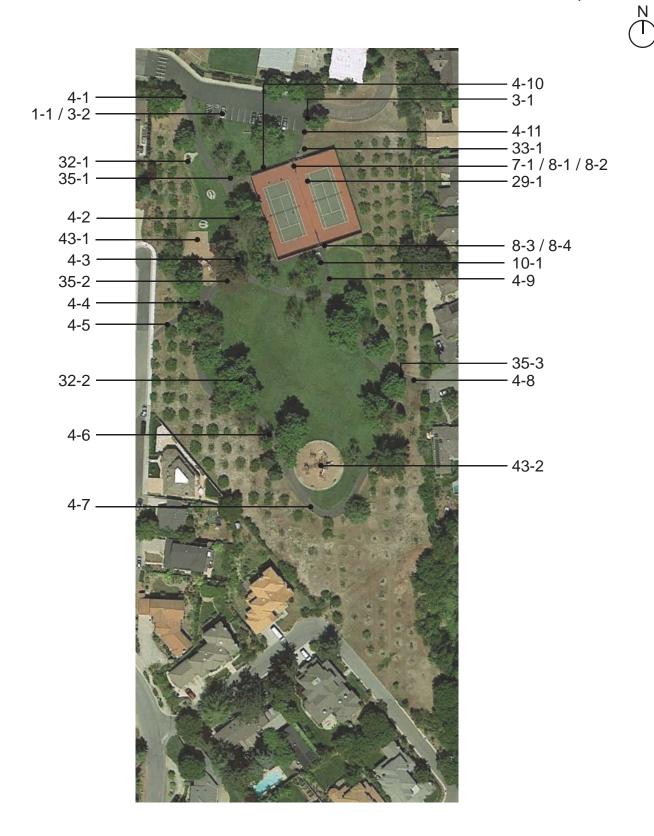

1 - 1 Parking Area	Category: 1
nstall van accessible sign	\$375
Notes: A "Van Accessible" sign is not provided. Required posted at stalls striped and designated to be van	5
CBC: 11B-502.6	
Other: ADA 208.2.4	
Provide an accessible path of travel	\$2,460
Notes: There is no accessible path of travel from access located at top of the parking space rather than ac	
CBC: 11B-502.7.1	
Other: ADA 502.3	
3 - 1 Curb Ramp	Category: 1
Provide or relocate crossing or curb markings	\$0
Notes: A curb ramp is not provided at the corner of at a	walk that crosses a curb. (See 1-1)
CBC: 11B-406.4	
Other: ADA 406.1	
3 - 2 Curb Ramp	Category: 1
Provide detectable warnings	\$0
Notes: Truncated dooms are 2.5" apart (2.35" max).	
CBC: 11B-406.5.12	
Other: ADA 705.1	
nstall, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 8.8% (8.33% max).	
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	
4 - 1 Walk	Category: 1
Detectable warnings	\$1,000
Notes: No detectable warnings are provided where a wa	
CBC: 11B-705.1.2	
······	
CBC: 11B-705.1.2	Category: 2
CBC: 11B-705.1.2 Other: -	Category: 2 \$440
CBC: 11B-705.1.2 Other: - 4 - 2 Walk	\$440
CBC: 11B-705.1.2 Other: - 4 - 2 Walk Regrade surface	\$440

4 - 3	Walk	Category: 2
Regrade	surface	\$960
Notes:	Cross slope of asphalt path is up to 8%	6 for 48 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 4	Walk	Category: 2
Regrade	surface	\$200
Notes:	Cross slope of asphalt path is up to 4.9	9% for 10 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 5	Walk	Category: 1
Regrade	surface	\$820
Notes:	Cross slope of asphalt path is up to 5% running slope in the last 5 linear feet (5	6 for 41 linear feet (2.0% max). 10.5% of 5% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 6	Walk	Category: 2
Regrade	surface	\$460
Notes:	Cross slope of asphalt path is up to 3.3	3% for 23 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 7	Walk	Category: 2
Regrade	surface	\$440
Notes:	Cross slope of asphalt path is up to 8%	6 for 22 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 8	Walk	Category: 1
Regrade	surface	\$820
Notes:	Running slope of asphalt path is up to	7.8% for 41 linear feet (5.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
Detectab	le warnings	\$1,000
Notes:	No detectable warnings are provided w	vhere a walk adjoins vehicular area.
CBC:	11B-705.1.2	
Other:	-	

4 - 9	Walk	Category: 2
Regrade	e surface	\$980
Notes	: Cross slope of asphalt path is up to 4	1.2% for 49 linear feet (2.0% max).
CBC	: 11B-403.3	
Other	: ADA 403.3	
4 - 10	Walk	Category: 2
Regrade	e surface	\$380
Notes	: Running slope of asphalt path is up t	o 9.5% for 19 linear feet (5.0% max).
CBC	: 11B-403.3	
Other	: ADA 403.3	
4 - 11	Walk	Category: 1
Regrade	e surface	\$1,060
Notes	: Running slope of asphalt path is up t (2.0% max) for 53 linear feet.	o 10% (5.0% max) and cross slope is up to 5%
CBC	: 11B-403.3	
Other	: ADA 403.3	
7 - 1	Hazard	Category: 2
Remove	overhanging or protruding objects	\$125
Notes	: Tennis court play order board protruc more than 4" must be mounted below	des 9" from the wall at 40" AFF (protrusion v 27" or above 80").
CBC	: 11B-307.4	
Other	: ADA 307.4	
8 - 1	Door/Gate	Category: 2
Regrade	e surface	\$2,500
Notes	: Slope on the swing side of the door is	s 9% (2.0% max).
	: 11B-404.2.4.4	
CBC	: 11B-404.2.4.4 : ADA 404.2.4.4	
CBC: Other	-	\$125
CBC: Other Replace	: ADA 404.2.4.4 or modify door threshold	\$125 to the court surface (1/4" max, up to 1/2" with
CBC Other Replace Notes	: ADA 404.2.4.4 or modify door threshold : Threshold has a vertical change of 1	
CBC Other Replace Notes CBC	: ADA 404.2.4.4 e or modify door threshold : Threshold has a vertical change of 1 a bevel).	· · · · · · · · · · · · · · · · · · ·
CBC Other Replace Notes CBC Other	: ADA 404.2.4.4 e or modify door threshold : Threshold has a vertical change of 1 a bevel). : 11B-404.2.5	
CBC Other Replace Notes CBC Other Provide	: ADA 404.2.4.4 or modify door threshold : Threshold has a vertical change of 1 a bevel). : 11B-404.2.5 : ADA 404.2.5	to the court surface (1/4" max, up to 1/2" with
CBC Other Replace Notes CBC Other Provide Notes	: ADA 404.2.4.4 e or modify door threshold : Threshold has a vertical change of 1 a bevel). : 11B-404.2.5 : ADA 404.2.5 or modify door kickplate	to the court surface (1/4" max, up to 1/2" with


Category: 2
\$125
Irt surface (1/4" max, up to 1/2" with
\$225
s not provided.
\$2,500
max).
Category: 2
\$125
irt surface (1/4" max, up to 1/2" with
\$225
s not provided.
!
\$1,650
s (32" min).
5 (JZ 11111).
5 (52 11111).

8 - 4	Door/Gate	Category: 2
Replace	or modify door threshold	\$125
Notes:	Threshold has a vertical change of 1" to a bevel).	o the court surface (1/4" max, up to 1/2" with
CBC:	11B-404.2.5	
Other:	ADA 404.2.5	
Provide	or modify door kickplate	\$225
Notes:	A smooth and uninterrupted kick plates	surface is not provided.
CBC:	11B-404.2.10	
Other:	ADA 404.2.10	
Enlarge	door opening	\$1,650
Notes:	Width of clear opening is 13" due to two	o bollards (32" min).
CBC:	11B-404.2.3	
Other:	ADA 404.2.3	
10 - 1	Drinking Fountain	Category: 3
Install a	n additional high or low fountain	\$3,000
Notes:	A standing person drinking fountain is r	not provided.
CBC:	11B-211.2	
Other:	ADA 211.2	
29 - 1	Game and Sports Area	Category: 2
Enlarge	door opening	\$150
Notes:	Clear width of gate opening between te	ennis courts is 31.75" (32" min).
CBC:	11B-404.2.3	
Other:	ADA 404.2.3	
32 - 1	Picnic Area	Category: 4
Increase	or provide clear floor area	\$700
Notes:	Clear floor space between grill and picr	nic table is 13"; table offset is 27" (36" min).
CBC:	-	
Other:	AGODA 1011.2.1	
Provide	an accessible path of travel	\$180
Notes:	An accessible route to the picnic area a provided. Rout is 56" over natural surfa	and fixed trash/recycling container is not ice.
CBC:	11B-403	
Other	AGODA F245.4	

32 - 2 Picnic Area	Category: 2
ncrease or provide clear floor area	\$700
Notes: Clear floor space around the picnic table is 2 the grill and the picnic table is 26" (36" min).	
CBC: -	
Other: AGODA 1011.2.1	
Provide an accessible path of travel	\$300
Notes: An accessible route to the picnic area is not grass to picnic area.	provided. Route is 15 linear feet over
CBC: 11B-403	
Other: AGODA F245.4	
Provide an accessible table	\$500
Notes: Knee space is 24" wide (30" min).	
CBC: 11B-306.3	
Other: -	
33 - 1 Outdoor Constructed Features	Category: 3
33 - 1 Outdoor Constructed Features Regrade surface	Category: 3 \$250
	\$250
Regrade surface	\$250
Regrade surface Notes: Clear floor space adjacent to the trash conta	\$250
Regrade surface Notes: Clear floor space adjacent to the trash conta CBC: -	\$250
Regrade surfaceNotes: Clear floor space adjacent to the trash contaCBC: -Other: AGODA 1011.2.333 - 2Outdoor Constructed Features	\$250 ainer has a slope of 9% (2.0% max). Category: 3
Regrade surface Notes: Clear floor space adjacent to the trash conta CBC: - Other: AGODA 1011.2.3	\$250 ainer has a slope of 9% (2.0% max). Category: 3 \$250
Regrade surface Notes: Clear floor space adjacent to the trash conta CBC: - Other: AGODA 1011.2.3 33 - 2 Outdoor Constructed Features Regrade surface	\$250 ainer has a slope of 9% (2.0% max). Category: 3 \$250
Regrade surface Notes: Clear floor space adjacent to the trash conta CBC: - Other: AGODA 1011.2.3 33 - 2 Outdoor Constructed Features Regrade surface Notes: Clear floor space in front of the Mutt Mitt has	\$250 ainer has a slope of 9% (2.0% max). Category: 3 \$250
Regrade surface Notes: Clear floor space adjacent to the trash conta CBC: - Other: AGODA 1011.2.3 33 - 2 Outdoor Constructed Features Regrade surface Notes: Clear floor space in front of the Mutt Mitt has CBC: -	\$250 ainer has a slope of 9% (2.0% max). Category: 3 \$250
Regrade surface Notes: Clear floor space adjacent to the trash conta CBC: - Other: AGODA 1011.2.3 33 - 2 Outdoor Constructed Features Regrade surface Notes: Clear floor space in front of the Mutt Mitt has CBC: - Other: AGODA 1011.2.3	\$250 ainer has a slope of 9% (2.0% max). Category: 3 \$250 s a slope of up to 7.5% (2% max). Category: 3
Regrade surface Notes: Clear floor space adjacent to the trash conta CBC: - Other: AGODA 1011.2.3 33 - 2 Outdoor Constructed Features Regrade surface Notes: Clear floor space in front of the Mutt Mitt has CBC: - Other: AGODA 1011.2.3	\$250 ainer has a slope of 9% (2.0% max). Category: 3 \$250 s a slope of up to 7.5% (2% max). Category: 3 ea \$1,000
Regrade surface Notes: Clear floor space adjacent to the trash conta CBC: - Other: AGODA 1011.2.3 33 - 2 Outdoor Constructed Features Regrade surface Notes: Clear floor space in front of the Mutt Mitt has CBC: - Other: AGODA 1011.2.3 35 - 1 Other ncrease or provide maneuvering or clear floor are	\$250 ainer has a slope of 9% (2.0% max). Category: 3 \$250 s a slope of up to 7.5% (2% max). Category: 3 ea \$1,000
Regrade surface Notes: Clear floor space adjacent to the trash conta CBC: - Other: AGODA 1011.2.3 33 - 2 Outdoor Constructed Features Regrade surface Notes: Clear floor space in front of the Mutt Mitt has CBC: - Other: AGODA 1011.2.3 35 - 1 Other ncrease or provide maneuvering or clear floor are Notes: Clear floor space in front of the Mutt Mitt has	\$250 ainer has a slope of 9% (2.0% max). Category: 3 \$250 s a slope of up to 7.5% (2% max). Category: 3 ea \$1,000
Regrade surface Notes: Clear floor space adjacent to the trash conta CBC: - Other: AGODA 1011.2.3 33 - 2 Outdoor Constructed Features Regrade surface Notes: Clear floor space in front of the Mutt Mitt has CBC: - Other: AGODA 1011.2.3 35 - 1 Other ncrease or provide maneuvering or clear floor are Notes: Clear floor space in front of the Mutt Mitt has CBC: - Other AGODA 1011.2.3	\$250 ainer has a slope of 9% (2.0% max). Category: 3 \$250 s a slope of up to 7.5% (2% max). Category: 3 ea \$1,000
RegradesurfaceNotes:Clear floor space adjacent to the trash contaCBC:-Other:AGODA 1011.2.333 - 2Outdoor Constructed FeaturesRegradesurfaceNotes:Clear floor space in front of the Mutt Mitt hasCBC:-Other:AGODA 1011.2.335 - 1Otherncrease or provide maneuvering or clear floor areNotes:Clear floor space in front of the Mutt Mitt hasCBC:1Otherncrease or provide maneuvering or clear floor areNotes:Clear floor space in front of the Mutt Mitt hasCBC:11B-305.5Other:ADA 305.3, ADA 305.5	\$250 ainer has a slope of 9% (2.0% max). Category: 3 \$250 s a slope of up to 7.5% (2% max). Category: 3 Category: 3 Category: 3
Regrade surfaceNotes: Clear floor space adjacent to the trash contaCBC: -Other: AGODA 1011.2.333 - 2Outdoor Constructed FeaturesRegrade surfaceNotes: Clear floor space in front of the Mutt Mitt hasCBC: -Other: AGODA 1011.2.335 - 1Otherncrease or provide maneuvering or clear floor areNotes: Clear floor space in front of the Mutt Mitt hasCBC: 11B-305.5Other: ADA 305.3, ADA 305.535 - 2Other	\$250 ainer has a slope of 9% (2.0% max). Category: 3 \$250 s a slope of up to 7.5% (2% max). Category: 3 ea \$1,000 s a slope of up to 5% (2% max).
RegradesurfaceNotes:Clear floor space adjacent to the trash contaCBC:-Other:AGODA 1011.2.333 - 2Outdoor Constructed FeaturesRegradesurfaceNotes:Clear floor space in front of the Mutt Mitt hasCBC:-Other:AGODA 1011.2.335 - 1Otherncrease or provide maneuvering or clear floor areNotes:Clear floor space in front of the Mutt Mitt hasCBC:-Other:AGODA 1011.2.335 - 1Otherncrease or provide maneuvering or clear floor areNotes:Clear floor space in front of the Mutt Mitt hasCBC:11B-305.5Other:ADA 305.3, ADA 305.535 - 2Otherncrease or provide maneuvering or clear floor are	\$250 ainer has a slope of 9% (2.0% max). Category: 3 \$250 s a slope of up to 7.5% (2% max). Category: 3 ea \$1,000 s a slope of up to 5% (2% max).

Varian Park

43 - 1 Play Equipment Area	Category: 2
Regrade or replace ramp	\$4,250
Notes: Ramp from ground surface to the pla- max).	y area has a running slope of 8.5% (6.25%
CBC: 11B-1008.2.5.1	
Other: ADA 1008.2.5.1	
43 - 2 Play Equipment Area	Category: 2
Regrade or replace ramp	\$4,250
Notes: Ramp to play area has a running slop	be of 20.2% (6.25% max).
CBC: 11B-1008.2.5.1	
Other: ADA 1008.2.5.1	
Provide play components	\$5,000
Notes: There are 8 elevated play component components, each a different type).	ts and no ground play components (3 min
CBC: 11B-240.2.1.2	
Other: ADA 240.2.1.2	

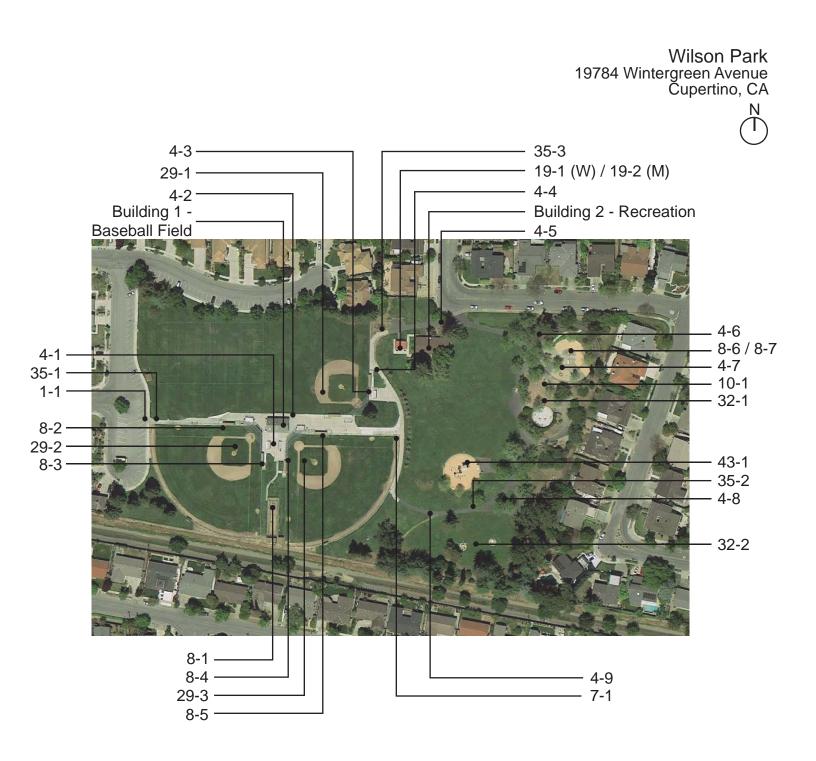

1 - 1	Parking Area Category	:1
Provide	adequate striping	\$100
Notes	The words "No Parking" are not painted in the access aisle.	
CBC	11B-502.3.3	
Other	-	
Provide	or modify accessible access aisles	\$210
Notes:	Access aisle does not have a blue border.	
CBC	11B-502.3.2, 11B-502.3.3	
Other	ADA 502.3.3	
Regrade	accessible parking space or access aisle	\$1,600
Notes:	The slope in the access aisle is of the van space is up to 4% (2%	% max).
CBC:	11B-502.4	
Other	ADA 502.4	
4 - 1	Walk Category	:2
Regrade	surface	\$1,200
Notes:	Cross slope of concrete path is up to 3% for 30 linear feet (2.0%	max).
CBC	11B-403.3	
Other	ADA 403.3	
Grind or	patch vertical change of grade	\$250
Notes	3/4" change in level at joints in the plaza area (1/4" max, up to 1.	/2" with a bevel).
CBC	11B-303.2	
Other	ADA 303.2, ADA 303.3	
4 - 2	Walk Category	:2
Grind or	patch vertical change of grade	\$250
Notes	A 29" long, 2" wide and 3" deep change in level due to cracked p up to 1/2" with a bevel).	pavement (1/4" max
CBC	11B-303.2	
Other	ADA 303.2, ADA 303.3	
4 - 3	Walk Category	:2
Regrade	surface	\$1,600
Notes	Cross slope of concrete path is up to 2.6% for 40 linear feet (2.0	% max).
CBC	11B-403.3	
Other	ADA 403.3	

4 - 4	Walk	Category: 2	
Regrade	surface	\$1,	320
Notes:	Cross slope of concrete path is up to 2.5%	6 for 33 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 5	Walk	Category: 1	
Regrade	surface	\$3,	000
	600 square feet of asphalt walk up to 5.89 max running slope, 2% max cross slope).	% running slope and 4.4% cross slope	(5%
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 6	Walk	Category: 1	
Regrade	surface	\$	400
Notes:	Cross slope of asphalt path is up to 4% for	r 20 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 7	Walk	Category: 2	
Regrade	surface	\$1,	520
	Cross slope of asphalt path is up to 3.4% max).	for 76 linear feet inside play area (2.0	%
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 8	Walk	Category: 2	
Regrade	surface	\$	620
Notes:	Cross slope of asphalt path is up to 3.6%	for 31 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 9	Walk	Category: 2	
Regrade	surface	\$	600
Notes:	Running slope of asphalt path is up to 9.1	% (5.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
7 - 1	Hazard	Category: 2	
Reduce o	or eliminate opening	\$	250
	A 10" long, 1.5" wide and 10" deep gap ir	concrete pavement (1/2" max openir	ng).
110100.			
	11B-302.3		

8 - 1	Door/Gate	Category: 2
Provide	or modify door kickplate	\$22
Notes:	A smooth and uninterrupted kick plate	e surface is not provided on the gate to the
	batting cage.	
CBC:	11B-404.2.10	
Other:	ADA 404.2.10	
8 - 2	Door/Gate	Category: 2
Provide	or modify door kickplate	\$22
Notes:	A smooth and uninterrupted kick plate field.	e surface is not provided on the gate to the
CBC:	11B-404.2.10	
Other:	ADA 404.2.10	
8 - 3	Door/Gate	Category: 2
Provide	or modify door kickplate	\$22
Notes:	A smooth and uninterrupted kick plate entrance to the play area.	e surface is not provided on the gate to the
CBC:	11B-404.2.10	
Other:	ADA 404.2.10	
8 - 4	Door/Gate	Category: 2
Provide	or modify door kickplate	\$22
Notes:	A smooth and uninterrupted kick plate entrance to the play area.	e surface is not provided on the gate to the
CBC:	11B-404.2.10	
Other:	ADA 404.2.10	
8 - 5	Door/Gate	Category: 2
Provide	or modify door kickplate	\$22
Notes:	A smooth and uninterrupted kick plate batting cage.	e surface is not provided on the gate to the
CBC:	11B-404.2.10	
Other:	ADA 404.2.10	
8 - 6	Door/Gate	Category: 2
Provide	or modify door kickplate	\$22
Notes:	A smooth and uninterrupted kick plate	surface is not provided.
110100.		
	11B-404.2.10	

8 - 7	Door/Gate	Category: 2
Provide	or modify door kickplate	\$225
Notes:	A smooth and uninterrupted kick plate su	Irface is not provided.
CBC:	11B-404.2.10	
Other:	ADA 404.2.10	
10 - 1	Drinking Fountain	Category: 3
Adjust tl	ne water stream height or direction	\$125
Notes:	The flow of the water is 2" high (4" high r	nin).
CBC:	11B-602.6	
Other:	ADA 602.6	
Raise or	lower fountain	\$1,500
Notes:	Space between ground and bottom of for	untain is 26-3/4" (27" min).
CBC:	11B-306.3	
Other:	ADA 306.3, ADA 306.3.1	
19 - 1	Multiple User Restroom	Category: 2
Provide	or replace compartment door hardware	e \$175
Notes:	Compartment door is not self-closing (co	· · ·
	handles both inside and outside of the do	por and be self-closing).
CBC:	11B-604.8.1.2	oor and be self-closing).
		oor and be self-closing).
Other:	11B-604.8.1.2	bor and be self-closing). \$250
Other: Replace	11B-604.8.1.2 ADA 604.8.1.2 or reposition dispenser Toilet seat cover dispenser is mounted b	\$250
Other: Replace Notes:	11B-604.8.1.2 ADA 604.8.1.2 or reposition dispenser Toilet seat cover dispenser is mounted b with a 30" by 48" clear space). Centerline	\$250 ehind the water closet at 42" AFF (40" max
Other: Replace Notes: CBC:	11B-604.8.1.2 ADA 604.8.1.2 or reposition dispenser Toilet seat cover dispenser is mounted b with a 30" by 48" clear space). Centerline closet (7" min to 9" max).	\$250 ehind the water closet at 42" AFF (40" max,
Other: Replace Notes: CBC: Other:	11B-604.8.1.2 ADA 604.8.1.2 or reposition dispenser Toilet seat cover dispenser is mounted b with a 30" by 48" clear space). Centerline closet (7" min to 9" max). 11B-603.5, 11B-604.7, 11B-606.1	\$250 ehind the water closet at 42" AFF (40" max
Other: Replace Notes: CBC: Other: Repositi	11B-604.8.1.2 ADA 604.8.1.2 or reposition dispenser Toilet seat cover dispenser is mounted b with a 30" by 48" clear space). Centerline closet (7" min to 9" max). 11B-603.5, 11B-604.7, 11B-606.1 ADA 604.7	\$250 ehind the water closet at 42" AFF (40" max e of toilet paper is 10" in front of the water \$750
Other: Replace Notes: CBC: Other: Repositi Notes:	11B-604.8.1.2 ADA 604.8.1.2 or reposition dispenser Toilet seat cover dispenser is mounted b with a 30" by 48" clear space). Centerline closet (7" min to 9" max). 11B-603.5, 11B-604.7, 11B-606.1 ADA 604.7 on toilet flush controls	\$250 ehind the water closet at 42" AFF (40" max e of toilet paper is 10" in front of the water \$750
Other: Replace Notes: CBC: Other: Repositi Notes: CBC:	11B-604.8.1.2 ADA 604.8.1.2 or reposition dispenser Toilet seat cover dispenser is mounted b with a 30" by 48" clear space). Centerline closet (7" min to 9" max). 11B-603.5, 11B-604.7, 11B-606.1 ADA 604.7 on toilet flush controls Operating effort of flush control is 20 lbs	\$250 ehind the water closet at 42" AFF (40" max e of toilet paper is 10" in front of the water \$750
Other: Replace Notes: CBC: Other: Repositi Notes: CBC: Other:	11B-604.8.1.2 ADA 604.8.1.2 or reposition dispenser Toilet seat cover dispenser is mounted b with a 30" by 48" clear space). Centerline closet (7" min to 9" max). 11B-603.5, 11B-604.7, 11B-606.1 ADA 604.7 on toilet flush controls Operating effort of flush control is 20 lbs 11B-604.6	\$250 ehind the water closet at 42" AFF (40" max e of toilet paper is 10" in front of the water \$750
Other: Replace Notes: CBC: Other: Repositi Notes: CBC: Other: Replace	11B-604.8.1.2 ADA 604.8.1.2 or reposition dispenser Toilet seat cover dispenser is mounted b with a 30" by 48" clear space). Centerline closet (7" min to 9" max). 11B-603.5, 11B-604.7, 11B-606.1 ADA 604.7 on toilet flush controls Operating effort of flush control is 20 lbs 11B-604.6 ADA 604.6	\$250 ehind the water closet at 42" AFF (40" max e of toilet paper is 10" in front of the water \$750 (5 lbs max). \$300
Other: Replace Notes: CBC: Other: Repositi Notes: CBC: Other: Replace Notes:	11B-604.8.1.2 ADA 604.8.1.2 or reposition dispenser Toilet seat cover dispenser is mounted b with a 30" by 48" clear space). Centerline closet (7" min to 9" max). 11B-603.5, 11B-604.7, 11B-606.1 ADA 604.7 on toilet flush controls Operating effort of flush control is 20 lbs 11B-604.6 ADA 604.6 or modify grab bars	\$250 ehind the water closet at 42" AFF (40" max e of toilet paper is 10" in front of the water \$750 (5 lbs max). \$300

Wilson Park

19 - 2	Multiple User Restroom	Category: 2
Provide	or replace compartment door hardware	\$175
Notes:	Compartment door is not self-closing (compartment of handles both inside and outside of the door and be s	•
CBC:	11B-604.8.1.2	
Other:	ADA 604.8.1.2	
Replace	or reposition dispenser	\$250
Notes:	Toilet seat cover dispenser is mounted behind the was space). Centerline of toilet paper is 12" in front of the	· ·
	11B-603.5, 11B-604.7, 11B-606.1	
Other:	ADA 604.7	
•	ion toilet flush controls	\$750
	Operating effort of flush control is 20 lbs (5 lbs max).	
	11B-604.6	
Other:	ADA 604.6	
•	or modify grab bars	\$0
Notes:	Toilet paper is 5" above the side grab bar (12" min cl	aar shaca ahaya arah har)
		ear space above grab bar).
CBC:	11B-609.3	ear space above grab bar).
CBC: Other:	11B-609.3 ADA 609.3	
CBC: Other: 29 - 1	11B-609.3 ADA 609.3 Game and Sports Area	Category: 2
CBC: Other: 29 - 1 Provide	11B-609.3 ADA 609.3 Game and Sports Area wheelchair seating	Category: 2 \$1,400
CBC: Other: 29 - 1 Provide	11B-609.3 ADA 609.3 Game and Sports Area	Category: 2 \$1,400
CBC: Other: 29 - 1 Provide Notes:	11B-609.3 ADA 609.3 Game and Sports Area wheelchair seating No wheelchair spaces provided in team seating area	Category: 2 \$1,400
CBC: Other: 29 - 1 Provide Notes: CBC:	11B-609.3 ADA 609.3 Game and Sports Area wheelchair seating No wheelchair spaces provided in team seating area space).	Category: 2 \$1,400
CBC: Other: 29 - 1 Provide Notes: CBC: Other:	11B-609.3 ADA 609.3 Game and Sports Area wheelchair seating No wheelchair spaces provided in team seating area space). 11B-221.2.1.4	Category: 2 \$1,400
CBC: Other: 29 - 1 Provide Notes: CBC: Other: Provide	11B-609.3 ADA 609.3 Game and Sports Area wheelchair seating No wheelchair spaces provided in team seating area space). 11B-221.2.1.4 ADA 221.2.1.4	Category: 2 \$1,400 s (two min - one per team
CBC: Other: 29 - 1 Provide Notes: CBC: Other: Provide Notes:	11B-609.3 ADA 609.3 Game and Sports Area wheelchair seating No wheelchair spaces provided in team seating area space). 11B-221.2.1.4 ADA 221.2.1.4 an accessible path of travel	Category: 2 \$1,400 s (two min - one per team
CBC: Other: 29 - 1 Provide Notes: CBC: Other: Provide Notes: CBC:	11B-609.3 ADA 609.3 Game and Sports Area wheelchair seating No wheelchair spaces provided in team seating area space). 11B-221.2.1.4 ADA 221.2.1.4 an accessible path of travel Clear width of turn to two dugouts is 44" (48" min).	Category: 2 \$1,400 s (two min - one per team
CBC: Other: 29 - 1 Provide Notes: CBC: Other: Provide Notes: CBC:	11B-609.3 ADA 609.3 Game and Sports Area wheelchair seating No wheelchair spaces provided in team seating area space). 11B-221.2.1.4 ADA 221.2.1.4 an accessible path of travel Clear width of turn to two dugouts is 44" (48" min). 11B-206.2.12, 11B-206.2.2 ADA 206.2.2	Category: 2 \$1,400 s (two min - one per team
CBC: Other: 29 - 1 Provide Notes: CBC: Other: CBC: CBC: Other: 29 - 2	11B-609.3 ADA 609.3 Game and Sports Area wheelchair seating No wheelchair spaces provided in team seating area space). 11B-221.2.1.4 ADA 221.2.1.4 an accessible path of travel Clear width of turn to two dugouts is 44" (48" min). 11B-206.2.12, 11B-206.2.2 ADA 206.2.2	Category: 2 \$1,400 s (two min - one per team \$400
CBC: Other: 29 - 1 Provide Notes: CBC: Other: Provide Notes: CBC: Other: 29 - 2 Provide	 11B-609.3 ADA 609.3 Game and Sports Area wheelchair seating No wheelchair spaces provided in team seating area space). 11B-221.2.1.4 ADA 221.2.1.4 an accessible path of travel Clear width of turn to two dugouts is 44" (48" min). 11B-206.2.12, 11B-206.2.2 ADA 206.2.2 Game and Sports Area 	Category: 2 \$1,400 s (two min - one per team \$400 Category: 2 \$1,400
CBC: Other: 29 - 1 Provide Notes: CBC: Other: Provide Notes: CBC: Other: 29 - 2 Provide Notes:	11B-609.3 ADA 609.3 Game and Sports Area wheelchair seating No wheelchair spaces provided in team seating area space). 11B-221.2.1.4 ADA 221.2.1.4 an accessible path of travel Clear width of turn to two dugouts is 44" (48" min). 11B-206.2.12, 11B-206.2.2 ADA 206.2.2 Game and Sports Area wheelchair seating No wheelchair spaces provided in team seating area	Category: 2 \$1,400 s (two min - one per team \$400 Category: 2 \$1,400


Wilson Park

29 - 3	Game and Sports Area	Category: 2	
Provide	wheelchair seating		\$1,400
Notes:	No wheelchair spaces provided in team se space).	eating areas (two min - one p	er team
CBC:	11B-221.2.1.4		
Other:	ADA 221.2.1.4		
32 - 1	Picnic Area	Category: 4	
Provide	an accessible table		\$500
Notes:	Knee space at picnic table is 26-3/8" wide	e (30" min).	
CBC:	11B-306.3		
Other:	-		
32 - 2	Picnic Area	Category: 4	
ncrease	e or provide clear floor area		\$700
Notes:	A 36" min clear space around the picnic ta	able is not provided on one si	de.
CBC:	-		
Other:	AGODA 1011.2.1		
Provide	an accessible picnic unit		\$3,200
Notes:	An accessible table is not provided.		
CBC:	11B-246.5		
Other:	-		
Provide	an accessible path of travel		\$1,200
Notes:	An accessible route to the picnic area is n linear feet over grass from path to picnic a	•	ute is 60
CBC:	11B-403		
Other:	AGODA F245.4		
Replace	or reposition picnic grill		\$750
Notes:	Cooking surface of grill is 36" AFF (15" to	34" allowable range).	
CBC:	-		
Other:	AGODA 1011.5.2		
35 - 1	Other	Category: 3	
Repositi	on controls		\$200
Notes:	Mutt Mitt is located 52" AFF (15" min to 44	8" max).	
000	11B-308.2.1, 11B-308.3		
CBC:	110-300.2.1, 110-300.3		

35 - 2	Other	Category: 3
Reposit	tion controls	\$200
Notes	: Mutt Mitt is 21" off the path of travel at off path of travel).	50" AFF (46" max when between 10" to 24"
CBC	: 11B-308.3	
Othe	r: ADA 308.3, ADA 308.3.1, ADA 308.3.2	
35 - 3	Other	Category: 3
Reposit	tion controls	\$200
Notes	:: Mutt Mitt is 28" off the path of travel at 4 off path of travel).	48" AFF (46" max when between 10" to 24"
CBC	: 11B-308.3	
Othe	r: ADA 308.3, ADA 308.3.1, ADA 308.3.2	
43 - 1	Play Equipment Area	Category: 2
Regrad	e or replace ramp	\$4,250
Notes	: Ramp to the play area has a slope of 1	0.3% (6.25% max).
CBC	: 11B-1008.2.5.1	
Othe	r: ADA 1008.2.5.1	

Wilson Park- Baseball Fields Building 19784 Wintergreen Dr Cupertino, CA


Ν

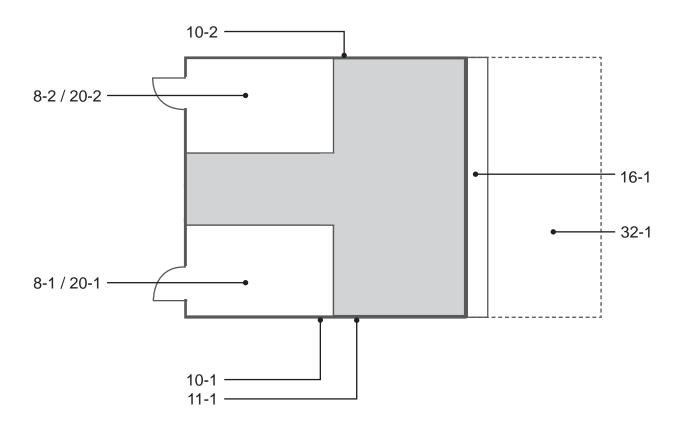

Building 1		
8 - 1 Door/Gate	Category: 2	
Adjust door closer		\$125
Notes: Door opening force is 1	10 lbs (5 lbs max).	
CBC: 11B-404.2.9		
Other: ADA 404.2.9		
8 - 2 Door/Gate	Category: 2	
Adjust door closer	5,	\$125
Notes: Door opening force is 8	3 lbs (5 lbs max).	
CBC: 11B-404.2.9		
Other: ADA 404.2.9		
10 - 1 Drinking Fountain	Category: 3	
Replace fountain		\$3,000
Notes: A standing person drin	king fountain is not provided.	
CBC: 11B-602.7		
Other: ADA 602.7		
Raise or lower fountain		\$1,500
Notes: Knee space of fountair	n is 26" (27" min).	
CBC: 11B-306.3		
Other: ADA 306.3, ADA 306.3	3.1	
Provide wing walls		\$1,000
	udes 12" from vertical support at 26" AFF (protrusion	more
	ed below 27" or above 80").	
CBC: 11B-602.8, 11B-602.9		
Other: ADA 307	0.1	
10 - 2 Drinking Fountain	Category: 3	AA AAA
Replace fountain		\$3,000
Notes: A standing person drin	king fountain is not provided.	
CBC: 11B-602.7		
Other: ADA 602.7		• · - • •
Raise or lower fountain		\$1,500
Notes: Knee space of fountain	n is 26" (27" min).	
CBC: 11B-306.3		
Other: ADA 306.3, ADA 306.3	3.1	
Provide wing walls		\$1,000
	udes 12" from vertical support at 26" AFF (protrusion ed below 27" or above 80").	more
CBC: 11B-602.8, 11B-602.9		
Other: ADA 307		
12/19/2014	Building 1 Baseball Facility Wilson Park	Page 8

Building 1	
11 - 1 Telephone	Category: 3
Reposition phone equipment	\$500
Notes: Coin slot is 55.5" AFF (48" max). Phone protre	•
AFF (protrusion more than 4" must be mounte	•
CBC: 11B-307, 11B-308.3	
Other: ADA 307, ADA 307.2, ADA 307.3, ADA 308.3	, ADA 308.3.1, ADA 308.3.2
Install volume control sign	\$225
Notes: Volume controls are not provided.	
CBC: 11B-703.7.2.3	
Other: ADA 703.7.2.3	
16 - 1 Built-in Elements	Category: 2
Provide an accessible counter	\$1,500
Notes: Accessible counter at snack bar is not provide	ed. Two counters are 44" AFF (34"
max).	
CBC: 11B-904.4	
Other: ADA 904.4.1	
20 - 1 Single User Restroom	Category: 2
Modify lavatory or counter clearances	\$1,500
Notes: Height of the lavatory apron is 28.75" AFF (29)" max).
CBC: 11B-306.3.1	
Other: -	
Install restroom sign	\$250
Notes: Federal required sign is not provided.	
CBC: -	
Other: ADA 703	
Replace or reposition fixtures	\$1,250
Notes: Centerline of water closet is 20.5" from the sid	de wall (17" min to 18" max).
CBC: 11B-604.2	
Other: ADA 604.2	
Replace or reposition dispenser	\$125
Notes: Height of toilet seat cover is 48" AFF (40" may	x).
CBC: 11B-603.5	
Other: -	
Replace or modify grab bars	\$300
Notes: Side grab bar extends 53" from the rear wall (54" min).
CBC: 11B-604.5.1	

Building 1	
20 - 2 Single User Restroom	Category: 2
Modify lavatory or counter clearances	\$1,500
Notes: Lavatory front apron is located 28" AFF (29" min). Kr measured at 8" deep from the front of the lavatory (2	nee space is 26.5" AFF
CBC: 11B-306.3.1, 11B-306.3.3	
Other: ADA 306.3, ADA 306.3.3	
Install restroom sign	\$250
Notes: Federal required sign is not provided.	
CBC: -	
Other: ADA 703	
Reposition toilet flush controls	\$750
Notes: Flush control is not located on the wide side.	
CBC: 11B-604.6	
Other: ADA 604.6	
Replace or reposition fixtures	\$1,250
Notes: Centerline of water closet is 21" from the side wall (1	7" min to 18" max).
CBC: 11B-604.2	
Other: ADA 604.2	
Replace or reposition dispenser	\$125
Notes: Height of toilet seat cover is 48" AFF (40" max).	
CBC: 11B-603.5	
Other: -	
Replace or modify grab bars	\$300
Notes: Side grab bar is 36" long and extends 46" from the re min from side wall). Rear grab bar is 43" long (36" lo min from centerline of water closet). (Switch grab ba	ng min, extends 12" and 24"
CBC: 11B-604.5.1, 11B-604.5.2	
Other: ADA 604.5.1, ADA 604.5.2	
32 - 1 Picnic Area	Category: 2
Provide an accessible table	\$500
Notes: Knee clearance is 26" measured at 8" horizontally fro (27" min). Picnic table is 27.75" AFF (28" min to 34"	•
CBC: 11B-306.3, 11B-902.3 Other: AGODA 1011.4.1	

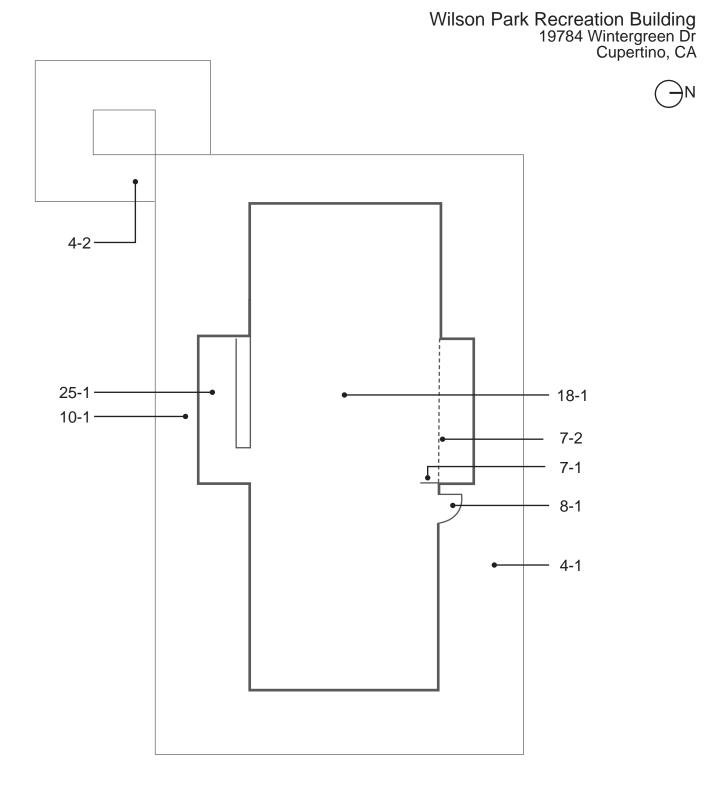

Building 2	
4 - 1 Walk	Category: 1
Regrade surface	\$540
Notes: Running slope of asphalt path is u 5.8% (2.0% max) for 27 linear fee	up to 11% (5.0% max) and cross slope is up to
CBC: 11B-403.3	
Other: ADA 403.3	
Grind or patch vertical change of grade	\$250
Notes: 1.5" change in level at concrete jo	int (1/4" max, up to 1/2" with a bevel).
CBC: 11B-303.2	
Other: ADA 303.2, ADA 303.3	
4 - 2 Walk	Category: 2
Provide an accessible path of travel	\$500
Notes: No accessible route to plaza due	to a 6" curb (1/4" max, up to 1/2" with a bevel).
CBC: 11B-206.2.2	
Other: ADA 206.2.2	
7 - 1 Hazard	Category: 2
7 - 1 Hazard Remove overhanging or protruding obje	
Remove overhanging or protruding obje	
Remove overhanging or protruding obje Notes: Shelf protrudes 5" from wall at 66	cts \$125
Remove overhanging or protruding obje Notes: Shelf protrudes 5" from wall at 66 below 27" or above 80").	cts \$125
Remove overhanging or protruding object Notes: Shelf protrudes 5" from wall at 66 below 27" or above 80"). CBC: 11B-307.4	cts \$125
Remove overhanging or protruding obje Notes: Shelf protrudes 5" from wall at 66 below 27" or above 80"). CBC: 11B-307.4 Other: ADA 307.4	cts \$125 " AFF (protrusion more than 4" must be mounted Category: 2
Remove overhanging or protruding objeNotes: Shelf protrudes 5" from wall at 66below 27" or above 80").CBC: 11B-307.4Other: ADA 307.47 - 2Hazard	cts \$125 " AFF (protrusion more than 4" must be mounted Category: 2 cts \$0
Remove overhanging or protruding objeNotes: Shelf protrudes 5" from wall at 66below 27" or above 80").CBC: 11B-307.4Other: ADA 307.47 - 2HazardRemove overhanging or protruding obje	cts \$125 " AFF (protrusion more than 4" must be mounted Category: 2 cts \$0

Building 2	
8 - 1 Door/Gate	Category: 1
Provide or modify door kickplate	\$225
Notes: A smooth and uninterrupted kick plate sur	face is not provided. Door stop is located
in the 10" space above the finished floor.	·
CBC: 11B-404.2.10	
Other: ADA 404.2.10	
Install or modify sign	\$250
Notes: A tactile and Braille EXIT sign is not provi	ded in passageway for emergency exit.
CBC: 1011	
Other: ADA 216.4.1, ADA 703.4.1	
Regrade surface	\$2,500
Notes: Clear floor space on the pull side of the do cross slope of 11% for 48" outside the do	e , ,
CBC: 11B-404.2.4.4	
Other: ADA 404.2.4.4	
10 - 1 Drinking Fountain	Category: 3
Raise or lower fountain	\$1,500
Notes: Space between floor and bottom of founta	ain is 24.75" (27" min).
CBC: 11B-306.3	
Other: ADA 306.3, ADA 306.3.1	
Provide wing walls	\$1,000
Notes: Drinking fountain protrudes 18" from vertie than 4" must be mounted below 27" or ab	
CBC: 11B-602.8, 11B-602.9	
Other: ADA 307	
Install an additional high or low fountain	\$3,000
Notes: A higher standing person fountain is not p	rovided.
CBC: 11B-211.2	
Other: ADA 211.2	
18 - 1 Room	Category: 2
Provide an accessible room element	\$0
Notes: Six pottery wheels, no accessible wheel p	rovided.
CBC: 11B-308.2	
Other: ADA 308.2, ADA 308.2.1	

Buildi	ng 2	
25 - 1	Kitchen	Category: 2
Provide	knee and toe clearance	\$0
Notes	: Knee space beneath the sink is not prov	ided.
CBC	: 11B-306.3.3	
Other	: ADA 306.3, ADA 306.3.3	
Replace	e or reposition dispenser	\$125
Notes	: Paper towel dispenser and soap dispense (40" AFF max).	er are 47" AFF and 24" behind the counter
CBC	: 11B-606.1	
Other	: ADA 308, ADA 308.2.1, ADA 308.2.2, A	DA 308.3.1, ADA 308.3.2
Modify	counter height	\$1,500
Notes	: Height of kitchen work surface is 36" AF	F (28" AFF min to 34" AFF max).
CBC	: 11B-804.3.2	
Other	: ADA 804.3.2	

Appendix D: Public Rights-of-Way Reports for City Facilities

Location Name	Cost Estimate
Blackberry Farm - PROW	\$12,890
Canyon Oaks Park- PROW	\$2,050
Civic Center - PROW	\$10,580
Creekside Park - PROW	\$23,440
Franco Park - PROW	\$690
Hoover Park - PROW	\$15,060
Jollyman Park - PROW	\$66,380
McClellan Ranch - PROW	\$35,270
Memorial Park - PROW	\$31,920
Monta Vista Park - PROW	\$68,000
Oak Valley Park - PROW	\$10,920
Portal Park - PROW	\$8,980
Quinlan Community Center - PROW	\$44,750
Senior Center - PROW	\$13,560
Service Center - PROW	\$14,275
Somerset Park - PROW	\$2,400
Sport Center - PROW	\$63,380
Sterling/Barnhart Park - PROW	\$9,680
Stevens Creek Boulevard	\$309,365
Three Oaks Park - PROW	\$8,550
Varian Park - PROW	\$4,845
Wilson Park - PROW	\$63,830

Total \$820,815

Blackberry Farm Golf Course 22100 Stevens Creek Boulevard Cupertino, CA



Blackberry Farm - PROW

3 - 1 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of	of the curb ramp is 9.8% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide a level landing	\$90
Notes: The landing at the top of the	e curb ramp has a slope of 2.3% (2% max).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide detectable warnings	\$1,000
Notes: Truncated domes are space	e 2.5" center to center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
4 - 1 Walk	Category:
Regrade surface	\$160
Notes: Cross slope of concrete pat	th is up to 2.4% for 4 linear feet near storm drain (2.0%
max).	
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 2 Walk	Category:
Regrade surface	\$8,640
Notes: Cross slope of concrete pat (2.0% max).	th is up to 3.5% with spots up to 5% for 216 linear feet
CBC: 11B-403.3	
Other: ADA 403.3	
14 - 1 Bus Stop	Category:
Regrade bus stop pad or light rail	platform \$500
Notes: The bus pad has a slope up	o to 3.4% perpendicular to the roadway (2% max).
CBC: 11B-810.2.4	
Other: ADA 810.2.4	

Canyon Oaks Park 21140-21150 Canyon Oak Way Cupertino, CA






Canyon Oaks Park- PROW

4 - 1	Walk	Category:
Regrade	surface	\$400
Notes:	Cross slope of concrete path is u	up to 2.6% for 10 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 2	Walk	Category:
nstall cu	urb, barrier, or guardrail	\$250
Notes:	No warning curb provided at abr required).	upt drop off of 9" near drain (6" warning curb
CBC:	11B-303.5	
Other:	-	
Regrade	surface	\$400
Notes:	Cross slope of concrete path is u	up to 3% for 10 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 3	Walk	Category:
Regrade	surface	\$1,000
Notes:	Cross slope of concrete path is u	up to 4.5% for 25 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	

Civic Center Complex 10800 Torre Ave Cupertino, CA

N T

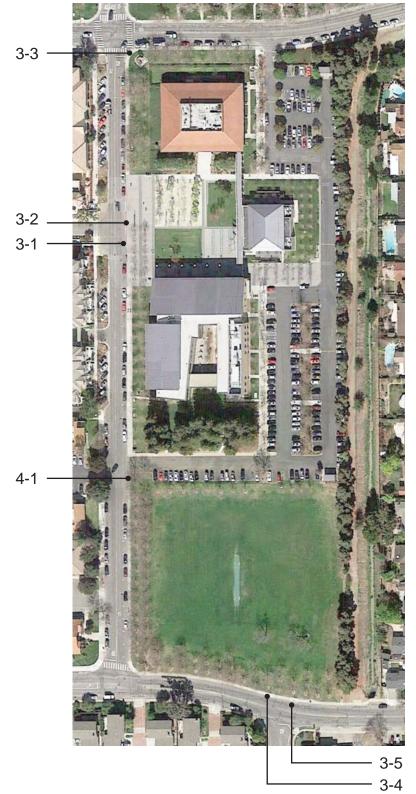

Civic Center - PROW

3 - 1 Curb Ramp	Category:
Provide detectable warnings	\$1,000
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
3 - 2 Curb Ramp	Category:
Provide detectable warnings	\$1,000
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
3 - 3 Curb Ramp	Category:
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
nstall, replace or modify curb ramp	\$2,460
Notes: Slope of one flared side is 16.5% (10.0% ma (8.33% max).	x). Slope of the curb ramp is 9.1%
CBC: 11B-405.2, 11B-406, 11B-406.2.2	
Other: ADA 405.2, ADA 406.1, ADA 406.3	
Provide a level landing	\$0
Notes: A level landing is not provided at the top of th	ne ramp (48" x 48" min).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
3 - 4 Curb Ramp	Category:
Provide detectable warnings	\$C
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
nstall, replace or modify curb ramp	\$2,460
Notes: Cross slope of the curb ramp is 2.4% (2.0% r (8.33% max).	max). Slope of the curb ramp is 9.7%
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 405.3, ADA 406.1	

Civic Center - PROW

3 - 5 Curb Ramp	Category:
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Install, replace or modify curb ramp	\$2,460
Notes: Cross slope of the parallel curb ra	mp is 8.8% (2.0% max).
CBC: 11B-406	
Other: ADA 405.3, ADA 406.1	
4 - 1 Walk	Category:
Regrade surface	\$1,200
Notes: Cross slope of concrete path is up	to 11% for 30 linear feet across drive (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	

Creekside Park 10455 Miller Avenue Cupertino, CA





4-12 -

3 - 1 Curb Ramp	Category:
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 9.4% (8.33%	max).
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ra	amp is 7.6% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Grind or patch vertical change of grade	\$0
Notes: 1" change in level due to cracked surfac the side walk.	ce at the ramp. 3/4" change in level across
CBC: 11B-303.2.3, 11B-405.4	
Other: ADA 405.4	
3 - 2 Curb Ramp	Category:
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Provide a level landing	\$0
Notes: A level landing is not provided at the top	o of the ramp (48" x 48" min).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide surface texture	\$0
Notes: Grooved border is not located at the top	of the curb ramp.
CBC: 11B-406.5.11	
Other: -	
Install, replace or modify curb ramp Notes: Slope of one flared side is 10.5% (10.0% (8.33% max).	\$2,460 % max). Slope of the curb ramp is 10.2%
CBC: 11B-405.2, 11B-406, 11B-406.2.2	
Other: ADA 405.2, ADA 406.1, ADA 406.3	
Grind or patch vertical change of grade	\$0
Notes: Surface level change is 1.5" at joint betw	
CBC: 11B-303.2.3, 11B-405.4	
Other: ADA 405.4	

3 - 3 Curb Ramp	Category:
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Reduce or eliminate opening	\$0
Notes: Space at the bottom of the ramp has a	a 2" vegetated band.
CBC: 11B-302.3	
Other: ADA 302.3	
nstall, replace or modify curb ramp	\$2,460
Notes: Slope of one flared side is 16.7% (10. 5.6% (2.0% max).	0% max). Cross slope of the curb ramp is
CBC: 11B-406, 11B-406.2.2	
Other: ADA 405.3, ADA 406.1, ADA 406.3	
Provide a level landing	\$0
Notes: The top landing has a slope of 6.2% (2% max).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
4 - 1 Walk	Category:
Regrade surface	\$200
Notes: Running slope of walk is 6.1% for 63'	' (5% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 2 Walk	Category:
Regrade surface	\$2,000
Notes: Cross slope of concrete path is betwe	en 3.3% to 4% for 50 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4-3 Walk	Category:
Regrade surface	\$1,600
Notes: Cross slope of concrete path is up to 3	
CBC: 11B-403.3	
Other: ADA 403.3	
Grind or patch vertical change of grade	\$250
Notes: 1" change in level at cracked flag (1/4	
CBC: 11B-303.2	
Other: ADA 303.2, ADA 303.3	

4 - 4	Walk	Category:	
Regrade	surface		\$1,200
Notes:	Cross slope of concrete path is up to 3% fo	or 30 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 5	Walk	Category:	
Regrade	surface		\$440
Notes:	Cross slope across drive is up to 10% for 1	1 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 6	Walk	Category:	
Regrade	surface		\$2,600
Notes:	Cross slope of concrete path is up to 4% for	or 65 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 7	Walk	Category:	
Regrade	surface		\$640
Notes:	Cross slope across drive is up to 9.6% for	16 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 8	Walk	Category:	
Regrade	surface		\$400
Notes:	Cross slope of concrete path is up to 3.2%	for 10 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
Grind or	patch vertical change of grade		\$250
Notes:	75" change in level at joint near brick walk	to house (1/4" max, up to 1/2" w	rith a
	pevel).		
CBC:	11B-303.2		
Other:	ADA 303.2, ADA 303.3		
4 - 9	Walk	Category:	
Regrade	surface		\$1,140
Notes:	Cross slope of concrete path is up to 3.3%	for 28.5 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		

4 - 10 Walk	Category:
Regrade surface	\$640
Notes: Cross slope across drive is up t	to 12% for 16 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 11 Walk	Category:
Regrade surface	\$1,400
Notes: Cross slope of concrete path is	up to 4.2% for 35 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 12 Walk	Category:
Regrade surface	\$800
Notes: Cross slope of concrete path is	up to 3.7% for 20 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	

Franco Park 10981 Franco Court Cupertino, CA





Franco Park - PROW

3 - 1	Curb Ramp	Category:
Provide	e a level landing	\$90
Notes	s: Top landing has a slope of 2.8%	6 (2%max).
CBC	C: 11B-406.5.3	
Othe	r: ADA 406.4, ADA 406.7	
4 - 1	Walk	Category:
Regrad	le surface	\$600
Notes	s: Cross slope of concrete path is	up to 2.4% for 15 linear feet (2.0% max).
CBC	C: 11B-403.3	

Hoover Park Leeds Avenue and Donegal Avenue Cupertino, CA




Hoover Park - PROW

3 - 1 Curb Ramp	Category:
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 15.4% (8.33 (2.0% max).	3% max). Cross slope of the curb ramp is 6.3%
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 405.3, ADA 406.1	
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Grind or patch vertical change of grade	\$0
Notes: 1/2" change in level at the bottom of t	the curb ramp (0" max).
CBC: 11B-303.2.3, 11B-405.4	
Other: ADA 405.4	
Provide surface texture	\$0
Notes: No grooved border provided.	
CBC: 11B-406.5.11	
Other: -	
Provide a level landing	\$0
Notes: Top landing of the curb ramp has a sl	lope of 2.6% (2% max).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
4 - 1 Walk	Category:
Regrade surface	\$8,080
Notes: Cross slope of concrete path is up to	
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 2 Walk	Category:
Regrade surface	\$1,440
Notes: Running slope of concrete path is up	
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 3 Walk	Category:
Regrade surface	\$3,080
Notes: Cross slope of concrete path is up to	
CBC: 11B-403.3	<i>111</i> _ <i>1</i>
Other: ADA 403.3	

Jollyman Park Dumas Drive and Jollyman Road Cupertino, CA



Jollyman Park Dumas Drive and Jollyman Road Cupertino, CA

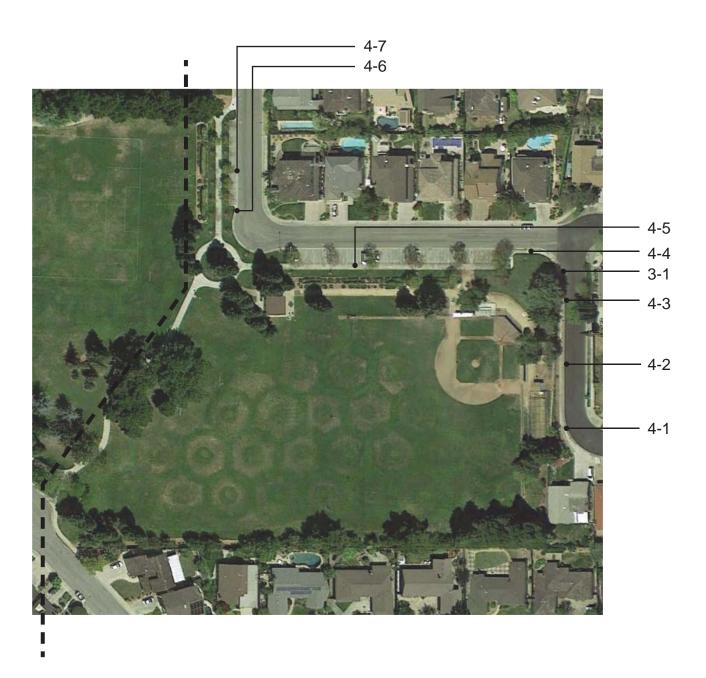

Jollyman Park - PROW

3 - 1 Curb Ramp	Category:
Provide surface texture	\$0
Notes: Grooved border is 11" wide (12" mi	n).
CBC: 11B-406.5.11	
Other: -	
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 12.1% (8 (10.0% max).	.33% max). Slope of one flared side is 17%
CBC: 11B-405.2, 11B-406, 11B-406.2.2	
Other: ADA 405.2, ADA 406.1, ADA 406.3	6
Provide a level landing	\$0
Notes: A level landing is not provided at th	e top of the ramp (48" x 48" min).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide a level landing	\$2,500
Notes: Counter slope at the base of the cu	rb ramp is 7.8% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Grind or patch vertical change of grade	\$0
Notes: Deteriorated concrete at the top 24	of the curb ramp.
CBC: 11B-303.2.3, 11B-405.4	
Other: ADA 405.4	

Jollyman Park - PROW

3 - 2 Curb Ramp	Category:
Grind or patch vertical change of grade	\$0
Notes: There is a 1" change in level at the be at the joint between the asphalt and t	ottom of the curb ramp and a 1" change in level he concrete paving (0").
CBC: 11B-303.2.3, 11B-405.4	
Other: ADA 405.4	
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb	o ramp is 7% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide detectable warnings	\$1,000
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Provide surface texture	\$1,000
Notes: No grooved border provided.	
CBC: 11B-406.5.11	
Other: -	
3 - 3 Curb Ramp	Category:
Provide surface texture	\$0
Notes: Grooved border is 11.25" wide (12" n	nin).
CBC: 11B-406.5.11	
Other: -	
Install, replace or modify curb ramp	\$2,460
Notes: Cross slope of the curb ramp is 5.4% (10.0% max).	(2.0% max). Slope of one flared side is 15.3%
CBC: 11B-406, 11B-406.2.2	
Other: ADA 405.3, ADA 406.1, ADA 406.3	
Provide a level landing	\$0
Notes: A level landing is not provided at the space at the bottom of the parallel cu	top of the ramp (48" x 48" min). The turning Irb ramp has a slope of 5.3% (2% max).
CBC: 11B-406.3.2, 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	

3 - 4 Curb Ramp	Category:
Provide surface texture	\$0
Notes: Grooved border is 11.5" wide (12" m	nin).
CBC: 11B-406.5.11	
Other: -	
Install, replace or modify curb ramp	\$2,460
Notes: Cross slope of the curb ramp is 4.2%	% (2.0% max).
CBC: 11B-406	
Other: ADA 405.3, ADA 406.1	
Provide a level landing	\$0
a 1	e top of the ramp (48" x 48" min). The turning curb ramp has a slope of 8.9% (2% max).
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	φ0
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
4 - 1 Walk	Category:
Grind or patch vertical change of grade	\$250
Notes: 1/2" change in level at concrete join	
CBC: 11B-303.2	
Other: ADA 303.2, ADA 303.3	
4 - 2 Walk	Category:
Regrade surface	\$2,760
Notes: Cross slope of concrete path is up to	
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 3 Walk	Category:
Regrade surface	\$4,600
Notes: Cross slope of concrete path is up to	
CBC: 11B-403.3	
Other: ADA 403.3	

4 - 4	Walk	Category:	
Regrade	surface		\$3,720
Notes:	Cross slope of concrete path is up	to 4.1% for 93 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
Grind or	patch vertical change of grade		\$250
Notes:	1.5" marked change in level at cor	ncrete joint (1/4" max, up to 1/2" with a be	evel).
CBC:	11B-303.2		
Other:	ADA 303.2, ADA 303.3		
4 - 5	Walk	Category:	
Regrade	surface		\$11,040
Notes:	Cross slope of concrete path is up	to 3.1% for 276 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 6	Walk	Category:	
Regrade	surface		\$3,960
Notes:	Cross slope of concrete path is up	to 3.1% for 99 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 7	Walk	Category:	
Regrade	surface		\$1,680
Notes:	Cross slope of concrete path is up utility drive for 15 linear feet (2.0%	to 4.4% for 42 linear feet and up to 10.7 max).	'% at the
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 8	Walk	Category:	
Regrade	surface		\$440
Notes:	Cross slope of concrete path is up	to 2.7% for 11 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 9	Walk	Category:	
Regrade	surface		\$1,440
Notes:	Cross slope of concrete path is up	to 3.2% for 36 linear feet (2.0% max).	
CBC:	11B-403.3		
0.1	ADA 403.3		

4 - 10	Walk	Category:
Regrade	surface	\$92
Notes:	Cross slope of concrete path is up to 3.1% for 23	linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 11	Walk	Category:
Regrade	surface	\$3,00
Notes:	Cross slope of concrete path is up to 3.1% for 75	linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 12	Walk	Category:
Regrade	surface	\$6,72
Notes:	Cross slope of concrete path is up top 4.1% for 16	68 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 13	Walk	Category:
Regrade	surface	\$80
Notes:	Cross slope of concrete path is up to 11.9% for 20 max).) linear feet across drive (2.0%
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 14	Walk	Category:
		outogory.
Regrade	surface	\$9,12
•	surface Cross slope of concrete path is up to 3.2% for 228	\$9,12
Notes:		\$9,12
Notes: CBC:	Cross slope of concrete path is up to 3.2% for 228	\$9,12
Notes: CBC: Other:	Cross slope of concrete path is up to 3.2% for 228 11B-403.3	\$9,12
Notes: CBC: Other: Grind or	Cross slope of concrete path is up to 3.2% for 228 11B-403.3 ADA 403.3	\$9,12 3 linear feet (2.0% max). \$25
Notes: CBC: Other: Grind or Notes:	Cross slope of concrete path is up to 3.2% for 228 11B-403.3 ADA 403.3 patch vertical change of grade	\$9,12 3 linear feet (2.0% max). \$25

4 - 15 Walk	Category:
Regrade surface	\$800
•	s up to 7% at 48" adjacent to curb and 3.8% in ax). Flared sides of the drive have a slope of 18.1%
CBC: 11B-403.3	
Other: ADA 403.3	
Widen walk	\$0
Notes: Width of walk is 37.5" for 20 lin	ear feet across the drive (48" min).
CBC: 11B-403.5.1.3	
Other: ADA 403.5.1	
Grind or patch vertical change of grad	l e \$250
Notes: 1.5" change in level in one flag	before the drive (1/4" max, up to 1/2" with a bevel).
CBC: 11B-303.2	
Other: ADA 303.2, ADA 303.3	

McClellan Ranch 22221 McClellan Road Cupertino, CA





McClellan Ranch - PROW

3 - 1	Curb Ramp	Category:
Provide	a level landing	\$2,500
Notes:	Counter slope at the base of the curb	o ramp is 7.1% (5.0% max).
CBC:	11B-406.5.8	
Other:	ADA 406.2	
Provide	surface texture	\$0
Notes:	Grooved border is 11.5" wide (12" m	in).
CBC:	11B-406.5.11	
Other:	-	
nstall, r	eplace or modify curb ramp	\$2,460
-	Slope of one flared side is 13.9% (10).0% max).
	11B-406.2.2	
Other:	ADA 406.3	
4 - 1	Walk	Category:
Regrade	surface	\$1,360
	Cross slope at drive is up to 3.5% for	r 34 linear feet (2% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 2	Walk	Category:
Regrade	surface	\$40
Notes:		3% for 20 linear feet (2.0% max). Running for last 10 linear feet before the bridge (5.0%
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 3	Walk	Category:
Detectal	- ble warnings	\$1,000
Notes:	No detectable warnings are provided Blended transition needed.	where the sidewalk crosses vehicular drive.
CBC:	11B-705.1.2, 11B-705.1.2.5	
Other:	-	
4 - 4	Walk	Category:
Detectal	ble warnings	\$1,000
Notes:	No detectable warnings are provided Blended transition needed.	where the sidewalk crosses vehicular drive.
CBC:	11B-705.1.2, 11B-705.1.2.5	

McClellan Ranch - PROW

4 - 5	Walk	Category:
Regrade		\$1,640
Notes:	Running slope of concrete path is (2.0% max) for 41 linear feet.	up to 7% (5.0% max) and cross slope is up to 4%
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 6	Walk	Category:
Regrade	surface	\$20,000
Notes:	Cross slope of concrete path is up	o to 4.2% for 500 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 7	Walk	Category:
Regrade	surface	\$4,720
Notes:	Cross slope of concrete path is up	o to 5% for 118 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
Remove	overhanging or protruding obje	cts \$125
Notes:	Oak branches protrude 36" from t ground).	he trunk of the tree at 44" AFF (80" min above
CBC:	11B-307.4	
Other:	ADA 307.4	
5 - 1	Ramp	Category:
Regrade	or replace ramp	\$425
Notes:	Cross slope of asphalt ramp is up	to 8.6% near middle of run (2.0% max).
	11B-405.3	
Other:	ADA 405.3	
••		

Memorial Park 21121 Stevens Creek Boulevard Cupertino, CA N



Memorial Park 21121 Stevens Creek Boulevard Cupertino, CA N




Memorial Park - PROW

3 - 1 Curb Ramp	Category:
Install, replace or modify curb ramp	\$2,460
Notes: Slope of one flared side is 11% (10.0% max).	Slope of the curb ramp is 13.3%
(8.33% max).	
CBC: 11B-405.2, 11B-406, 11B-406.2.2	
Other: ADA 405.2, ADA 406.1, ADA 406.3	
Provide a level landing	\$0
Notes: Top level landing is 15" deep (48" min).	
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ramp is	12% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Provide surface texture	\$0
Notes: Grooved border is not at the top of the curb rai	mp.
CBC: 11B-406.5.11	
Other: -	
3 - 2 Curb Ramp	Category:
Install, replace or modify curb ramp	\$2,460
Notes: Slope of one flared side is 11% (10.0% max).	
CBC: 11B-406.2.2	
Other: ADA 406.3	
Provide a level landing	\$0
Notes: Top landing has a slope of 2.2% (2% max).	
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
3 - 3 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ramp is	5.2% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	


Memorial Park - PROW

4 - 1	Walk	Category:
Regrade	surface	\$3,080
Notes:	Cross slope of concrete path is	s up to 5.7% for 77 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 2	Walk	Category:
Regrade	surface	\$11,720
Notes:	Cross slope of concrete path is	s up to 5% for 293 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 3	Walk	Category:
Regrade	surface	\$800
Notes:	Cross slope of concrete path is for 20 linear feet (2.0% max).	s up to 6% for 188 linear feet and 18% across ramp
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 4	Walk	Category:
Regrade	surface	\$6,400
Notes:	Cross slope of concrete path is	s up to 3.7% for 160 linear feet (2.0% max).
CBC:	11B-403.3	
Othor	ADA 403.3	

Monte Vista Park 22601 Voss Avenue Cupertino, CA

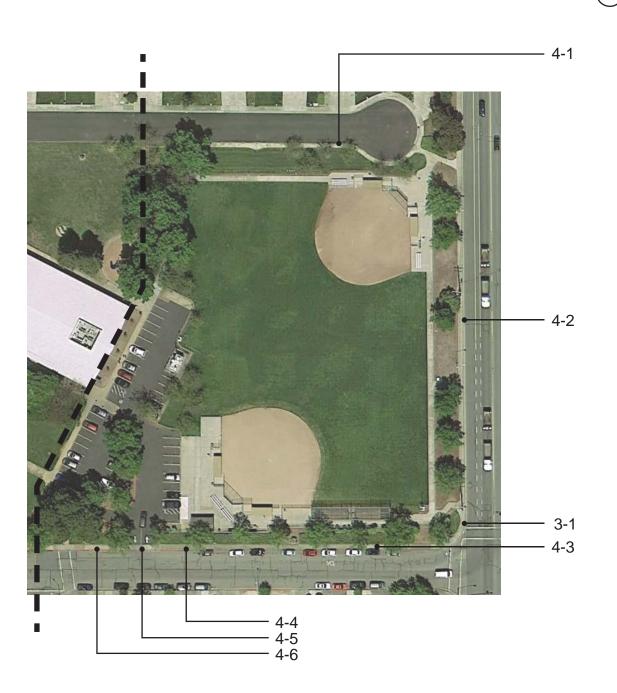

Monte Vista Park 22601 Voss Avenue Cupertino, CA N

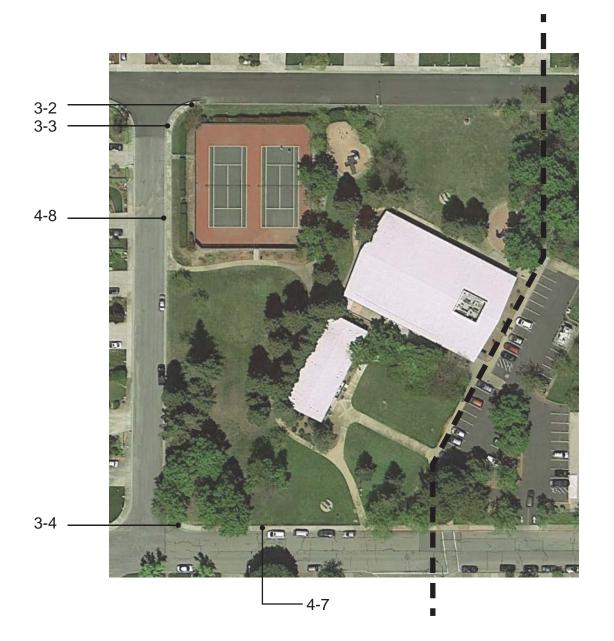

Category:
\$2,460
Slopes of flared sides are 10.5% and
·
\$2,500
9.3% (5.0% max).
\$0
amp in transition between asphalt and
Category:
\$2,460
Slopes of flared sides are 12.6% and
\$2,500
5.2% (5.0% max).
\$0
ramp (48" x 48" min).
\$0
\$0

3 - 3	Curb Ramp	Category:	
Install, I	eplace or modify curb ramp	\$2,40	60
Notes	Slope of the curb ramp is 11.4% (8.3) 14% (10.0% max).	33% max). Slopes of flared sides are 14.7% a	and
CBC	11B-405.2, 11B-406, 11B-406.2.2		
Other	ADA 405.2, ADA 406.1, ADA 406.3		
Provide	a level landing	\$2,50	00
Notes	Counter slope at the base of the cur	b ramp is 8.7% (5.0% max).	
CBC	11B-406.5.8		
Other	ADA 406.2		
Provide	detectable warnings	:	\$0
Notes	Detectable warnings not provided.		
CBC	11B-247.1.2, 11B-406.5.12		
Other	-		
Provide	surface texture	:	\$0
Notes	No grooved border provided.		
CBC	11B-406.5.11		
Other	-		
Grind o	patch vertical change of grade	:	\$0
Notes	1/2" change in level at the bottom of any changes in level).	the curb ramp (curb ramps must be free from	n
CBC	11B-303.2.3, 11B-405.4		
Other	ADA 405.4		

Category:
\$90
of the ramp (48" x 48" min).
\$2,500
mp is 9.5% (5.0% max).
\$250
ramp (curb ramps must be free from any
\$1,000
Category:
\$7,880
6% for 197 linear feet (2.0% max).
Category:
\$14,360
% for 359 linear feet (2.0% max).
Category:
\$7,280
1% for 181 linear feet (2.0% max).
······································

4 - 4 Wa	lk	Category:
Regrade su		\$1,28
		to 2.6% for 32 linear feet (2.0% max).
CBC: 11	······	······································
Other: AD		
4 - 5 Wa	lk	Category:
Regrade su	rface	\$1,28
Notes: Cro	oss slope of concrete path is up	to 10.3% at drive for 32 linear feet (2.0% max)
CBC: 11	3-403.3	
Other: AD	A 403.3	
4 - 6 Wa	lk	Category:
Regrade su	rface	\$1,44
Notes: Cro	oss slope of concrete path is up	to 2.9% for 36 linear feet (2.0% max).
CBC: 11	3-403.3	
Other: AD	A 403.3	
4 - 7 Wa	lk	Category:
Regrade su	rface	\$10,32
Notes: Cro	oss slope of concrete path is up	to 4.2% for 258 linear feet (2.0% max).
CBC: 11	3-403.3	
Other: AD	A 403.3	
4 - 8 Wa	lk	Category:
Regrade su	rface	\$5,44
Notes: Cro	oss slope of concrete path is up	to 4.8% for 136 linear feet (2.0% max).
CBC: 11	3-403.3	
Other: AD	A 403.3	

Oak Valley Park 23625-23645 Oak Valley Road Cupertino, CA





Oak Valley Park - PROW

3 - 1	Curb Ramp	Category:
Provid	e a level landing	\$2,500
Note	s: Counter slope at the base of the curb	ramp is 7.2% (5.0% max).
CBO	C: 11B-406.5.8	
Othe	er: ADA 406.2	
Provid	e detectable warnings	\$0
Note	s: Detectable warnings not provided.	
CB	C: 11B-247.1.2, 11B-406.5.12	
Othe	er: -	
Install,	replace or modify curb ramp	\$2,460
Note	s: Cross slope of the curb ramp is 3.1%	(2.0% max).
CB	C: 11B-406	
Othe	er: ADA 405.3, ADA 406.1	
Provid	e surface texture	\$0
Note	s: No grooved border provided.	
CB	C: 11B-406.5.11	
Othe	er: -	

Oak Valley Park - PROW

3 - 2 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ramp	is 8.9% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide surface texture	\$0
Notes: No grooved border provided.	
CBC: 11B-406.5.11	
Other: -	
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Provide a level landing	\$0
Notes: A level landing is not provided at the top of	the ramp (48" x 48" min).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 15.2% (8.33% ma	ax).
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	
4 - 1 Walk	Category:
Regrade surface	\$1,000
Notes: Cross slope of concrete path is up to 2.5%	for 25 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	

Portal Park 19810 North Portal Road Cupertino, CA




Portal Park - PROW

4 - 1	Walk	Category:
Regrade	e surface	\$640
Notes	: Cross slope of concrete path is u	p to 2.5% for 16 linear feet (2.0% max).
CBC	: 11B-403.3	
Other	: ADA 403.3	
4 - 2	Walk	Category:
Regrade	e surface	\$1,840
Notes	: Cross slope of concrete path is u	p to 2.5% for 46 linear feet (2.0% max).
CBC	: 11B-403.3	
Other	: ADA 403.3	
Grind o	r patch vertical change of grade	\$250
		oint across walk in front of pathway into park (1/4"
CBC	: 11B-303.2	
Other	: ADA 303.2, ADA 303.3	
4 - 3	Walk	Category:
Regrade	e surface	\$3,000
Notes	: Cross slope of concrete path is u	p to 3.7% for 75 linear feet (2.0% max).
CBC	: 11B-403.3	
Other	: ADA 403.3	
Grind o	r patch vertical change of grade	\$0
Notes	: 1/2" change in level due to deteri with a bevel).	orated concrete at joint, 1.5 sf (1/4" max, up to 1/2
CBC	: 11B-303.2	
Other	: ADA 303.2, ADA 303.3	
4 - 4	Walk	Category:
Srind o	r patch vertical change of grade	\$250
Notes	: 1/2" change in level due to deteri with a bevel).	orated concrete at joint, 1 sf (1/4" max, up to 1/2"
CBC	: 11B-303.2	
Other	: ADA 303.2, ADA 303.3	
4 - 5	Walk	Category:
Regrade	e surface	\$3,000
_		p to 2.3% for 75 linear feet and up to 4.4% for last
CBC	: 11B-403.3	

Quinlan Community Center 10350 Torre Ave Cupertino, CA

N T

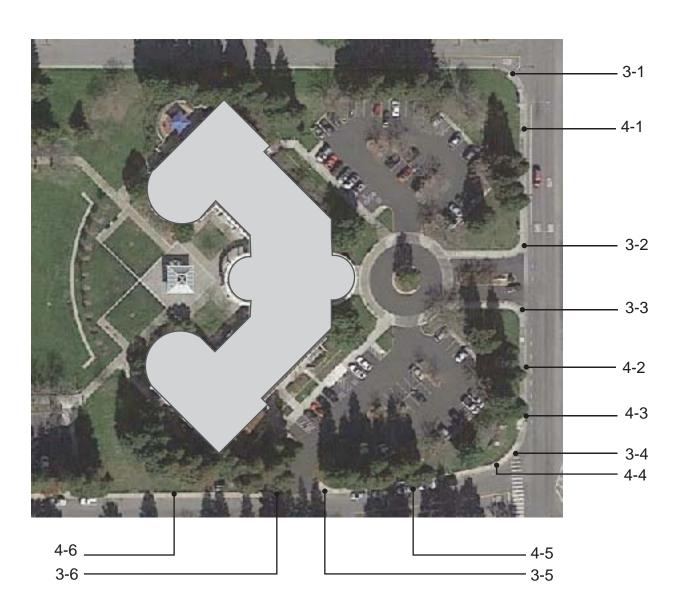

Quinlan Community Center - PROW

3 - 1	Curb Ramp	Category:
Provide	detectable warnings	\$1,000
Notes:	Detectable warnings not provided.	
CBC:	11B-406.5.12	
Other:	ADA 705.1	
Provide a	a level landing	\$90
Notes:	The turning space at the bottom of the max).	e parallel curb ramp has a slope of 4.2% (2%
CBC:	11B-406.3.2	
Other:	-	
Provide a	a level landing	\$2,500
Notes:	Counter slope at the base of the curb	ramp is 10.8% (5.0% max).
CBC:	11B-406.5.8	
Other:	ADA 406.2	
3 - 2	Curb Ramp	Category:
Provide (detectable warnings	\$0
Notes:	Detectable warnings not provided.	
CBC:	11B-247.1.2, 11B-406.5.12	
Other:	-	
Provide :	surface texture	\$0
Notes:	No grooved border provided.	
CBC:	11B-406.5.11	
Other:	-	
Provide a	a level landing	\$0
Notes:		op of the ramp (48" x 48" min). The turning b ramp has a slope of 5.8% (2% max).
CBC:	11B-406.3.2, 11B-406.5.3	
Other:	ADA 406.4, ADA 406.7	
Install, re	eplace or modify curb ramp	\$2,460
	Slope of the curb ramp is 9.2% (8.33%	6 max).
CBC:	11B-405.2, 11B-406	

Other: ADA 405.2, ADA 406.1

3 - 3 Curb Ramp	Category:
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Provide surface texture	\$0
Notes: No grooved border provided.	
CBC: 11B-406.5.11	
Other: -	
Provide a level landing	\$2,500
Notes: Counter slope at the base of the cu	rb ramp is 5.2% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 10.8% (8. (10.0% max).	33% max). Slope of one flared side is 10.3%
CBC: 11B-405.2, 11B-406, 11B-406.2.2	
Other: ADA 405.2, ADA 406.1, ADA 406.3	
Provide a level landing	\$0
e 1	e top of the ramp (48" x 48" min). The turning curb ramp has a slope of 5.7% (2% max).
CBC: 11B-406.3.2, 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	

3 - 4 Curb Ramp	Category:
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 12.3% (8.33%)	max).
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	
Provide surface texture	\$0
Notes: No grooved border provided.	
CBC: 11B-406.5.11	
Other: -	
Grind or patch vertical change of grade	\$0
Notes: 1/2" change in level at the bottom of the o	curb ramp at asphalt.
CBC: 11B-303.2.3, 11B-405.4	
Other: ADA 405.4	
3 - 5 Curb Ramp	Category:
Provide a level landing	\$0
Notes: A level landing is not provided at the top	of the ramp (48" x 48" min).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 9.1% (8.33% m	nax).
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Provide surface texture	\$0
Notes: No grooved border provided.	
CBC: 11B-406.5.11	

3 - 6 Curb Ramp	Category:
Provide detectable warnings	\$1,000
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Provide a level landing	\$90
Notes: A level landing is not provided at the top of the ramp (4	8" x 48" min).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide surface texture	\$1,000
Notes: No grooved border provided.	
CBC: 11B-406.5.11	
Other: -	
4 - 1 Walk	Category:
Regrade surface	\$5,800
Notes: Cross slope of concrete path is up to 3.4% for 145 linea	ar feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 2 Walk	Category:
Regrade surface	\$2,520
Notes: Cross slope of concrete path is up to 2.9% for 63 linear	
CBC: 11B-403.3	
Other: ADA 403.3	
4-3 Walk	Category:
Regrade surface	\$760
Notes: Cross slope of concrete path is up to 5.2% for 19 linear	r feet (2.0% max).
CBC: 11B-403.3	······
Other: ADA 403.3	
Grind or patch vertical change of grade	\$250
Notes: 1" change in level at PG&E vault (1/4" max, up to 1/2" v	with a bevel).
CBC: 11B-303.2	······
Other: ADA 303.2, ADA 303.3	
	Category:
Regrade surface	\$1,080
Notes: Cross slope of concrete path is up to 4.5% for 27 linear	
CBC: 11B-403.3	· · · · /·
Other: ADA 403.3	

4 - 5 Walk	Category:
Regrade surface	\$4,600
Notes: Cross slope of concrete path	h is up to 3.3% for 115 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 6 Walk	Category:
Regrade surface	\$11,720
Notes: Cross slope of concrete path	h is up to 5% for 293 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	

Senior Center 21251 Stevens Creek Blvd. Cupertino, CA






Senior Center - PROW

3 - 1 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb	ramp is 12.6% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
3 - 2 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb	ramp is 6.8% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
4 - 1 Walk	Category:
Regrade surface	\$480
Notes: Cross slope of concrete path is up to	2.9% for 12 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 2 Walk	Category:
Regrade surface	\$1,560
Notes: Cross slope of concrete path is up to max).	7.1% for 39 linear feet across drive (2.0%
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 3 Walk	Category:
Regrade surface	\$6,520
Notes: Cross slope of concrete path is up to	3.6% for 163 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	

Service Center Corporation Yard 10555 Mary Avenue Cupertino, CA

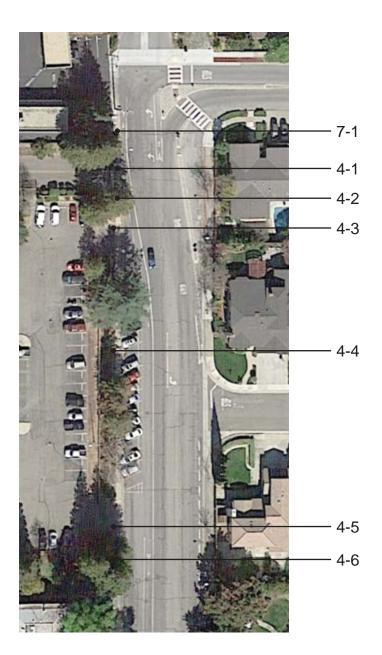

Service Center - PROW

4 - 1	Walk	Category:	
Regrade	surface		\$1,360
Notes	Cross slope of concrete path is up to 16.5% for yard entrance (2.0% max).	r 34 linear feet across drive	at utility
CBC	11B-403.3		
Other	ADA 403.3		
4 - 2	Walk	Category:	
Regrade	surface		\$960
Notes	Cross slope of concrete path is up to 3.7% for 2	24 linear feet (2.0% max).	
CBC	11B-403.3		
Other	ADA 403.3		
4 - 3	Walk	Category:	
Regrade	surface		\$1,200
Notes	Cross slope of concrete path is up to 10.1% for lot (2.0% max).	r 30 linear feet across drive	to parking
CBC:	11B-403.3		
Other	ADA 403.3		
4 - 4	Walk	Category:	
Regrade	surface		\$7,740
Notes:	Cross slope of concrete path is up to 4.6% for 7	193.5 linear feet (2.0% max).
CBC:	11B-403.3		
Other	ADA 403.3		
4 - 5	Walk	Category:	
Regrade	surface		\$1,240
Notes	Cross slope of concrete path is up to 9.3% for 3 lot (2.0% max).	31 linear feet across drive to	o parking
CBC:	11B-403.3		
Other	ADA 403.3		
4 - 6	Walk	Category:	
Regrade	surface		\$1,400
Notes:	Cross slope of concrete path is up to 2.9% for 3	35 linear feet (2.0% max).	
CBC	11B-403.3		
	ADA 403.3		
Other:	notel control of an of and b		\$250
	patch vertical change of grade		
Grind or	patch vertical change of grade 1/2" change in level at concrete joint at center f	flag (1/4" max, up to 1/2" wit	th a bevel
Grind or Notes:		flag (1/4" max, up to 1/2" wit	h a bevel

Service Center - PROW

7 - 1	Hazard	Category:
Remove	overhanging or protruding objects	\$12
Notes	: Guy wire at utility pole ranges in height from 2 travel (27" max or 80" min).	8" to 79" for 40" along the path of
CBC	: 11B-307.4	
Other	: -	

Somerset Park 10710 Stokes Avenue Cupertino, CA






Somerset Park - PROW

4 - 1 Walk	Category:
Regrade surface	\$1,200
Notes: Cross slope of concrete path	is up to 2.6% for 30 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4-2 Walk	Category:
Regrade surface	\$1,200
Notes: Cross slope of concrete path	is up to 3% for 30 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	

Sport Center 21111 Stevens Creek Blvd. Cupertino, CA



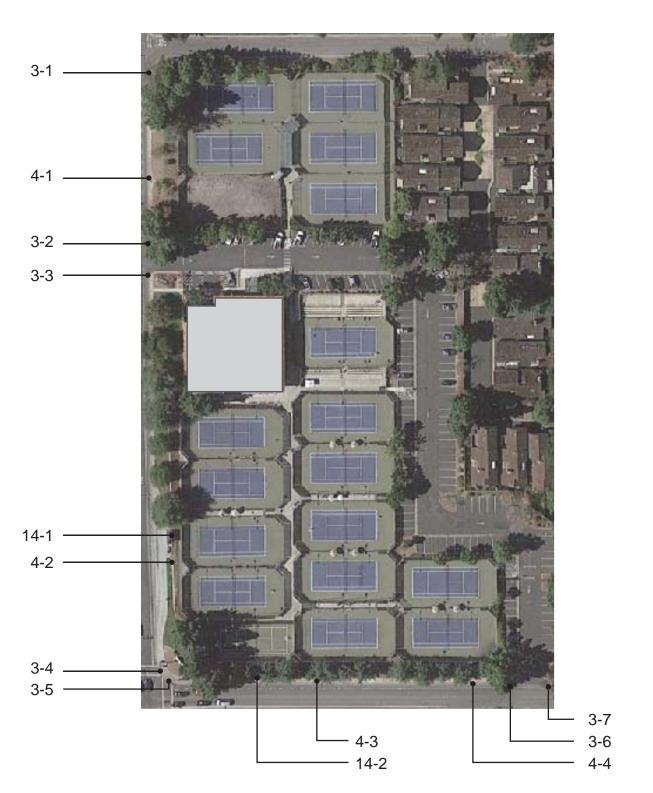

3 - 1 Curb Ramp	Category:
Provide surface texture	\$1,000
Notes: No grooved border provided.	
CBC: 11B-406.5.11	
Other: -	
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ram	p is 7.3% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide a level landing	\$90
Notes: Top landing has a slope of 2.3% (2% max	s).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
3 - 2 Curb Ramp	Category:
Provide a level landing	\$90
Notes: Top landing has a slope of up to 3.5% (2%	% max).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide surface texture	\$1,000
Notes: Grooved border is 11.5" wide (12" min).	
CBC: 11B-406.5.11	
Other: -	
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ram	p is 6.1% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
3 - 3 Curb Ramp	Category:
Provide surface texture	\$1,000
Notes: Grooved border is 11.5" wide (12" min).	
CBC: 11B-406.5.11	
Other: -	
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ram	p is 5.5% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	

3 - 4	Curb Ramp	Category:	
Provide	detectable warnings		\$1,000
Notes	: Truncated domes are 2.5" apart (2.3" mi	n to 2.4" max).	
CBC	: 11B-406.5.12		
Other	: ADA 705.1		
Provide	a level landing		\$2,500
Notes	: Counter slope at the base of the curb rate	mp is 6.7% (5.0% max).	
CBC	: 11B-406.5.8		
Other	: ADA 406.2		
Provide	a level landing		\$90
Notes	: Top landing has a slope of 2.5% (2% ma	ax).	
CBC	: 11B-406.5.3		
Other	: ADA 406.4, ADA 406.7		
Provide	surface texture		\$1,000
Notes	: Grooved border is 11.5" wide (12" min).		
CBC	: 11B-406.5.11		
Other	: -		
3 - 5	Curb Ramp	Category:	
Provide	a level landing		\$90
Notes	: Top landing has a slope of 2.6% (2% ma	ax).	
CBC	: 11B-406.5.3		
Other	: ADA 406.4, ADA 406.7		

3 - 6	Curb Ramp	Category:	
Provide	a level landing		\$0
Notes	: Top landing has a slope of 4.5% (2%	6 max).	
CBC	: 11B-406.5.3		
Other	: ADA 406.4, ADA 406.7		
Provide	a level landing		\$2,500
Notes	: Counter slope at the base of the cur	b ramp is 5.8% (5.0% max).	
CBC	: 11B-406.5.8		
Other	: ADA 406.2		
Provide	surface texture		\$0
Notes	: No grooved border provided.		
CBC	: 11B-406.5.11		
Other	: -		
Provide	detectable warnings		\$0
Notes	: Detectable warnings not provided.		
CBC	: 11B-247.1.2, 11B-406.5.12		
Other	: -		
Install,	replace or modify curb ramp		\$2,460
Notes	: Width of ramp, not including flared s 12.4% (8.33% max).	ides, is 44" (48" min). Slope of the curb	o ramp is
CBC	: 11B-405.2, 11B-406, 11B-406.5.2		
Other	: ADA 405.2, ADA 405.5, ADA 406.1		

Category:
\$0
\$0
\$0
\$2,460
48" min). Slope of the curb ramp is
Category:
\$7,320
3 linear feet, with two flags of up to
Category:
\$17,840
6 linear feet (2.0% max).
Category:
\$3,160
\$3,160 linear feet (2.0% max).

4 - 4 Walk	Category:
Regrade surface	\$11,280
Notes: Cross slope of concrete path is up to 3.6% f	or 282 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
14 - 1 Bus Stop	Category:
Regrade bus stop pad or light rail platform	\$500
Notes: Clear floor space at the bus stop has a slope	e of up to 2.4% (2% max).
CBC: 11B-810.2.4	
Other: ADA 810.2.4	
14 - 2 Bus Stop	Category:
Regrade bus stop pad or light rail platform	\$500
Notes: Clear floor space at the bus stop has a slop	e of up to 3.4% (2% max0.
CBC: 11B-810.2.4	
Other: ADA 810.2.4	


Sterling/Barnhart Park 10486 Sterling Boulevard Cupertino, CA



Sterling/Barnhart Park - PROW


3 - 1 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb r	amp is 11.6% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Grind or patch vertical change of grade	\$0
Notes: 1/2" change in level at the bottom of th any changes in level).	e curb ramp (curb ramps must be free from
CBC: 11B-303.2.3, 11B-405.4	
Other: ADA 405.4	
Install, replace or modify curb ramp	\$2,460
Notes: Slope of one flared side is 10.7% (10.0	1% max).
CBC: 11B-406.2.2	
Other: ADA 406.3	
Provide surface texture	\$0
Notes: Grooved border is 11" wide (12" min).	
CBC: 11B-406.5.11	
Other: -	
4 - 1 Walk	Category:
Regrade surface	\$800
Notes: Cross slope of concrete path is up to 2	.8% for 20 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 2 Walk	Category:
Regrade surface	\$3,920
Notes: Cross slope of concrete path is up to 4	% for 98 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	

Stevens Creek Boulevard DeAnza Boulevard to Saich Way Cupertino, CA

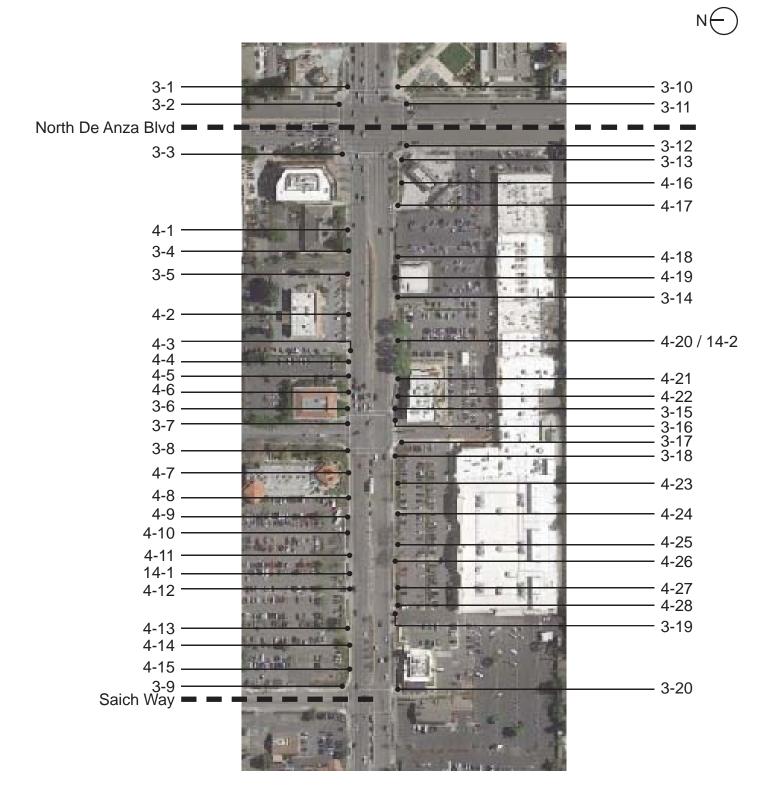


Stevens Creek Boulevard Saich Way to Stelling Road Cupertino, CA

N(

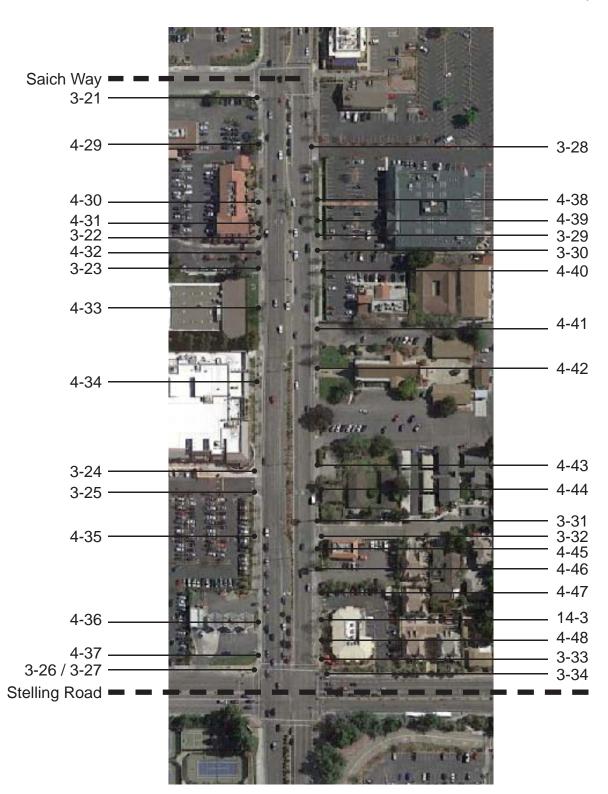

Stevens Creek Boulevard Stelling Road to Highway 85 Cupertino, CA

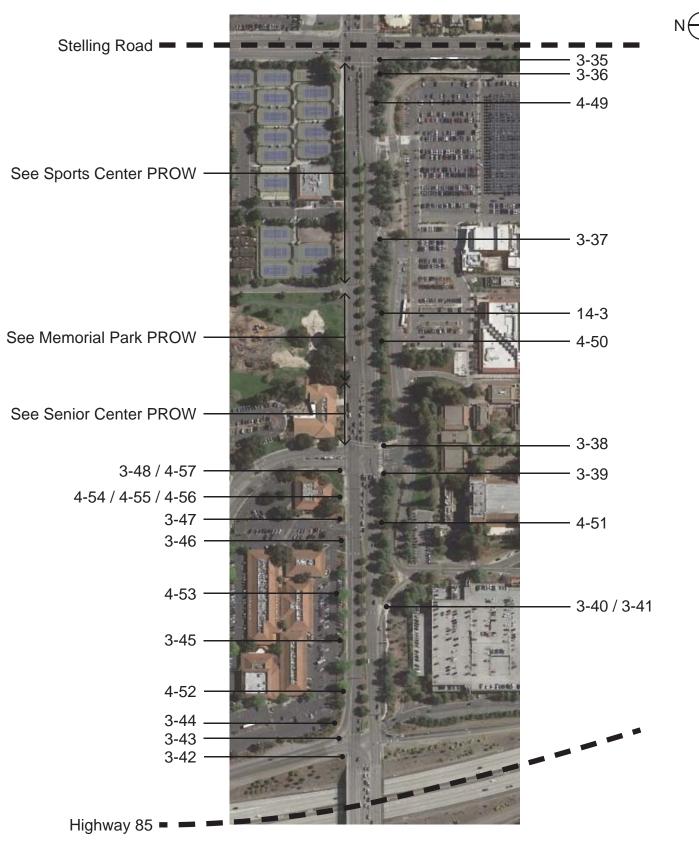

City of Cupertino PROW Surveys

3 - 1	Curb Ramp	Category:
Install, r	eplace or modify curb ramp	\$2,460
Notes	Slope of the curb ramp is 9.1% (8.33% max). Slope of (10.0% max).	one flared side is 11%
	11B-405.2, 11B-406, 11B-406.2.2 ADA 405.2, ADA 406.1, ADA 406.3	
Provide	detectable warnings	\$0
Notes	Truncated domes are spaced 2.5" center to center (2.	3" min to 2.4" max).
	11B-406.5.12 ADA 705.1	
3 - 2	Curb Ramp	Category:
Provide	a level landing	\$2,500
Notes	Counter slope at the base of the curb ramp is 6.3% (5	.0% max).
CBC	11B-406.5.8	
Other	ADA 406.2	
Install, r	eplace or modify curb ramp	\$2,460
Notes	Slope of the curb ramp is 10% (8.33% max).	
CBC	11B-405.2, 11B-406	
Other	ADA 405.2, ADA 406.1	
Provide	detectable warnings	\$0
Notes	Truncated domes are spaced 2.5" center to center (2.	3" min to 2.4" max).
CBC	11B-406.5.12	
Other	ADA 705.1	

3 - 3 Curb Ramp	Category:
Provide a level landing	\$160
Notes: Landing at bottom of curb ramp is not (48"x48")	ot entirely within the crosswalk markings
CBC: 11B-406.5.9	
Other: ADA 406.6	
nstall, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 8.7% (8.3) one side and 13.6% on the other (10	3% max). Slopes of flared sides are 11.4% on 0.0% max).
CBC: 11B-405.2, 11B-406, 11B-406.2.2	
Other: ADA 405.2, ADA 406.1, ADA 406.3	
Provide detectable warnings	\$0
Notes: Truncated domes are spaced 2.5" c	enter to center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
Grind or patch vertical change of grade	\$0
Notes: 2" change in level at the counter slo from any changes in level).	pe of the curb ramp (curb ramps must be free
CBC: 11B-303.2.3, 11B-405.4	
CBC: 11B-303.2.3, 11B-405.4 Other: ADA 405.4	
	Category:
Other: ADA 405.4 3 - 4 Curb Ramp	
Other: ADA 405.4 3 - 4 Curb Ramp	\$2,500
Other: ADA 405.4 3 - 4 Curb Ramp Provide a level landing	\$2,500
Other: ADA 405.4 3 - 4 Curb Ramp Provide a level landing Notes: Counter slope at the base of the cur	\$2,500
Other: ADA 405.4 3 - 4 Curb Ramp Provide a level landing Notes: Counter slope at the base of the cur CBC: 11B-406.5.8 Other: ADA 406.2	\$2,500 b ramp is 6.4% (5.0% max).
Other: ADA 405.4 3 - 4 Curb Ramp Provide a level landing Notes: Counter slope at the base of the cur CBC: 11B-406.5.8 Other: ADA 406.2	\$2,500 b ramp is 6.4% (5.0% max). \$90
Other: ADA 405.4 3 - 4 Curb Ramp Provide a level landing Notes: Counter slope at the base of the cur CBC: 11B-406.5.8 Other: ADA 406.2 Provide a level landing	\$2,500 b ramp is 6.4% (5.0% max). \$90
Other: ADA 405.4 3 - 4 Curb Ramp Provide a level landing Notes: Counter slope at the base of the cur CBC: 11B-406.5.8 Other: ADA 406.2 Provide a level landing Notes: Top landing has a slope of 2.8% (29)	\$2,500 b ramp is 6.4% (5.0% max). \$90
Other: ADA 405.4 3 - 4 Curb Ramp Provide a level landing Notes: Counter slope at the base of the cur CBC: 11B-406.5.8 Other: ADA 406.2 Provide a level landing Notes: Top landing has a slope of 2.8% (2% CBC: 11B-406.5.3	\$2,500 b ramp is 6.4% (5.0% max). \$90
Other: ADA 405.4 3 - 4 Curb Ramp Provide a level landing Notes: Counter slope at the base of the cur CBC: 11B-406.5.8 Other: ADA 406.2 Provide a level landing Notes: Top landing has a slope of 2.8% (29 CBC: 11B-406.5.3 Other: ADA 406.4, ADA 406.7	\$2,500 b ramp is 6.4% (5.0% max). \$90 % max). \$1,000
Other: ADA 405.4 3 - 4 Curb Ramp Provide a level landing Notes: Counter slope at the base of the cur CBC: 11B-406.5.8 Other: ADA 406.2 Provide a level landing Notes: Top landing has a slope of 2.8% (2% CBC: 11B-406.5.3 Other: ADA 406.4, ADA 406.7 Provide detectable warnings	\$2,500 b ramp is 6.4% (5.0% max). \$90 % max). \$1,000

3 - 5 Curb Ramp	Category:
Provide detectable warnings	\$1,000
Notes: Truncated domes are spaced 2.5" center	to center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
Provide surface texture	\$1,000
Notes: Grooved border is 11.5" wide (12" min).	
CBC: 11B-406.5.11	
Other: -	
3 - 6 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ram	ıp is 5.6% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide a level landing	\$0
Notes: Top landing has a slope of 2.9% (2% max	().
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Install, replace or modify curb ramp	\$2,460
Notes: Cross slope of the curb ramp is 2.6% (2.0 (8.33% max).	% max). Slope of the curb ramp is 10%
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 405.3, ADA 406.1	
Provide detectable warnings	\$0
Notes: Truncated domes are spaced 2.5" center	to center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
Provide surface texture	\$0
Notes: Grooved border is 11.5" wide (12" min).	
CBC: 11B-406.5.11	
Other: -	

3 - 7 Curb Ramp	Category:
Provide detectable warnings	\$1,000
Notes: Truncated domes are spaced 2.5" ce	nter to center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
Provide surface texture	\$1,000
Notes: Grooved border is 11.5" wide (12" mi	n).
CBC: 11B-406.5.11	
Other: -	
3 - 8 Curb Ramp	Category:
Provide a level landing	\$90
Notes: Top landing has a slope of 4.8% (2%	max). (See 4-7).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide detectable warnings	\$1,000
Notes: Truncated domes are spaced 2.5" ce	nter to center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
Provide surface texture	\$1,000
Notes: Grooved border is 11.5" wide (12" mi	n).
CBC: 11B-406.5.11	
Other: -	

3 - 9 Curb Ramp	Category:
Provide a level landing	\$0
Notes: Top landing has a slope of 2.9% (2% max parallel curb ramp has a slope of 4.6% (29	,
CBC: 11B-406.3.2, 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide detectable warnings	\$0
Notes: Truncated domes are spaced 2.5" center	to center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
Grind or patch vertical change of grade	\$0
Notes: 3/4" change in level at the bottom of the carrier any changes in level).	urb ramp (curb ramps must be free from
CBC: 11B-303.2.3, 11B-405.4	
Other: ADA 405.4	
Install, replace or modify curb ramp	\$2,460
Notes: Cross slope of run down to turning space	is 4% (2% max).
CBC: 11B-406	
Other: ADA 405.3, ADA 406.1	
3 - 10 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ram	p is 5.6% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Install, replace or modify curb ramp	\$2,460
Notes: Slope of one flared side is 10.2% (10.0%)	max).
CBC: 11B-406.2.2	
Other: ADA 406.3	
Provide detectable warnings	\$0
Notes: Truncated domes are spaced 2.5" center	to center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
3 - 11 Curb Ramp	Category:
Provide detectable warnings	\$1,000
Notes: Truncated domes are spaced 2.5" center	
CBC: 11B-406.5.12	· · · · /
Other: ADA 705.1	

3 - 12 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ram	ıp is 8.3% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide a level landing	\$90
Notes: Top landing has a slope of 6.2% (2% max	κ).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide detectable warnings	\$1,000
Notes: Truncated domes are spaced 2.5" center	to center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
3 - 13 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ram	ıp is 6.1% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide a level landing	\$90
Notes: Top landing has a slope of 4.5% (2% max	κ).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide detectable warnings	\$1,000
Notes: Truncated domes are spaced 2.5" center	to center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
3 - 14 Curb Ramp	Category:
Provide a level landing	\$90
Notes: Top landing has a slope of 3.5% (2% max	<).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	

3 - 15 Curb Ramp	Category:	
Provide a level landing		\$90
Notes: Top landing has a slope of 3.5% (2% max).		
CBC: 11B-406.5.3		
Other: ADA 406.4, ADA 406.7		
Install, replace or modify curb ramp		\$2,460
Notes: Slope of one flared side is 10.9% (10.0% max	к).	
CBC: 11B-406.2.2		
Other: ADA 406.3		
3 - 16 Curb Ramp	Category:	
Grind or patch vertical change of grade		\$250
Notes: 3/4" change in level at the joint between the g	prooved border and sidewalk.	
CBC: 11B-303.2.3, 11B-405.4		
Other: ADA 405.4		
3 - 17 Curb Ramp	Category:	
Provide a level landing		\$0
Notes: Top landing has a slope of 2.6% (2% max).		
CBC: 11B-406.5.3		
Other: ADA 406.4, ADA 406.7		
Install, replace or modify curb ramp		\$2,460
Notes: Cross slope of the curb ramp is 2.8% (2.0% n	nax).	
CBC: 11B-406		
Other: ADA 405.3, ADA 406.1		
Grind or patch vertical change of grade		\$0
Notes: 1/2" change in level between grooved border	and adjacent pavers.	
CBC: 11B-303.2.3, 11B-405.4		
Other: ADA 405.4		
Provide a level landing		\$160
Notes: 48" x48" space at the bottom of the ramp is n	ot located within crosswalk ma	arkings.
CBC: 11B-406.5.9		
Other: ADA 406.6		

3 - 18 Curb Ramp	Category:	
Provide a level landing		\$2,500
Notes: Counter slope at the base of the curb ram	p is 6.1% (5.0% max).	
CBC: 11B-406.5.8		
Other: ADA 406.2		
Provide a level landing		\$90
Notes: Top landing has a slope of 3.5% (2% max).	
CBC: 11B-406.5.3		
Other: ADA 406.4, ADA 406.7		
Grind or patch vertical change of grade		\$250
Notes: 1/2" change in level between grooved bor	der and adjacent pavers.	
CBC: 11B-303.2.3, 11B-405.4		
Other: ADA 405.4		
3 - 19 Curb Ramp	Category:	
Grind or patch vertical change of grade		\$250
Notes: 1/2" change in level between grooved bor	der and adjacent pavers.	
CBC: 11B-303.2.3, 11B-405.4		
Other: ADA 405.4		
3 - 20 Curb Ramp	Category:	
Provide a level landing		\$2,500
Notes: Counter slope at the base of the curb ram	p is 7.1% (5.0% max).	
CBC: 11B-406.5.8		
Other: ADA 406.2		
Provide surface texture		\$1,000
Notes: Grooved border is 11.5" wide (12" min).		
CBC: 11B-406.5.11		
Other: -		

3 - 21 Curb Ramp	Category:	
Provide a level landing		\$2,500
Notes: Counter slope at the base of the curb ramp i	s 6% (5.0% max).	
CBC: 11B-406.5.8		
Other: ADA 406.2		
Provide a level landing		\$0
Notes: Top landing has a slope of 4.9% (2% max).		
CBC: 11B-406.5.3		
Other: ADA 406.4, ADA 406.7		
Install, replace or modify curb ramp		\$2,460
Notes: Cross slope of the curb ramp is 3.3% (2.0%	max).	
CBC: 11B-406		
Other: ADA 405.3, ADA 406.1		
Provide detectable warnings		\$0
Notes: Truncated domes are spaced 2.5" center to	center (2.3" min to 2.4" max).	
CBC: 11B-406.5.12		
Other: ADA 705.1		
Provide surface texture		\$0
Notes: Grooved border is 11.5" wide (12" min).		
CBC: 11B-406.5.11		
Other: -		

3 - 22 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb rai	mp is 5.6% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide a level landing	\$0
Notes: Top landing has a slope of 3% (2% max)).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 8.9% (8.33% r	nax).
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	
Provide detectable warnings	\$O
Notes: Truncated domes are spaced 2.5" cente	r to center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
Provide surface texture	\$O
Notes: Grooved border is 11.5" wide (12" min).	
CBC: 11B-406.5.11	
Other: -	
3 - 23 Curb Ramp	Category:
Provide a level landing	\$90
Notes: The turning space at the bottom of the p max).	arallel curb ramp has a slope of 3.2% (2%
CBC: 11B-406.3.2	
Other: -	
Provide detectable warnings	\$1,000
Notes: Truncated domes are spaced 2.5" cente	r to center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	

3 - 24 Curb Ramp	Category:	
Provide a level landing		\$90
Notes: Top landing has a slope of 3.2% (2% max).		
CBC: 11B-406.5.3		
Other: ADA 406.4, ADA 406.7		
Provide detectable warnings		\$1,000
Notes: Truncated domes are spaced 2.5" center to cent	er (2.3" min to 2.4" max).	
CBC: 11B-406.5.12		
Other: ADA 705.1		
3 - 25 Curb Ramp	Category:	
Provide a level landing		\$90
Notes: Top landing has a slope of 2.3% (2% max).		
CBC: 11B-406.5.3		
Other: ADA 406.4, ADA 406.7		
3 - 26 Curb Ramp	Category:	
Provide a level landing		\$90
Notes: Top landing has a slope of 3.3% (2% max).		
CBC: 11B-406.5.3		
Other: ADA 406.4, ADA 406.7		
Provide detectable warnings		\$1,000
Notes: Truncated domes are spaced 2.5" center to cent	er (2.3" min to 2.4" max).	
CBC: 11B-406.5.12		
Other: ADA 705.1		
Provide surface texture		\$1,000
Notes: Grooved border is 11.5" wide (12" min).		
CBC: 11B-406.5.11		
Other: -		

3 - 27 Curb Ramp	Category:
Provide a level landing	\$2,50
Notes: Counter slope at the base of the curb ramp is	5.6% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide a level landing	\$
Notes: Top landing has a slope of 2.2% (2% max).	
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Install, replace or modify curb ramp	\$2,46
Notes: Cross slope of the curb ramp is 2.2% (2.0% m	nax).
CBC: 11B-406	
Other: ADA 405.3, ADA 406.1	
Provide detectable warnings	\$
Notes: Truncated domes are spaced 2.5" center to ce	enter (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
Provide surface texture	\$
Notes: Grooved border is 11.5" wide (12" min).	
CBC: 11B-406.5.11	
Other: -	
3 - 28 Curb Ramp	Category:
Provide a level landing	\$9
Notes: Top landing has a slope of 4.3% (2% max).	
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
3 - 29 Curb Ramp	Category:
Provide detectable warnings	\$1,00
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	

3 - 30 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ramp) is 12.6% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide a level landing	\$0
Notes: Top landing has a slope of 3% (2% max).	
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Install, replace or modify curb ramp	\$2,460
Notes: Cross slope of the curb ramp is 3.2% (2.0% flared sides, is 45" (48" min).	6 max). Width of ramp, not including
CBC: 11B-406, 11B-406.5.2	
Other: ADA 405.3, ADA 405.5, ADA 406.1	
3 - 31 Curb Ramp	Category:
Provide detectable warnings	\$1,000
Notes: Truncated domes are spaced 2.5" center to	o center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
Provide surface texture	\$1,000
Notes: No grooved border provided.	
CBC: 11B-406.5.11	
Other: -	

3 - 32 Curb Ramp	Category:
Provide a level landing	\$
Notes: Top landing has a slope of 3.1% (2% max).	
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide surface texture	\$0
Notes: Grooved border is 11" wide (12" min).	
CBC: 11B-406.5.11	
Other: -	
nstall, replace or modify curb ramp	\$2,460
Notes: Cross slope of the curb ramp is 5.6% (2.0%	max).
CBC: 11B-406	
Other: ADA 405.3, ADA 406.1	
3 - 33 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ramp	is 9.7% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide a level landing	\$(
Notes: Top landing has a slope of 4.4% (2% max).	Landing is 47.5" wide (48" min).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide detectable warnings	\$(
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Grind or patch vertical change of grade	\$250
Notes: 1/2" change in level at the bottom of the cur	b ramp (curb ramps must be free from
any changes in level).	
CBC: 11B-303.2.3, 11B-405.4	
Other: ADA 405.4	
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 9.8% (8.33% max	<i>(</i>).
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	

3 - 34	Curb Ramp	Category:
Provide	a level landing	\$0
Notes:	: Top landing has a slope of 4.5% (2% max). Landing	g is 47" wide (48" min).
CBC:	: 11B-406.5.3	
Other	: ADA 406.4, ADA 406.7	
Provide	detectable warnings	\$0
Notes:	Detectable warnings not provided.	
CBC:	: 11B-247.1.2, 11B-406.5.12	
Other	: -	
Install, r	eplace or modify curb ramp	\$2,460
Notes	Slope of the curb ramp is 9.5% (8.33% max). Cross (2.0% max).	slope of the curb ramp is 5.7%
CBC:	: 11B-405.2, 11B-406	
Other	: ADA 405.2, ADA 405.3, ADA 406.1	
Provide	a level landing	\$2,500
Notes:	Counter slope at the base of the curb ramp is 14%	(5.0% max).
CBC:	: 11B-406.5.8	
Other	: ADA 406.2	

3 - 35 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the cur	b ramp is 6.4% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide a level landing	\$90
Notes: Top landing has a slope of 5.3% (2%	6 max).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide detectable warnings	\$1,000
Notes: Truncated domes are spaced 2.5" ce	enter to center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
Grind or patch vertical change of grade	\$250
Notes: 3/4" change in level at the bottom of any changes in level).	the curb ramp (curb ramps must be free from
CBC: 11B-303.2.3, 11B-405.4	
Other: ADA 405.4	
Provide a level landing	\$160
Notes: Space at the bottom of the ramp is 4	1" within the cross walk (48" by 48" min).
CBC: 11B-406.5.9	
Other: ADA 406.6	
3 - 36 Curb Ramp	Category:
Grind or patch vertical change of grade	\$250
Notes: 1" change in level at the bottom of th	ne curb ramp. 3/4" change in level where cover (curb ramps must be free from any
CBC: 11B-303.2.3, 11B-405.4	
Other: ADA 405.4	
nstall, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 9.6% (8.33	3% max).
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	

3 - 37 Curb Ramp	Category:	
Install, replace or modify curb ramp		\$2,460
Notes: Slope of the curb ramp is 8.9% and 16.1% at the la	ast 16" of the run (8.33%	6 max).
CBC: 11B-405.2, 11B-406		
Other: ADA 405.2, ADA 406.1		
Provide detectable warnings		\$0
Notes: Truncated domes are spaced 2.5" center to center	r (2.3" min to 2.4" max).	
CBC: 11B-406.5.12		
Other: ADA 705.1		
Provide surface texture		\$0
Notes: Grooved border is 11.5" wide (12" min).		
CBC: 11B-406.5.11		
Other: -		
3 - 38 Curb Ramp	Category:	
Install, replace or modify curb ramp		\$2,460
Notes: Slope of one flared side is 11.2% (10.0% max).		
CBC: 11B-406.2.2		
Other: ADA 406.3		
Provide a level landing		\$2,500
Notes: Counter slope at the base of the curb ramp is 5.2%	% (5.0% max).	
CBC: 11B-406.5.8		
Other: ADA 406.2		
3 - 39 Curb Ramp	Category:	
Provide a level landing		\$90
Notes: Top landing has a slope of 5.5% (2% max).		
CBC: 11B-406.5.3		
Other: ADA 406.4, ADA 406.7		
Provide a level landing		\$2,500
Notes: Counter slope at the base of the curb ramp is 5.8%	% (5.0% max).	
CBC: 11B-406.5.8		
Other: ADA 406.2		
3 - 40 Curb Ramp	Category:	
Provide a level landing		\$90
Notes: Top landing has a slope of 2.6% (2% max).		
CBC: 11B-406.5.3		
Other: ADA 406.4, ADA 406.7		

3 - 41 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb	ramp is 7.6% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
3 - 42 Curb Ramp	Category:
Provide a level landing	\$90
Notes: Top landing has a slope of 3.2%.	
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide detectable warnings	\$1,000
Notes: Truncated domes are spaced 2.5" cen	iter to center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
Provide surface texture	\$1,000
Notes: Grooved border is 11.25" wide (12" mi	n).
CBC: 11B-406.5.11	
Other: -	
3 - 43 Curb Ramp	Category:
Provide detectable warnings	\$0
Notes: Detectable warnings don't extend the f	full width of pedestrian opening.
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Install, replace or modify curb ramp	\$2,460
Notes: Cross slope of the curb ramp is 2.4% ((2.0% max).
CBC: 11B-406	
Other: ADA 405.3, ADA 406.1	
3 - 44 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb	ramp is 6.4% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide a level landing	\$90
Notes: Top landing has a slope of 3.5% (2% r	max).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	

3 - 45 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ram	o is 5.4% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide detectable warnings	\$1,000
Notes: Truncated domes are spaced 2.5" center t	o center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
3 - 46 Curb Ramp	Category:
Provide a level landing	\$0
Notes: Top landing has a slope of 3% (2% max).	
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 8.7% (8.33% ma	
CBC: 11B-405.2, 11B-406	
Other: ADA 405.2, ADA 406.1	
Provide detectable warnings	\$0
Notes: Truncated domes are spaced 2.5" center t	o center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	
3 - 47 Curb Ramp	Category:
Provide a level landing	\$90
Notes: Top landing has a slope of 3.8% (2% max)).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
3 - 48 Curb Ramp	Category:
Provide a level landing	\$90
Notes: Top landing has a slope of 3.3% on one si	de and 5.4% on the building side (2%
max).	
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
Provide detectable warnings	\$1,000
Notes: Truncated domes are spaced 2.5" center t	o center (2.3" min to 2.4" max).
CBC: 11B-406.5.12	
Other: ADA 705.1	

4 - 1 Walk	Category:
Regrade surface	\$2,480
Notes: Cross slope of concrete path is up to	2.7% for 62 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
4 - 2 Walk	Category:
Regrade surface	\$6,840
Notes: Cross slope of concrete path is up to	3.6% for 171 linear feet (2.0% max).
CBC: 11B-403.3	
Other: ADA 403.3	
Grind or patch vertical change of grade	\$250
Notes: Two 1/2" changes in level at concret	e joint (1/4" max, up to 1/2" with a bevel).
CBC: 11B-303.2	
Other: ADA 303.2, ADA 303.3	
4 - 3 Walk	Category:
Regrade surface	\$1,200
Notes: Cross slope of concrete path is up to max). CBC: 11B-403.3 Other: ADA 403.3	3.3% for 30 linear feet across drive (2.0%
4 - 4 Walk	Category:
Regrade surface	\$400
Notes: Cross slope of concrete path is up to CBC: 11B-403.3	2.6% for 10 linear feet (2.0% max).
Other: ADA 403.3	
Other: ADA 403.3 4 - 5 Walk	Category:
4 - 5 Walk	Category: \$1,440
4 - 5 Walk Regrade surface Notes: Cross slope of concrete path is up to	\$1,440
4 - 5 Walk Regrade surface Notes: Cross slope of concrete path is up to	\$1,440 6.3% for 36 linear feet across drive (2.0%
 4 - 5 Walk Regrade surface Notes: Cross slope of concrete path is up to max). Flared sides of the drive have 	\$1,440 6.3% for 36 linear feet across drive (2.0%
 4 - 5 Walk Regrade surface Notes: Cross slope of concrete path is up to max). Flared sides of the drive have CBC: 11B-403.3 	\$1,440 6.3% for 36 linear feet across drive (2.0%
 4 - 5 Walk Regrade surface Notes: Cross slope of concrete path is up to max). Flared sides of the drive have CBC: 11B-403.3 Other: ADA 403.3 	\$1,440 0 6.3% for 36 linear feet across drive (2.0% slopes of 22.6% and 16.5% (10% max). Category:
 4 - 5 Walk Regrade surface Notes: Cross slope of concrete path is up to max). Flared sides of the drive have CBC: 11B-403.3 Other: ADA 403.3 4 - 6 Walk 	\$1,440 0 6.3% for 36 linear feet across drive (2.0% slopes of 22.6% and 16.5% (10% max). Category: \$3,160
 4 - 5 Walk Regrade surface Notes: Cross slope of concrete path is up to max). Flared sides of the drive have CBC: 11B-403.3 Other: ADA 403.3 4 - 6 Walk Regrade surface 	\$1,440 0 6.3% for 36 linear feet across drive (2.0% slopes of 22.6% and 16.5% (10% max). Category: \$3,160

4 - 7	Walk	Category:	
Regrade	surface		\$400
Notes:	Cross slope of concrete path is up to 2.7% for 10 lir	near feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 8	Walk	Category:	
Regrade	surface		\$1,000
Notes:	Cross slope of concrete path is up to 2.8% for 25 lir	near feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 9	Walk	Category:	
Regrade	surface		\$800
Notes:	Cross slope of concrete path is up to 3.2% for 20 lir	near feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 10	Walk	Category:	
Remove	overhanging or protruding objects		\$125
Notes:	Tree branches are protruding 32" out from the tree	trunk at 60" AFF (80" m	in).
CBC:	11B-307.4		
Other:	ADA 307.4		
4 - 11	Walk	Category:	
Regrade	surface		\$1,200
Notes:	Cross slope of concrete path is up to 3.5% for 30 lir	near feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 12	Walk	Category:	
Regrade	surface		\$6,440
Notes:	Cross slope of concrete path is up to 4% for 161 lin	ear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 13	Walk	Category:	
Regrade	surface		\$1,520
	Cross slope of concrete path is up to 5.6% for 38 lir		.0%
Notes:	max). One flared side of the drive has a slope of 13	8.6% (10% max).	
		8.6% (10% max).	

4 - 14	Walk	Category:	
Regrade	surface		\$800
Notes:	Cross slope of concrete path is up to 3.4% for 20	linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 15	Walk	Category:	
Regrade	surface		\$800
Notes:	Cross slope of concrete path is up to 3.5% for 20	linear feet (2.0% max).	
	11B-403.3	22222	
Other:	ADA 403.3		
Grind or	patch vertical change of grade		\$250
	Four changes in level across walk and ranging from with a bevel).	om 1/2" to 1" (1/4" max, up	•
CBC:	11B-303.2		
Other:	ADA 303.2, ADA 303.3		
4 - 16	Walk	Category:	
Regrade	surface		\$4,760
Notes:	Cross slope of concrete path is up to 3.2% for 119	9 linear feet (2.0% max).	
	11B-403.3	······	
Other:	ADA 403.3		
Other: 4 - 17	ADA 403.3	Category:	
4 - 17	ADA 403.3	Category:	\$2,240
4 - 17 Regrade	ADA 403.3 Walk		
4 - 17 Regrade Notes:	ADA 403.3 Walk surface Cross slope of concrete path is up to 4.4% for 56		
4 - 17 Regrade Notes: CBC:	ADA 403.3 Walk surface Cross slope of concrete path is up to 4.4% for 56 max).		
4 - 17 Regrade Notes: CBC:	ADA 403.3 Walk surface Cross slope of concrete path is up to 4.4% for 56 max). 11B-403.3 ADA 403.3		
4 - 17 Regrade Notes: CBC: Other: 4 - 18	ADA 403.3 Walk surface Cross slope of concrete path is up to 4.4% for 56 max). 11B-403.3 ADA 403.3 Walk	linear feet across drive (2	.0%
4 - 17 Regrade Notes: CBC: Other: 4 - 18 Regrade	ADA 403.3 Walk surface Cross slope of concrete path is up to 4.4% for 56 max). 11B-403.3 ADA 403.3 Walk	linear feet across drive (2. Category:	
4 - 17 Regrade Notes: CBC: Other: 4 - 18 Regrade Notes:	ADA 403.3 Walk surface Cross slope of concrete path is up to 4.4% for 56 max). 11B-403.3 ADA 403.3 Walk surface Cross slope of concrete path is up to 3.6% for 156	linear feet across drive (2. Category:	.0%
4 - 17 Regrade Notes: CBC: Other: 4 - 18 Regrade Notes: CBC:	ADA 403.3 Walk surface Cross slope of concrete path is up to 4.4% for 56 max). 11B-403.3 ADA 403.3 Walk surface Cross slope of concrete path is up to 3.6% for 156 11B-403.3	linear feet across drive (2. Category:	.0%
4 - 17 Regrade Notes: CBC: Other: 4 - 18 Regrade Notes: CBC: Other:	ADA 403.3 Walk surface Cross slope of concrete path is up to 4.4% for 56 max). 11B-403.3 ADA 403.3 Walk surface Cross slope of concrete path is up to 3.6% for 156 11B-403.3 ADA 403.3	linear feet across drive (2. Category: 6 linear feet (2.0% max).	.0%
4 - 17 Regrade Notes: CBC: Other: 4 - 18 Regrade Notes: CBC: Other: 4 - 19	ADA 403.3 Walk surface Cross slope of concrete path is up to 4.4% for 56 max). 11B-403.3 ADA 403.3 Walk surface Cross slope of concrete path is up to 3.6% for 156 11B-403.3 ADA 403.3 Walk	linear feet across drive (2. Category:	\$6,240
4 - 17 Regrade Notes: CBC: Other: 4 - 18 Regrade Notes: CBC: Other: 4 - 19 Regrade	ADA 403.3 Walk surface Cross slope of concrete path is up to 4.4% for 56 max). 11B-403.3 ADA 403.3 Walk surface Cross slope of concrete path is up to 3.6% for 156 11B-403.3 ADA 403.3 Walk surface	linear feet across drive (2 Category: 6 linear feet (2.0% max). Category:	.0% \$6,240 \$1,600
4 - 17 Regrade Notes: CBC: Other: 4 - 18 Regrade Notes: CBC: Other: 4 - 19 Regrade	ADA 403.3 Walk surface Cross slope of concrete path is up to 4.4% for 56 max). 11B-403.3 ADA 403.3 Walk surface Cross slope of concrete path is up to 3.6% for 156 11B-403.3 ADA 403.3 Walk surface Cross slope of concrete path is up to 3.8% for 40	linear feet across drive (2 Category: 6 linear feet (2.0% max). Category:	.0% \$6,240 \$1,600
4 - 17 Regrade Notes: CBC: Other: 4 - 18 Regrade Notes: CBC: Other: 4 - 19 Regrade Notes:	ADA 403.3 Walk surface Cross slope of concrete path is up to 4.4% for 56 max). 11B-403.3 ADA 403.3 Walk surface Cross slope of concrete path is up to 3.6% for 156 11B-403.3 ADA 403.3 Walk surface	linear feet across drive (2 Category: 6 linear feet (2.0% max). Category:	.0% \$6,240 \$1,600

4 - 20	Walk	Category:	
Regrade	surface		\$4,880
Notes:	Cross slope of concrete path is betw max).	een 2.2% and 2.7% for 122 linear fee	t (2.0%
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 21	Walk	Category:	
Regrade	surface		\$600
Notes:	Cross slope of concrete path is up to	2.9% for 15 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 22	Walk	Category:	
Regrade	surface		\$2,080
Notes:	Cross slope of concrete path is up to	4% for 52 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 23	Walk	Category:	
Regrade	surface		\$920
Notes:	Cross slope of concrete path is up to	4% for 23 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 24	Walk	Category:	
Regrade	surface		\$1,160
Notes:	Cross slope of concrete path is up to	2.4% for 29 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 25	Walk	Category:	
Regrade	surface		\$1,600
Notes:	Cross slope of concrete path is up to	3% for 40 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 26	Walk	Category:	
Regrade	surface		\$600
-	Cross slope of concrete path is up to	3.7% for 15 linear feet (2.0% max).	
	11B-403.3		
Othor	ADA 403.3		

4 - 27	Walk	Category:
Regrade	surface	\$640
Notes	Cross slope of concrete path is up t	o 2.4% for 16 linear feet (2.0% max).
CBC	11B-403.3	
Other	ADA 403.3	
4 - 28	Walk	Category:
Regrade	surface	\$1,160
Notes	Cross slope of concrete path is up t	o 2.8% for 29 linear feet (2.0% max).
CBC	11B-403.3	
Other	ADA 403.3	
4 - 29	Walk	Category:
Regrade	surface	\$2,600
Notes	Cross slope of concrete path is up t	o 3.4% for 65 linear feet (2.0% max).
CBC	11B-403.3	
Other	ADA 403.3	
4 - 30	Walk	Category:
Regrade	surface	\$520
Notes	Cross slope of concrete path is up t	o 3% for 13 linear feet (2.0% max).
CBC	11B-403.3	
Other	ADA 403.3	
4 - 31	Walk	Category:
Regrade	surface	\$720
Notes	Cross slope of concrete path is up t Peet's Coffee plaza (2.0% max).	o 4% for 18 linear feet at pavers leading to
CBC	11B-403.3	
Other	ADA 403.3	
Grind o	patch vertical change of grade	\$250
Notes	1/2" change in level at concrete join	t (1/4" max, up to 1/2" with a bevel).
CBC	11B-303.2	
Other	ADA 303.2, ADA 303.3	
4 - 32	Walk	Category:
Regrade	surface	\$720
Notes	Cross slope of concrete path is up t max).	o 2.3% for 18 linear feet across drive (2.0%
CBC	11B-403.3	
Other	ADA 403.3	

		_	
4 - 33	Walk	Category:	
-	surface		\$40
Notes:	Running slope of concrete path is up	to 12.8% for 12" at utility cover (5.0% r	nax).
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 34	Walk	Category:	
Regrade	surface		\$5,040
Notes:	Cross slope of concrete path is up to a	3.3% for 126 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 35	Walk	Category:	
Regrade	surface		\$1,800
Notes:	Cross slope of concrete path is up to 2	2.5% for 45 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 36	Walk	Category:	
Regrade	surface		\$7,680
CBC:	flared sides of 17.2% and 13.6% (10 ° drive is up to 10% with flared sides of side walk is up to 3.4% for 118 linear 11B-403.3	p to 13.4% for 37 linear feet (2.0% ma % max). Cross slope of the second co 20.3% and 19.9%. Cross slope of con feet.	ncrete
	ADA 403.3		
4 - 37	Walk	Category:	
	surface	· · · · ·	\$400
Notes:	Cross slope of concrete path is up to a	2.7% for 10 linear feet (2.0% max).	
	11B-403.3		
	ADA 403.3		
4 - 38	Walk	Category:	
Regrade	surface		\$1,520
Notes:		2.6% for 38 linear feet across drive (2. is up to 11.4% at the west side of the	
	(5.0% max).		
	, e , ,		

4 - 39	Walk	Category:	
Regrade	e surface		\$3,240
Notes	: Cross slope of concrete path is up to 3% for 81	linear feet (2.0% max).	
CBC	: 11B-403.3		
Other	: ADA 403.3		
4 - 40	Walk	Category:	
Regrade	e surface		\$520
Notes	: Cross slope of concrete path is up to 3% for 13	linear feet (2.0% max).	
CBC	: 11B-403.3		
Other	: ADA 403.3		
4 - 41	Walk	Category:	
Regrade	e surface		\$1,480
Notes	: Cross slope of concrete path is up to 3.3% for 3	37 linear feet (2.0% max).	
CBC	: 11B-403.3		
Other	: ADA 403.3		
4 - 42	Walk	Category:	
Regrade	e surface		\$4,360
Notes	: Cross slope of concrete path is up to 4% for 10	9 linear feet (2.0% max).	
CBC	: 11B-403.3		
Other	: ADA 403.3		
4 - 43	Walk	Category:	
Regrade	e surface		\$4,200
•	: Cross slope of concrete path is up to 3.9% for	105 linear feet (2.0% max).	
	: 11B-403.3		
Other	: ADA 403.3		
4 - 44	Walk	Category:	
	e surface		\$1,120
•	: Cross slope of concrete path is up to 2.3% for 2	28 linear feet (2.0% max).	
CBC	: 11B-403.3		
Other	: ADA 403.3		
4 - 45	Walk	Category:	
Grind o	r patch vertical change of grade	0,7	\$250
	: Marked 1/2" change in level (1/4" max, up to 1/	2" with a bevel).	
	: 11B-303.2		
	: ADA 303.2, ADA 303.3		

Stevens Creek Boulevard

4 - 46	Walk	Category:
Regrade	surface	\$880
Notes:	Cross slope of concrete path is up	to 2.3% for 22 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
Grind or	patch vertical change of grade	\$250
Notes:	1/2" change in level at concrete join	nt (1/4" max, up to 1/2" with a bevel).
	11B-303.2	
Other:	ADA 303.2, ADA 303.3	
4 - 47	Walk	Category:
Regrade	surface	\$3,720
	Cross slope of concrete path is up	to 9.8% for 93 linear feet across two drives (2.0) walk between drives is up to up to 4.9% (2%
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 48	Walk	Category:
Regrade	surface	\$4,120
Notes:	Cross slope of concrete path is up	to 9.8% for 103 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 49	Walk	Category:
Regrade	surface	\$9,680
Notes:	Cross slope of concrete path is up	to 3.9% for 242 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 50	Walk	Category:
Regrade	surface	\$27,000
Notes:	Cross slope of concrete path is up	to 3.3% for 675 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 51	Walk	Category:
Regrade	surface	\$17,440
Notes:	Cross slope of concrete path is up the walk by the curb ramp (2.0% n	to 3.6% for 436 linear feet and 4.4% at the end nax).
CBC:	11B-403.3	
Other [.]	ADA 403.3	

Stevens Creek Boulevard

4 - 52	Walk Category:	
Regrade	surface	\$3,520
Notes	Cross slope of concrete path is up to 3.5% for 88 linear feet (2.0% max).	
CBC	11B-403.3	
Other	ADA 403.3	
Grind o	patch vertical change of grade	\$250
Notes	3/4" change in level at utility cover (1/4" max, up to 1/2" with a bevel).	
CBC	11B-303.2	
Other	ADA 303.2, ADA 303.3	
4 - 53	Walk Category:	
Regrade	surface	\$17,440
Notes	Cross slope of concrete path is up to 4.8% for 436 linear feet (2.0% max).	
CBC	11B-403.3	
Other	ADA 403.3	
Grind o	patch vertical change of grade	\$250
Notes	2.75" change in level at concrete joint (1/4" max, up to 1/2" with a bevel).	
CBC	11B-303.2	
Other	ADA 303.2, ADA 303.3	
4 - 54	Walk Category:	
Regrade	surface	\$1,440
Notes	Cross slope of concrete path is up to 3.2% for 36 linear feet (2.0% max).	
CBC	11B-403.3	
Other	ADA 403.3	
4 - 55	Walk Category:	
Regrade	surface	\$640
Notes	Cross slope of concrete path is up to 2.7% for 16 linear feet (2.0% max).	
CBC	11B-403.3	
Other	ADA 403.3	
Grind o	patch vertical change of grade	\$250
Notes	1.5" wide and 4" long hole in water utility cover.	
CBC	11B-303.2	
Other	ADA 303.2, ADA 303.3	
4 - 56	Walk Category:	
Grind o	patch vertical change of grade	\$250
Notes	3/4" change in level at concrete path (1/4" max).	
CBC	11B-303.2	
Other	ADA 303.2, ADA 303.3	

Stevens Creek Boulevard

4 - 57	Walk	Category:	
Regrade	surface	\$	6800
Notes:	Cross slope of concrete path	is up to 3% for 20 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
14 - 1	Bus Stop	Category:	
Regrade	bus stop pad or light rail p	latform \$	\$500
Notes:	Clear floor space in front of t 13)	he bus stop has a slope of 2.8% (2% max). (See n	ote 4-
CBC:	11B-810.2.4		
Other:	ADA 810.2.4		
14 - 2	Bus Stop	Category:	
Regrade	bus stop pad or light rail p	latform \$	\$500
Notes:	•	nt of the bus stop has a slope of 2.7% (2% max). 7 to concrete pad at bus stop (1/4" max).	1/2"
CBC:	11B-810.2.4		
Other:	ADA 810.2.4		
14 - 3	Bus Stop	Category:	
Regrade	bus stop pad or light rail p	latform \$	\$500
Notes:	Clear floor space of the bus s	stop has a slope of up to 3% in alighting area (2%	max).
CBC:	11B-810.2.4		
Other [.]	ADA 810.2.4		

Three Oaks Park Candlelight Way near Rainbow Cupertino, CA




Three Oaks Park - PROW

3 - 1 Curb Ramp	Category:
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ramp	o is 6.4% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide a level landing	\$90
Notes: Top landing of the curb ramp has a slope of	of 4.6% (2% max).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
3 - 2 Curb Ramp	Category:
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ramp	o is 7.5% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Grind or patch vertical change of grade	\$0
Notes: 3/4" change in level between asphalt surfa level changes).	ce and curb (curb ramp must be free of
CBC: 11B-303.2.3, 11B-405.4	
Other: ADA 405.4	
Install, replace or modify curb ramp	\$2,460
Notes: Slope of the curb ramp is 16.4% (8.33% m (10.0% max).	ax). Slope of one flared side is 17%
CBC: 11B-405.2, 11B-406, 11B-406.2.2	
Other: ADA 405.2, ADA 406.1, ADA 406.3	
Provide a level landing	\$0
Notes: A landing is not provided at the top of the r	amp (48" x 48" min).
CBC: 11B-406.5.3	
Other: ADA 406 4 ADA 406 7	
Other: ADA 406.4, ADA 406.7	
	\$0
	\$0
Provide surface texture	\$0

Three Oaks Park - PROW

4 - 1	Walk	Category:
Regrad	le surface	\$320
Notes	s: Cross slope of concrete path is u	up to 2.7% for 8 linear feet (2.0% max).
CBC	C: 11B-403.3	
Othe	er: ADA 403.3	
4 - 2	Walk	Category:
Regrad	le surface	\$680
Notes	s: Running slope of concrete path i 8% (2.0% max) for 17 linear feet	s up to 5.3% (5.0% max) and cross slope is up to
CBC	C: 11B-403.3	
	er: ADA 403.3	

Varian Park Ainsworth Drive Cupertino, CA N

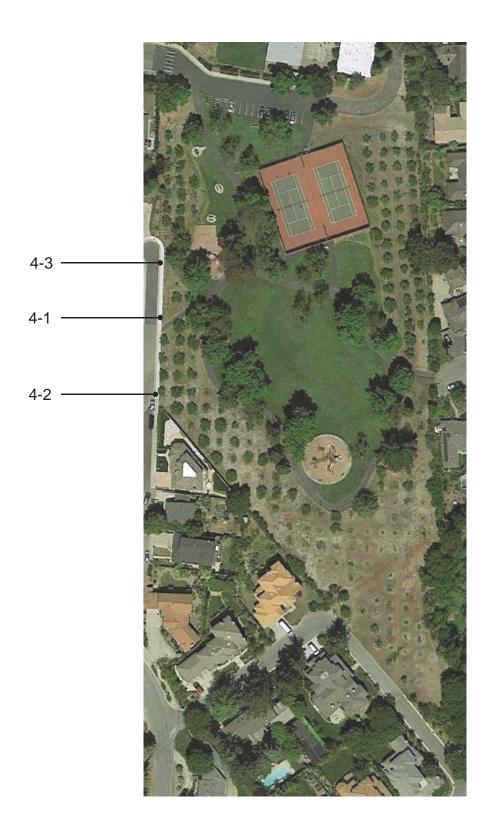

Varian Park - PROW

4 - 1	Walk	Category:
Regrade	surface	\$600
Notes:	Cross slope of concrete path is	up to 2.7% for 15 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
4 - 2	Walk	Category:
Regrade	e surface	\$3,240
Notes:	Cross slope of concrete path is slope at the fire hydrant is 5% (2	up to 3.2% for 81 linear feet (2.0% max). Cross 2% max).
CBC:	11B-403.3	
Other:	ADA 403.3	
Remove	overhanging or protruding ob	jects \$125
Notes:	4 trees overhang fence by 20" a	it 60" AFF (80" min).
CBC:	11B-307.4	
Other:	ADA 307.4	
4 - 3	Walk	Category:
Regrade	e surface	\$880
Notes:	Cross slope of concrete path is	up to 2.9% for 22 linear feet (2.0% max).
CBC:	11B-403.3	
Other:	ADA 403.3	

Wilson Park 19784 Wintergreen Avenue Cupertino, CA



3 - 1 Curb Ramp	Category:
Provide surface texture	\$1,000
Notes: Grooved border is 10" wide (12" min).	
CBC: 11B-406.5.11	
Other: -	
Grind or patch vertical change of grade	\$250
Notes: 1/4" change in level at bottom of the c changes in level).	urb ramp (curb ramps must be free from any
CBC: 11B-303.2.3, 11B-405.4	
Other: ADA 405.4	
Provide detectable warnings	\$1,000
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb	ramp is 9.1% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide a level landing	\$90
Notes: Top landing has a slope of 3.6% (2%	max).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
3 - 2 Curb Ramp	Category:
Provide detectable warnings	\$1,000
Notes: No detectable warning provided at ble	nded transition.
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Grind or patch vertical change of grade	\$250
Notes: 2" change in level on one flared side (level).	curb ramps must be free from any changes in
CBC: 11B-303.2.3, 11B-405.4	
Other: ADA 405.4	

3 - 3 Curb Ramp	Category:
Install, replace or modify curb ramp	\$2,460
Notes: Slopes of flared sides are 10.6% and 12.6% 9.6% (8.33% max).	
CBC: 11B-405.2, 11B-406, 11B-406.2.2	
Other: ADA 405.2, ADA 406.1, ADA 406.3	
Provide detectable warnings	\$0
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ramp	is 9.3% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide a level landing	\$0
Notes: The top landing has a slope of 11% (2% ma	ax).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	
3 - 4 Curb Ramp	Category:
Provide detectable warnings	\$1,000
Notes: Detectable warnings not provided.	
CBC: 11B-247.1.2, 11B-406.5.12	
Other: -	
Install, replace or modify curb ramp	\$2,460
Notes: Slopes of flared sides are 12.9% and 23%	(10.0% max).
CBC: 11B-406.2.2	
Other: ADA 406.3	
Provide a level landing	\$2,500
Notes: Counter slope at the base of the curb ramp	is 5.9% (5.0% max).
CBC: 11B-406.5.8	
Other: ADA 406.2	
Provide a level landing	\$0
Notes: The top landing has a slope of up to 4.8% (2% max).
CBC: 11B-406.5.3	
Other: ADA 406.4, ADA 406.7	

4 - 1	Walk	Category:	
Regrade	surface		\$6,640
	Cross slope of concrete path is up to	o 3.8% for 166 linear feet with last 30"	up to
	9.8% (2.0% max).		
	11B-403.3		
	ADA 403.3		
4 - 2	Walk	Category:	
Regrade	surface		\$10,800
Notes:	Cross slope of concrete path is up to	o 3.8% for 270 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
4 - 3	Walk	Category:	
Regrade	surface		\$12,560
Notes:	Cross slope of concrete path is up to	o 4.6% for 314 linear feet (2.0% max).	
CBC:	11B-403.3		
Other:	ADA 403.3		
Grind or	patch vertical change of grade		\$250
Notes:	1" change in level at concrete joint (1/4" max, up to 1/2" with a bevel).	
	11B-303.2		
Other:	ADA 303.2, ADA 303.3		
4 - 4	Walk	Category:	
Regrade	surface		\$1,160
	Cross slope of concrete path is up to	o 4% for 29 linear feet (2.0% max).	
CBC:	11B-403.3	······	
Other:	ADA 403.3		
Grind or	patch vertical change of grade		\$250
	3/4" change in level at concrete joint	t (1/4" max, up to 1/2" with a bevel).	
	11B-303.2		
	ADA 303.2, ADA 303.3		
4 - 5	Walk	Category:	
Regrade			\$9,000
	Cross slope of concrete path is up to	o 4% for 225 linear feet and up to 10.8	
050	linear feet drive (2.0% max).		
	11B-403.3		
Other:	ADA 403.3		

4 - 6	Walk	Category:	
Regrad	e surface		\$6,160
Notes	: Cross slope of concrete path i	s up to 4.8% for 154 linear feet (2.0% max).	
CBC	: 11B-403.3		
Othe	r: ADA 403.3		

City of Cupertino Draft ADA Self-Evaluation and Transition Plan March 2015

Appendix E: Grievance Form

CITY OF CUPERTINO ADA COMPLAINT PROCEDURE

POLICY

Any individual who believes that they have been subjected to unlawful discrimination on the basis of disability by the City of Cupertino, its employee(s), service or program may file a complaint.

A complaint is a formal expression of dissatisfaction with an employee, policy, service or program provided by the City of Cupertino regarding access or discrimination on the basis of disability as defined in the Americans with Disabilities Act of 1990.

PROCEDURE

1. Any individual who believes he or she has been discriminated against on the basis of disability including being denied access to facilities and programs, may make a written complaint as soon as possible after the incident. In order to facilitate the investigation, the complainant is encouraged to submit the complaint within 30 days of the alleged incident(s).

In all cases, complaints must be received in writing and include the location and date the alleged incident occurred. All complaints should be sent to the City Manager's office, City Hall, 10300 Torre Ave., Cupertino, CA 95014, for resolution. A written record of the complaint and the action taken will be maintained by the City. A decision by the City Manager will be rendered in writing within 30 working days. For additional information or assistance, call the City of Cupertino Public Works Department at (408) 777-3354. Copies of this policy are available in large print.

- 2. The complaint shall include:
 - a description of the alleged discriminating activity, policy, program or service;
 - date(s), time(s) and location(s) of incident(s);
 - name(s) of witnesses, if any;
 - complainant's address and telephone number;
 - copies of documents; and
 - remedy desired.
- 3. Upon receipt of a complaint, the City Manager shall cause an investigation of all charges to be made. The investigation shall include interviews with: (a) the complainant; (b) the person(s) responsible for the activity, policy, programs or service engaged in the alleged incident; and (c) any other person believed to have relevant knowledge concerning the complaint.

- 4. Upon completion of the investigation, the City Manager shall review factual information gathered through the investigation to determine whether the alleged complaint constitutes discrimination, giving consideration to all factual information, the totality of the circumstances, including the nature of the activity, program or services and the context in which the alleged incidents occurred.
- 5. The City Manager shall then prepare a written report stating the results of the investigation and the determination as to the action(s) to be taken, if any. The results of the investigation and recommendation(s) shall be conveyed to appropriate persons, including the complainant and the person(s) responsible for the alleged activity, policy, program or service engaged in the incident. The decision of the City Manager is final.
- 6. The complainant's right to a prompt and equitable resolution of the complaint will not be impaired by the complainant's pursuit of the other remedies, such as the filing of a complaint within the Department of Justice of other appropriate federal agency, or the filing of a suit in state or federal court. Complaints to any federal agency must be within 180 days of the alleged discrimination.